



Precision Built Solutions™

HB SERIES FRYER 2300 CONTROL MAINTENANCE MANUAL



Precision Built Solutions™

TABLE OF CONTENTS

1.0 - SAFETY INFORMATION

Safety Information	4
1.01 Mechanical Safety.....	5
1.02 Electrical Safety	6

2.0 - BASIC INSTALLATION

2.1 WHERE TO PLACE YOUR MACHINE

2.11 Foundation.....	7
2.12 Environmental Conditions.....	7
2.2 Unloading Your Machine	7

2.3 RECEIVING YOUR MACHINE

	7
--	---

2.4 UNPACK AND PLACE YOUR MACHINE

	8
--	---

2.5 PRIOR TO THE ARRIVAL OF THE TECHNICIAN

2.51 Installation Safety Instructions.....	8
2.52 Cleaning & Lubricating Machine.....	8
2.53 Line Voltage Check.....	8
2.54 Electrical Precautions.....	8

2.6 LEVELING THE MACHINE

2.61 Leveling Procedure.....	10
2.62 Leveling Procedures for Outriggers	11

3.0 - GENERAL INFORMATION

3.1 MAINTENANCE SCHEDULE CHART

	13
--	----

3.2 MACHINE COMPONENTS

3.21 Axis Lubrication System.....	14
3.22 Electrical System.....	14
3.23 Pneumatic System	15
3.24 Automatic Tool Changer	15
3.25 Spindle	16
3.26 Flood Coolant System.....	16
3.27 Fryer Tool Probe.....	17
3.28 Fryer Part Probe.....	18

3.3 BASIC MACHINE PROCEDURES

3.31 Set Axis Home Position.....	19
3.32 Check Axis Backlash.....	20
3.33 Adjusting Backlash Compensation.....	21
3.34 Working with Waycovers.....	21
3.35 Check / Adjusting Ballscrew Endplay.....	22
3.36 Check Axis Belts.....	22

4.0 - 2300- CONTROL

4.1 ACCESSING MACHINE PARAMETERS.....

	23
--	----

4.2 ACCESSING THE SOFTWARE VERSION.....

	23
--	----

4.3 REVERT TO THE FACTORY SET PASSWORD

	23
--	----

4.4 ADJUSTING INPUT VOLTAGE PARAMETERS

	24
--	----

4.5 M-CODES.....	25
4.6 ALARMS	
4.61 Siemens Alarms	26
4.62 Fryer PLC Alarms and Descriptions	26
4.63 Clearing an Alarm	27
4.7 WORKING WITH FILES	
4.71 File Types	27
4.72 Back-Up A 2300 Archive File to A USB Stick	27
4.73 Reloading an Archive File	27
4.74 Backing Up Tool Data on the 2300 Control	28
4.8 ADDING A SOFTWARE OPTION TO AN 2300 CONTROL	29
4.9 SET UP THE NETWORK DRIVE IN AN 2300	31
5.0 – ARM STYLE ATC OPERATION & MAINTENANCE	
5.1 ELECTRIC ARM TYPE ATC OPERATION & REPAIR	
5.11 Safety Rules -- READ BEFORE OPERATING ATC	33
5.12 Manual Operation of the Tool Changer	33
5.13 Setting Tool Change Height	34
5.14 Recovering from a Tool Change Failure	34
5.15 ATC HOME Position and Tool Bin# Reset	35
5.16 Spindle Orient Adjustment	35
5.17 Arm alignment	36
Control Element Position Explanation Drawing	37
Sequence Diagram of Electric Action	38
Control Circuit Reference Diagram	39
Motor & Switch Wiring Diagram	40
Air Pressure Switch Wiring Diagram	41
Wire Junction Box Drawing	42
Wire Box Drawing	43
Main Assembly Dimensional Drawings	44
DEX–2 Time Chart	45
Adjustment of Arm	46
Power Output Direction Diagram	47
ATC Gear Oil Specifications	48
ATC Repair Procedures	48
ATC Troubleshooting	49
ATC Maintenance	50
5.9 Tool pot replacement procedure	53
5.10 Replace ATC magazine motor	53
5.11 Replace arm motor.....	53
5.12 Cylinder replacement	53
5.13 Induction switch replacement	53
5.14 Replacing proximity switch for tool magazine	53
5.15 Replacing proximity switch for the arm	53
5.16 Notes	53
ATC Magazine Maintenance Points	54

6.0 – DRAWINGS AND PARTS LIST

2300 CONTROL ELECTRICAL PANEL LAYOUT	56
2300 FRONT CONSOLE LAYOUT	57
6.3 ELECTRIC ARM TYPE ATC DRAWINGS & PARTS LIST	58
6.4 ELECTRIC ARM TYPE ATC – INPUT SHAFT DRAWING & PARTS LIST.....	66
6.5 ELECTRIC ARM TYPE ATC – OUTPUT SHAFT & MOTOR DRAWING & PARTS LIST.....	67
6.6 ELECTRIC ARM TYPE ATC – SIGNAL PARTS DRAWING & PARTS LIST.....	68
6.7 ELECTRIC ARM TYPE ATC – ROCKER & IDLER SPROCKET DRAWING & PARTS LIST.....	69
 HB SERIES BASIC COMPONENTS DRAWING	 70
HB-70 BASE ASSEMBLY DRAWINGS & PARTS LISTS	71
HB-70 SADDLE ASSEMBLY DRAWINGS & PARTS LISTS	73
HB-70 TABLE ASSEMBLY DRAWINGS & PARTS LISTS	76
HB-70 COLUMN ASSEMBLY DRAWINGS & PARTS LISTS	78
HB-70 SPINDLE/QUILL ASSEMBLY & PARTS LISTS	81
HB-70 BUILT-IN ROTARY TABLE DRAWING & PARTS LISTS	82

1.0 SAFETY INFORMATION

READ BEFORE INSTALLING OR OPERATING

NOTE: THIS MACHINE IS AUTOMATICALLY CONTROLLED AND MAY START AT ANY TIME.



All CNC machines contain hazards from rotating parts, belts and pulleys, high voltage electricity, noise, and compressed air. When using CNC machines and their components, basic safety precautions, including all appropriate LOTO procedures must always be followed to reduce the risk of personal injury and mechanical damage.

It is the machine owner's responsibility to make sure all personnel who are involved in installation and operation of this machine are thoroughly acquainted with the procedures and safety instructions provided herein *BEFORE* they perform any actual work.

Only Fryer factory-trained service personnel should troubleshoot and repair the equipment.

Do not modify or alter this equipment in any way without first consulting Fryer Machine. Any modification or alteration of this equipment could lead to personal injury and/or mechanical damage and could void your warranty.



EMERGENCY STOP (E-STOP) BUTTON

PRESSING THE EMERGENCY STOP BUTTON WILL INSTANTLY STOP ALL MOTION OF THE MACHINE, THE SERVO MOTORS, THE TOOL CHANGER, AND THE COOLANT PUMP.

1. Keep machine and area around it clean and well lit. Never allow chips, coolant, or oil to remain on the floor. Do not leave loose objects on or around machine.
2. Use appropriate eye and ear protection while operating the machine. ANSI-approved impact safety goggles and OSHA-approved ear protection are recommended to reduce the risks of eye injury and hearing loss.

3. Keep all loose clothing, hair, and jewelry away from the machine at all times.
4. Gloves are easily caught in moving parts. Take them off before using the machine.
5. Always wear safety shoes with steel toes and oil-resistant soles.
6. Do not paint, alter, deface, or remove any warning plates from the machine. Replacement plates are available from Fryer Machine Systems.
7. Keep flammable liquids and materials away from the work area and hot chips.
8. Coolant and oils can make surfaces on the machine slippery. They can also present an electrical hazard if the machine has power on. Therefore, do not stand on any part of the machine at any time.
9. Keep vises, clamps, fixtures, or work pieces from extending beyond the back edge of the table.
10. Check for damaged parts and tools before operating the machine. Any part of a tool that is damaged should be properly repaired or replaced. Do not operate the machine if any component does not appear to be functioning correctly.
11. Improperly clamped parts machined at high speeds/feeds may be ejected and puncture the safety door. Machining oversized or marginally clamped parts is not safe.
12. To avoid tool changer damage, ensure that tools are properly aligned with the spindle drive lugs when loading tools.
13. Windows must be replaced immediately if damaged or severely scratched – contact the factory for replacement panels.
14. Do not attempt to operate the machine before all the installation instructions have been completed.
15. Be sure to review the maintenance section of this manual for instructions to keep your machine running properly.

1.01 Mechanical Safety

1. Always press Emergency Stop when the machine is not in use.
2. Never operate the machine with any cover or shield open or removed.
3. Never reach into the work area when the spindle is turning or if the machine is in automatic mode.
4. Put the machine in manual mode and be sure last programmed function has been completed before reaching inside of the work area.
5. The functions of the machine make it impossible to eliminate all pinch points. Be particularly aware of the following pinch points:
 - a. Spindle and tool rotation
 - b. Indexing of ATC and tools
 - c. Table, saddle, and head.
6. Do not operate machine without axis motor covers or axis waycovers in place.
7. Report any loose, worn, or broken parts to your supervisor. The same action should be taken if any unusual noise or machine action occurs.
8. The electric components are protected from normal moisture resulting from humidity or use of water-based coolants. **DO NOT** however, use a water hose to clean the machine or the area around it.
9. Never touch a machine control device or electrical component when your hand is wet.

10. Never clean up chips while the machine is running or is in automatic mode.
11. Do not file workpieces being rotated under power.
12. At the end of the workday the machine should be placed in "EMERGENCY STOP MODE"
13. When restarting a machine after it has been shut down always assume it has been altered. Recheck all phases of the job as though you were running the first piece.
14. Never run the spindle until hands, feet, and body are well clear of the work area.

1.02 Electrical Safety

1. **WARNING:** Electrical enclosures contain high voltage. Disconnect equipment from power source before opening cabinets.
2. **Before replacing a fuse, switch off the machine.**
3. ***Immediately turn off power if:***
 - Power problems develop
 - In the event of electrical storms.
 - Ambient temperatures exceed 105 degrees Fahrenheit (40 degrees C)
4. The electrical power must meet the specifications in this manual. Attempting to run the machine from any other source can cause severe damage and will void the warranty.
5. The electrical panel should always be closed and locked except during service.
6. When the main circuit breaker is on, there is high voltage throughout the electrical panel and some components operate at high temperatures, therefore extreme caution is required.
7. Do not reset a circuit breaker until the reason for the fault is investigated.
8. Never service the machine with the power connected.

2.0 BASIC INSTALLATION

2.1 WHERE TO PLACE YOUR MACHINE

Thank you for choosing Fryer Machine Systems. You have purchased a high quality, custom crafted machine tool designed and built to provide years of trouble-free service. To ensure that your machine is properly installed we ask that you review the following information prior to the shipment of your machine.

2.11 Foundation

Your foundation must be a minimum 6“(150mm) thick concrete slab floor and should be placed on a single slab with no seams. Be sure to leave space around the machine for leveling components and access to the electrical cabinet.

If your floor does not meet these specifications, contact the factory for further recommendations.

Install the machine on the first or second floor. Take the stress of ceiling and foundation into careful consideration to ensure that the machine load can be offset.

2.12 Environmental Conditions

Generally, the machine will be installed in the following conditions. However, these may change over a period of time or in response to seasonal changes.

- Supply voltage: +/- 10% of voltage listed on serial number tag.
- Source frequency: ± 2 Hz of frequency listed on serial number tag
- Temperature effects dimensional accuracy, therefore, ambient temperatures should not exceed 105 degrees Fahrenheit. Also avoid exposing the machine to direct sunlight or heat rays which can change the environmental temperature.
- Relative Humidity: Less than 80% (Temperature changes should not cause condensation)
- Atmosphere: Free from excessive dust, fumes, corrosive gases, and salt
- Avoid exposing the machine to abnormal vibration.

2.2 UNLOADING YOUR MACHINE

Fryer machines are shipped on skids designed for forklift offloading. Be sure your forklift is rated for the proper weight of the machine.

Note: If you are using a crane for offloading, please contact the factory in advance for instructions as damage can occur if supported in the wrong locations.

2.3 RECEIVING YOUR MACHINE

NOTE: If you have a door that is less than 8' wide x 10' high, please contact the factory prior to shipment so that we can make sure your machine is packaged to fit into your door openings.

1. Fryer machines are carefully packed to avoid damage in transit; however, we ask that you **UNWRAP AND INSPECT YOUR MACHINE AS THOROUGHLY AS POSSIBLE PRIOR TO SIGNING THE BILL OF LADING**. If a digital camera is available, pictures should be taken before the machine is moved further. Pictures should be sent to service@fryermachine.com.
2. Place the machine in its location and complete inspection. If there is any damage to your machine, Fryer should be notified immediately. This will enable us to provide replacement parts before the service technician arrives install the machine.
3. If you have any questions about any of these installation instructions or other questions about your new Fryer Machine Systems machine, please call the Fryer Service Department and one of our trained technical staff will be happy to assist you.

2.4 UNPACK AND PLACE YOUR MACHINE

To make certain that your machine installation goes smoothly, it is important that the following items are completed **prior** to the arrival of the Fryer authorized service technician. This will ensure that our technician is able to provide you with the maximum amount of training during his allocated time with you.

1. Have your rigger move the machine to the operating location, remove it from the skid and install on ALL leveling pads.
2. Remove all packaging material and thoroughly clean the machine and inspect for hidden damage.
3. Remove all large assemblies from skids and stage next to machine to facilitate ease of assembly.
4. Install leveling pads and level machine. Level with a precision level, using the leveling screws and pads provided with the machine.

2.5 PRIOR TO THE ARRIVAL OF THE TECHNICIAN

2.51 Installation Safety Instructions

Initial start-up of the machine must be performed by a Fryer Machine Systems authorized service technician.

2.52 Cleaning & Lubricating Machine

All protective coatings (cosmoline) must be removed before using the machine.

Be cautious when selecting a suitable cleaning agent. Paraffin applied with a clean brush will soften the protective coating. The protective coating can then be removed with clean rags.

- WD-40 or a similar product is recommended for cleaning the machine. Do not use gasoline or any other flammable solution to clean the machine.
- Clean all exposed ways of the bed and saddle.

2.53 Line Voltage Check

Line voltage must be $\pm 10\%$ of the voltage listed on the serial number tag.

**INITIAL POWER-UP SHOULD ONLY BE PERFORMED BY
A FRYER TECHNICIAN OR FACTORY AUTHORIZED
REPRESENTATIVE.**

2.54 Electrical Precautions

ELECTRICAL SCHEMATICS FOR YOUR MACHINE ARE LOCATED IN THE ELECTRICAL CABINET AND IN THIS MANUAL.

Wiring

1. Ensure that all local electrical codes are met.
2. Do not connect to the power distribution panel any power cables for devices that can cause line noise, such as welders and high frequency quenching machines.

Grounding

You should always refer to your local electrical code to be sure you are grounding to code. Generally, use a grounding

wire with a cross section of more than 14 mm and a resistance to ground of less than 100 ohms. This wire size should be greater than AWG (American Wire Gauge) No. 5 and SWG (British Legal Standard Wire Gauge) No.6.

Generally, the machine should be grounded to a separate grounding rod. If an independent ground cannot be provided for the machine, prepare the ground connection as follows:

1. Connect a single conductor to its own grounding terminal. This will avoid possible serious accidents resulting from ground currents that might otherwise flow in the NC machine if a peripheral device should malfunction.
2. Be careful when using concrete reinforcing rods as grounding points. These reinforcing rods often are used to ground equipment because they usually offer a resistance to ground of less than 100 ohms. In doing so, make the connection as follows: (This also applies to connecting ground wires to regular grounding terminals)
3. Do not use the same grounding reinforcing rod or grounding terminal for other devices since this could lead to line noise such as produced electric welders and high frequency quenching machines.
4. Use a grounding terminal with an adequate electrical performance rating and which is durable.
5. A separate grounding wire should be used, one whose length is as short as possible.
6. Check the resistance to ground by actual measurement.
7. This should measure less than 100 ohms if the single device is connected to its own grounding rod.

Desirable Independent Grounding: Earth resistance: Less than 100 ohms **Common Grounds:**

Resistance to ground = $100 / \text{the number of devices connected to the grounding } (\Omega)$

NEVER GROUND EQUIPMENT IN SERIES!

Connection of Power Line

<p>NOTE: Electrical installation should only be completed by a qualified electrician.</p>
--

1. Make sure that the incoming power is compatible with the requirements of the machine tool (voltage, amperage, phasing). All this information can be found on the machine's serial number tag.
2. Power wires, grounding and over-voltage protection should comply with the local electrical code.
3. **DO NOT** connect if the incoming power is different from the power requirements of the machine. Contact a qualified electrician.

2.6 LEVELING THE MACHINE

Before attempting to use the machine, it will be necessary to accurately level it.

- Screw the leveling bolts (with nut) into the holes in the base of the machine. Set a leveling pad under.
- Please prepare the following tools to adjust machine level:
 - Precision level (0.0005"/ft. or 0.013mm/1000mm accuracy)
 - Two adjustable wrenches
- Clean the bed way and cross slide surfaces thoroughly and set one of the precision levels on the flat bed way in the longitudinal direction, and the other on the cross slide, perpendicular to the first (if there is only one level available, then use it on both directions alternately).
- Adjust the leveling bolts located the bottom of the machine base until the machine is leveled to within 0.001"/ft. (0.08mm/1000mm) in both directions.
- Lock the nuts on the leveling bolts, and re-check to see whether the level of machine is still correct. Repeat as necessary until machine level is obtained with leveling bolts locked.
- After initial installation, check the level once a week for the first month, then check monthly thereafter.

2.61 Leveling Procedure

Step 1

- Set up your precision level in the middle of the machine table parallel to the X-axis.
- With the table centered in the X and Y-axis, adjust the machine's four outside leveling studs to achieve level.
- Be sure that the center leveling pads are not touching and that all four outside pads have load.
- Also check to make sure that the machine casting is not touching the floor.



Step 2

- Now rotate the level 90 degrees so it is parallel to the Y-axis and again check level.
- Adjust the four outside leveling studs as needed.
- If any adjustments are required to achieve level, you must go back and re-check level with the level parallel to the X-axis.
- Repeat the adjustment process until the machine is perfectly level with the level parallel to both axes without further adjustment.



Step 3

- Adjust the center leveling studs until they are just touching.
- Again, verify the machine is level with the level parallel to both axes without further adjustment.

Step 4


- With the level parallel to the X-axis, slowly move the table back and forth over full Y-axis travel check to see that the level does not change. Make any required adjustments to achieve level.

Step 5

- Re-center the table in the Y-axis and again verify that the machine is level with the level parallel to both axes.
- Check that all leveling pads have some degree of load.
- Lock the nuts on the studs once the correct level is achieved.

Step 6

- The final check is “tramping” of the head. This is accomplished by mounting the indicator base on the spindle nose and setting the indicator tip on the tabletop at position “0” shown below. Properly load the indicator tip and zero the indicator at position “0”. Sweep the indicator tip by rotating the spindle manually over a 12” diameter circle. The indicator should show no more than .0005” total indicator reading. Record the values found at positions 1, 2, and 3.

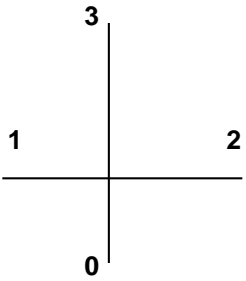	TABLE SWEEP		<u>.0005” OVER 12” DIAMETER IN X-Y AXIS</u>	1.
				2.
				3.

2.62 LEVELING PROCEDURES FOR OUTRIGGERS

Note: For added rigidity and better machine performance Fryer Machine Systems recommends that the machine itself and the right and left outriggers be securely bolted to the floor of your facility.

1. Perform the basic leveling procedure above.
2. After the machine is leveled, place the outriggers into position. The two outriggers as well as the four locating brackets will be marked left, right, front and rear.
3. The two outriggers should be placed under the saddle supports but should not make contact with the linear roller bearing. Each bearing on the saddle support is on a separate tapered way.
4. To start, push the roller bearings as far in toward the center of the saddle support as possible while still being able to securely tighten the lock nut on the threaded rod. By doing this, it will give you as much adjustment as possible to eliminate any table rock that might occur when the table is moved from side to side.
5. Move the X axis into the middle of its travel. Place a .002” piece of shim stock in between the roller bearing and the outrigger way.

6. Slowly raise the outrigger with the leveling bolts until there is some friction between the shim and the roller bearing. Be sure to keep the outrigger running parallel with the Y axis. This can be checked by placing an indicator base on the saddle with the needle on the way of the outrigger and running the Y-axis back and forth over the full travel. **THIS STEP MUST BE PERFORMED TO PREVENT SERIOUS DAMAGE.**
7. After you have some friction between the shim and the roller bearing remove the shim.
8. Using two indicators, place one on the front of the saddle and the other on the rear of the saddle making sure the needles are on the outrigger way.
9. Move the X axis from the middle of the travel to the end of the travel.
10. The indicators show the amount of table rock. Adjust the table rock by pulling the roller bearings out towards the front and rear of the machine. This will put more pressure between the outrigger way and the roller bearing. Make small adjustments and re-check the table rock after each adjustment until the table rock is between .002" and .004".

If you find that you cannot adjust the bearing enough to achieve the desired number, you can also raise the outrigger with the leveling bolts some more. (Be sure to keep the outrigger running parallel with the Y-axis.)

After these steps are completed, you should be able to move the axes around easily. We recommend that some grease be applied the way surface to lubricate the roller.

3.0 GENERAL INFORMATION

3.1 MAINTENANCE SCHEDULE CHART

***FOR FURTHER MAINTENANCE DETAIL, REFER TO THE MACHINE COMPONENT SECTIONS IN THE MANUAL LISTED BELOW.**

CAUTION! Always follow all Lock Out / Tag Out procedures before performing any maintenance

MAINTENANCE ITEM	RECOMMENDED	Daily	Weekly	6 Mo	As Required
Check air pressure gage	90 – 125 PSI	X			
At the end of the day remove and dispose of chips	Use of brush or vacuum is recommended. Do not use air as it can push chips into waycovers and ballscrews.	X			
Check axis lubrication pump oil level	See Section 3.201 – Use Mobil Vactra #2 (ISO 68) or equivalent	X			
Clean chips from interior of ATC	See Section 3.204 for details		X		
Check pneumatic (air) lubrication oil	Add Mobil ALMO break free synthetic air tool oil (5W-10W)		X		
Check coolant level	Complete a visual inspection		X		
Check machine level	See Section 2.61 for details			X	
Check axis backlash	See procedure in Section 3.43			X	
Remove and clean underside of waycovers / check sliders and bumpers for wear and/or damage	See Section 3.44 for details			X	
Check wipers for adjustment / damage	See Section 3.44 for details			X	
Check ballscrew endplay	See procedure in Section 3.45			X	
Check axis motor belts	See procedure in Section 3.46			X	
Grease ATC cam pockets	See Section 3.24 for details			X	
Change coolant	Blasocut BC40 NF-PL or equivalent				X
Check and change electrical cabinet air filters	Use Purolator A23465 air filters				X
Change ATC gearbox oil	Mobilgear 600XP 150, Shell Omala EP 150-220 or equivalent				Yearly
Chiller fluid	Oil Chiller: VG-32 Oil				Yearly

3.2 MACHINE COMPONENTS

3.21 Axis Lubrication System

- The automatic way lube system is controlled by the PLC in the control. The system only pumps way oil when the spindle and axes are moving. If there is no machine movement the pump will not pump unnecessary oil. This method greatly reduces way lube usage and keeps oil out of the machine coolant sump and prevents fouling.



For illustrative purposes only. Your specific machine's lubrication pump may be different.

- If the machine has been unused for more than 48 hours press the blue pushbutton on the side of the lube tank for approximately 30 seconds to pump oil to the ways. The pressure gage on the tank will indicate if it is working properly.
- If the system detects low way lube it will display the following message in the control: **700040 - WAY OILER PRESSURE FAULT**


3.22 Electrical System

- Schematics (1) – The Electrical and Pneumatic Schematics are inside electrical cabinet
- Cabinet Filter Type (2) – Purolator A23465 or equivalent
- Check Filter Interval - Weekly
- Change Filter Interval – As Required (depending on environment)



3.23 Pneumatic System

- Pneumatic Schematics for your machine are located in electrical cabinet door pocket(see previous page)
- A list of the different solenoids and pressure settings is located on a sticker where the solenoids are located.
- Some of the basic solenoids are listed below:
 - Air Gun
 - Air Pressure Switch
 - ATC Tool Pot Up
 - ATC Tool Pot Down
 - Drawbar Solenoid
 - Spindle Air Blast (Option)
 - Spindle Bearing Purge (Option)
 - 4th Axis Brake (Option)
 - Spray Mist (Option)
 - Glass Scale Air Purge (Option)
 - Programmable Air Blast (Option)
 - 4th Axis Tailstock Brake (Option)

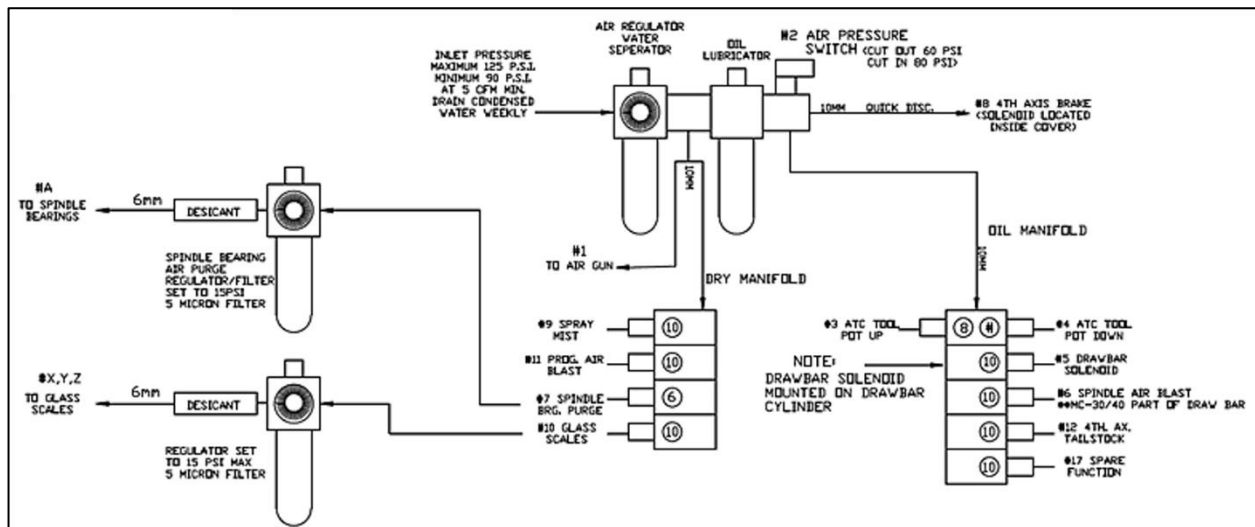

- Lubrication Requirements – Mobil Almo break free synthetic air tool oil 5W-10W or equivalent
- Check Lubrication Interval – Weekly – Add as needed

3.24 Automatic Tool Changers – Arm Style

50 Taper 24, 40 & 60-Position Arm Style Tool Changer

- Maximum Tool Diameter – 5"
- Maximum Tool Diameter with adjacent positions empty – 8.9"
- Maximum Tool Length – 11.8"
- Maximum Tool Weight – 35.25 lbs.
- Tool Change Time: 4 seconds

3.25 Spindle Information

Thermal expansion of the machine components can jeopardize machining accuracy. To prevent this condition always warm the machine up.

SPINDLE WARM UP – Use the chart below for daily startup

Warm Up Cycle	10 minutes @ 25% of maximum speed
	10 minutes @ 50% of maximum speed
	10 minutes @ 75% of maximum speed

SPINDLE DUTY RATING – Follow the duty rating outlined below for **6K, 8K & 10K RPM Spindles**

- If it is required for the spindle to run continuously (24 hours a day), the spindle must not run above 80% of the maximum RPM.
- If it is required for the spindle to run at maximum RPM, the spindle must not run more than 2 hours straight. After 2 hours of run time at maximum RPM, the spindle must be slowed down to 50% of the maximum RPM for at least 30 minutes before running at the maximum RPM again.

3.26 Coolant Systems

Flood Coolant - Standard

The standard flood coolant system consists of a submersible flood pump mounted on the coolant tank, generally at the rear of the machine. The flood line runs up the back of the column and through the Z-axis cable track. It splits at a y-fitting in the headstock where it runs to two separate lengths of loc-line. It flows a maximum of 9 GPM.

Coolant Thru Spindle Systems (optional)

- Available for 50 taper spindles.
- The 350 PSI System has an adjustable range of 100 to 350 PSI. Features full pressure even with tool coolant holes up to .200" diameter.
- The 1,000 PSI System has an adjustable range of 300 to 1,000 PSI. Features full pressure even with tool coolant holes up to .100" diameter.
- Both systems includes high volume 8 gallon / minute pumps and a 10-micron replaceable filter cartridge.
- Machines with this option include a top cover on the machine.

High Pressure Washdown System & Washdown Hose (optional)

- Washdown system consists of one high volume submersible pump. For larger machines, may use two of these pumps.
- On the output of the pump is a T-fitting one line feeds the washdown hose and the other line feeds the washdown nozzles inside the enclosure.
- A ball valve is located between the line that feeds the hose and the line that feeds the nozzles so volume of flow can be adjusted when using both the nozzles and the hose at the same time.

**Do not deadhead the pump by shutting off the pump's ability to discharge fluid.
Components in the pump can heat to the point that they will severely damage the pump.**

OPTIONAL AUTOMATIC TOOL SETTERS AND PART PROBE SYSTEMS

FRYER, RENISHAW and MARPOSS

Calibration for the Fryer Tool Probe & Part Probe are described below. For Renishaw and Marposs Systems, see the Manufacturers' Manuals.

3.27 Fryer Tool Setter (Tool Probe)

The Fryer Tool Probe can only be used to automatically measure tool length. It cannot be used to measure tool diameter or radius. Optional tool setting probes are available to perform length and diameter or radius measurements.

Tool Setter Calibration

If you ordered the tool probe during the original build of the machine it will have already been mounted to the machine table and tested at the factory. However, it must be calibrated before using it to set up your tool length offsets.

1. Install the tool probe in the reamed hole in the table and make sure that it is plugged in.
2. Set up a tool holder with a 1/2" dowel pin installed.
3. Use the **NEW TOOL** key to create the setup tool in the tool library as a 1/2" tool using the default name **CALIBRATION TOOL**.



10		CALIBRATION TOOL	1	1	0	-18.5250	0.5000		
----	--	------------------	---	---	---	----------	--------	--	--

4. Complete a tool change to this tool so that it will be active in the control.
5. Set a negative tool length offset for the **CALIBRATION TOOL** by measuring the distance from the tip of the dowel (while Z is at machine zero) to the top of the table surface.
6. Make sure your active work offset is zero in the Z-Axis.
7. Use paper, shim stock, or a gauge block to touch the dowel to the table.
8. Press **MEASURE TOOL** key
9. Press **LENGTH MANUALLY** key
10. Select **WORKPIECE**
11. Type the thickness of the paper, shim, or gauge block into Z0
12. Press **SET LENGTH** key

Now position the dowel approximately 1/4" above the probe in Z and roughly over the center of the probe

1. Select **MEASURE TOOL**
2. Select **CALIBRATE PROBE**
3. Select **LENGTH ONLY**
4. Press **CYCLE START**
5. The tool will move down in the Z axis and touch the top of the probe.
6. Once finished the tool will move back up.
7. Select **BACK** twice to exit the calibration screen and go to the **MANUAL** screen.

Calibration is now complete.



3.28 Fryer Part Probe

The Fryer Part Probe can only be used to automatically measure X and Y axis positions. It cannot be used to measure in the Z axis. Optional part probes are available to perform 3-axis measurements.


If you ordered the part probe during the original build of the machine it is located in the tool library where manual tools are stored. However, it must be calibrated before using it to set up your work offsets.

Fryer Part Probe Calibration

1. To set up a new FRYER probe in the tool table, it needs to be in the manual tool location in the library. It is important to remember your probe is wired which is manually inserted and removed the tool from the spindle.
2. Define the tool as a **3D probe**. When adding the new tool, you will need to press the **other** button to access the **3D** tool option. It is important that you fill out the correct tool diameter.

	3D_PROBE	1	1	0	-20.5340	0.3938	
---	----------	---	---	---	----------	--------	--

3. Load the probe into the spindle. Make sure the control recognizes the probe.
4. A ring gage is required for this next step. (A 2" diameter gage is recommended).
5. If a different diameter is required, change parameter **MD51770** to change diameter dimension. Refer to Section 4.1 for directions to access parameter screens.
6. Mount the gage to the machine table and use an indicator to find the center of the gage.
7. Once in the center, set a work offset in the middle. Make sure the offset is called up in the control.
8. Position the part probe at X and Y zero (middle of the gage). The Z axis should be roughly 1/4" below the top of the ring gage.
9. Select **WORKP. ZERO**
10. Select **CALIBRATE PROBE**
11. Select **DIAMETER**. The diameter value must equal the diameter of your gage.
12. Press **CYCLE START**. Once complete the probe should be calibrated in the X and Y axis.
13. At this point the part probe is calibrated and ready for use.
14. Remove the ring gage and store it in a safe place.

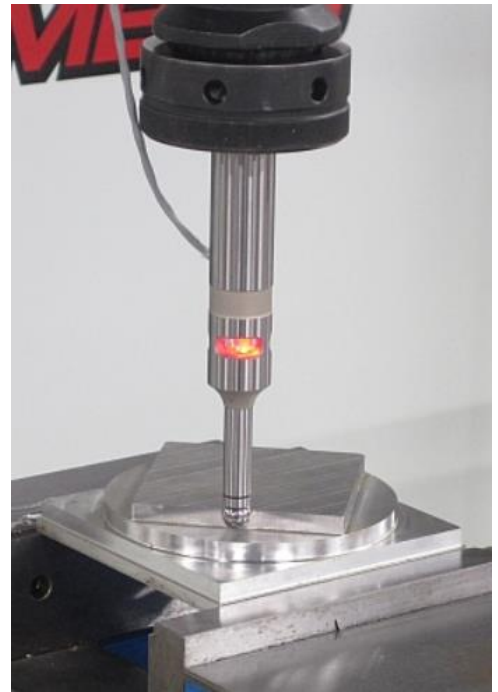



3.3 BASIC MACHINE PROCEDURES

3.31 Setting Axes Home Positions

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

The 2300 control comes standard with absolute encoders which generally do not require homing. However, if you have an issue with the battery or the machine is not turned on for an extended length of time the machine may need to be re-homed according to the following procedure. In addition, if an axis motor is removed or there is an issue with a motor coupling or pulley / belt assembly, one or more axes may need to be re-homed.

- Refer to Section 4.1 for directions to access parameter screens.

1. Press 
2. Select **SETUP**
3. Select **MACHINE DATA**
4. Select **AXIS MD**
5. Select **SEARCH**
6. Enter **34210 [0]** in the search field (This will read **ENC_REFP_STATE**)
7. Select **OK**
8. Select the proper axis with the **AXIS + AND AXIS –**
9. Change the parameter **34210 [0] to 0** for an axis with a motor encoder
10. Change the parameters **34210 [0]** and **34210 [1] to 0** for an axis with a scale
11. Press **INPUT**
12. Cycle power to machine leaving it off for a minimum of 30 seconds
13. **Take extreme caution now as the machine can be crashed!**
14. Line up the home markers for all axes that need to be homed
15. Press the **E-STOP** button to turn off the servos
16. Press 
17. Select **SETUP**
18. Select **MACHINE DATA**
19. Select **AXIS MD**
20. Select **SEARCH**
21. Enter **34210 [0]** in the search field (This will read **ENC_REFP_STATE**)
22. Select **OK**
23. Select the proper axis with the **AXIS + AND AXIS –**
24. Make sure Parameter **34210 [0]** and **34210 [1]** (if axis has a scale) **are set to 0**. If it is not, it is probable that the wrong axis is selected.
25. Change the parameter **34210 [0] to 1** for an axis with a motor encoder
26. Change the parameters **34210 [0]** and **34210 [1] to 1** for an axis with a scale
27. Press **INPUT**
28. Turn the feed rate override all the way down
29. Pull the **E-Stop** button out
30. Select **RESET**

31. Press **HOME RETURN** (should say Jog Ref at the top of the screen)
32. For a mill, press **AXIS+** (refers to the hard key on the manual panel you have selected)
33. When done make sure parameter **34210 [0]** shows **2** for all axes (axis with motor encoder)
34. When done make sure parameter **34210 [0]** and parameter **34210 [1]** shows **2** for all axes (axis with scale)

3.32 Check Axis Backlash

Tools Required: 0.0001" resolution dial indicator, remote handwheel (manual pulse generator)

- Set the indicator along the axis which is being measured. The needle should be in contact with a flat machined surface and the base on a stable, fixed point. See the pictures below which illustrate the setup for the X, Y, and Z axes.
- Using the remote handwheel, move the axis in one direction either positive or negative until the indicator is loaded by 0.002".
- Zero the indicator.
- Move the axis in the same direction by 0.005".
- Reverse the direction of the axis by 0.005".
- The additional amount that is needed to reach zero after the 0.005" reverse in direction is the backlash measured.
- This shows the loss of motion in the axis from the ballscrew and linear guide rails. Backlash compensation can be adjusted according to the procedure outlined below in *Section 3.33*.

X-Axis



Y-Axis




Z-Axis



3.33 Adjusting Backlash Compensation

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

- Refer to Section 4.1 for directions to access parameter screens.
- Press 
- Select **SETUP**
- Select **MACHINE DATA**
- Select **AXIS MD**
- Using **AXIS+ AND AXIS-**, select the correct axis
- Select **SEARCH**
- Enter **32450 [0] or 32450 [1]** if the machine is equipped with glass scales on the selected axis
- Adjust the backlash on each axis
- Select **SET MD ACTIVE (cf)**
- Select **RESET (po)** to reboot the control

3.34 Working With Waycovers

- When working with steel waycovers, several precautions must be taken:
- Do not put excessive weight on the waycovers (50lbs. max.)
- Protective gloves should be worn while handling waycovers, as the metal edges can be sharp.
- Covers should be cleaned regularly to avoid any build-up of chips or debris. It is recommended that the underside of the covers be thoroughly cleaned at least every 6 months.

To remove the waycovers for service:

- Jog the axis being worked on so that the cover to be removed is in the fully compressed position.
- Next, remove the cap head screws attaching the cover to the moving axis and to the waycover standoff (if applicable).
- The waycover can now be removed by simply pulling it off the way surface.

To check waycovers for wear and/or damage:

- Make sure the covers slide open and closed freely and that there are no dents or visible damage that would impair free movement of the covers.
- Inspect the plastic sliders and rubber bumpers under the waycover to make sure they are in place and not damaged or worn.

To reinstall the waycovers on the machine:

- Slide the cover on the appropriate way surface making sure that it is clear of debris.
- Insert the cap head screws to the moving axis and the standoffs (if applicable) and **hand tighten only**.
- To properly align the waycover, jog the axis to the position where the waycover is in full extension, and then full compression.
- With the waycover fully compressed, all cap head screws can now be tightened.
- Run the axis back and forth slowing over full travel check for any visual signs of misalignment.
- Now rapid the axis back and forth over full travel again check for any signs of misalignment.

3.35 Check / Adjusting Ballscrew Endplay

* It is important to read and understand the procedure 3.34 *Working with Waycovers*, before executing this procedure.

- Tools Required: 0.0001" resolution dial indicator, remote handwheel (manual pulse generator), metric allen key set, spanner wrench.
- Check Endplay: You will need to access the pulley end of the ballscrew for the axis being worked on. To do this, remove the left side waycover and the belt cover for the X-axis. Remove the front waycover and belt cover for the Y-axis. The top end of the z-axis ballscrew is accessible by just moving the head down. Place a dial indicator needle on the end of the ballscrew. Load and zero the indicator appropriately. Using the remote handwheel set to x100 for the appropriate axis, change axis direction back and forth and observe any axial motion shown on the indicator. Endplay should be no more than .0001". This can also be accomplished by jogging each axis using the manual panel buttons or manually by using an allen wrench on the end of the ballscrew.
- Adjusting Endplay: If ballscrew endplay is greater than 0.0001", it must be adjusted. To do so, loosen the 3 set screws on the ballscrew spanner nut adjacent to the motor coupling. Using a spanner wrench, tighten the nut. The ballscrew will have to be held stationary with an allen key on the opposite end. Tighten the set screws and recheck the endplay. Repeat the tightening procedure if necessary. Once the ballscrew endplay is .0001" or less, re-install any sheet metal or motor covers and re-install the waycover(s) as applicable.

3.36 Check Axis Motor Belts – **if equipped**

- The axis motors are connected to the ballscrews via pulley driven belts. Belts should be checked for excessive wear and proper tension at least every 6 months.
- To access the belts, remove left side belt cover for the X-axis and the front belt cover for the Y-axis.
- The Z-axis belt is located on the top of the column
- Once you have gained access to the belts, inspect them for any visible signs or wear or damage. Once the belts are considered acceptable, check each belt for proper tension.
- Belt tension is adjusted by loosening the slotted motor plate and sliding the motor-plate assembly to tighten or loosen the belt as required. Double check all hardware is properly tightened once the belt tension is correct.
- After the inspection is complete and any adjustments made, re-install the belt covers.

4.0 2300 CONTROL

4.1 ACCESSING MACHINE PARAMETERS


PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

WARNING

Malfunctions of the machine as a result of incorrect or changed parameter settings


As a result of incorrect or changed parameterization, machines can malfunction, which in turn can lead to injuries or death.

- Protect the parameterization (parameter assignments) against unauthorized access.
- Handle possible malfunctions by taking suitable measures, e.g. emergency stop or emergency off.

1. Press 
2. Select **SETUP**
3. Select **MACHINE DATA**
4. Available folders: **GENERAL MD / CHANNEL MD / AXIS MD**


4.2 ACCESSING THE SOFTWARE VERSION

To find out the version of the software you are running on your 2300 control:

1. Press 
2. Select **DIAGNOSIS**
3. Select **VERSION**
4. The Software Version number is on the first line and will read: **"V##.## + SP ## + HF ##"**

4.3 REVERT TO THE FACTORY SET PASSWORD

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

1. Press 
2. Select **SETUP**
3. Select **SET PASSWORD**
4. Enter the password: **SUNRISE**
5. Press **OK**
6. The lower part of the screen should now read "Current Access Level: Manufacturer"

4.4 ADJUSTING INPUT VOLTAGE PARAMETERS

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY


The Siemens control will shut itself off if the line voltage is more than 10% different than the voltage set in the control. You must adjust the parameter to match your line voltage to the machine.

The first step to accurately measure your line voltage. There are two ways to do this.

- Measure the incoming line voltage across all three legs with a voltmeter. Average your readings and write down the value.


- OR -


- Read the line voltage from the control, follow the following steps:

- Press 
- **SETUP** key
- **INFEED PARAMETER** key
- Find **r25[0]** = and write down the voltage value in this parameter.

- Now you have the proper line voltage value to enter in the control.

Follow the steps below:

- Press E-stop
- Press 
- **SETUP** key
- Press **Λ** (up arrow hard key next to machine hard key)
- **DRIVE SYSTEM** key
- **SUPPLY** key
- **POWER DATA** key See screen below:

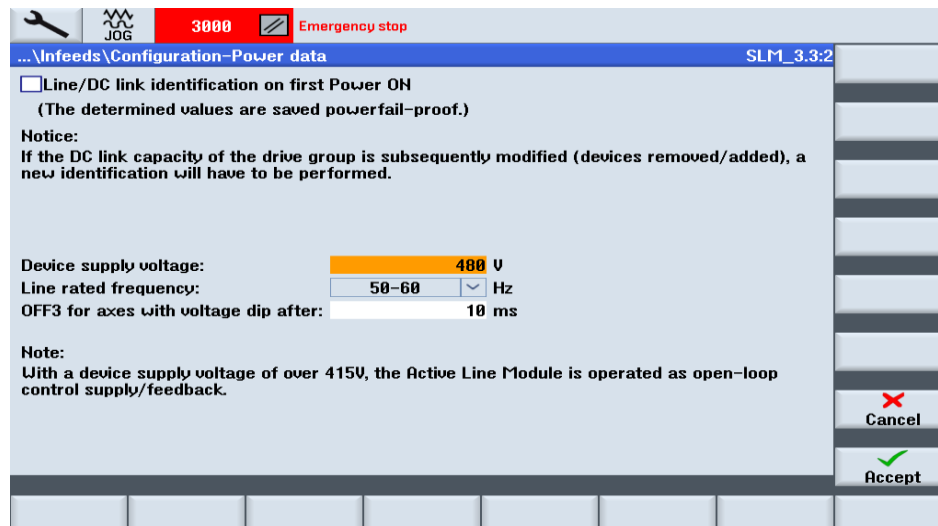

- Scroll down to the **Device Supply Voltage** field like in the screen shot above. Enter the line voltage value you obtained in the previous steps, press enter
- Press **ACCEPT** key

There will be a message that states, "Confirm You Want to Change the Parameter", Press **YES** key to accept the change.

4.5 M-CODES

An M code in CNC programming controls miscellaneous machine functions, including starting and stopping specific actions or programs.

M00	PROGRAM STOP
M01	OPTIONAL PROGRAM STOP
M02	END OF PROGRAM
M03	SPINDLE CLOCKWISE
M04	SPINDLE COUNTERCLOCKWISE
M05	SPINDLE STOP
M06	TOOL CHANGE REQUESTED
M07	MIST COOLANT OUTPUT (SPINDLE MAY HAVE TO BE ON)
M08	FLOOD COOLANT (SPINDLE MAY HAVE TO BE ON)
M09	COOLANT (FLOOD AND MIST) OFF
M10	INDEXER CYCLE START WAIT FOR COMPLETION
M11	MISC. MCODE M11=ON
M12	MISC. MCODE M12=OFF
M13	AXIS BRAKE ON
M17	HIGH PRESSURE THRU SPINDLE COOLANT ON
M18	HIGH PRESSURE THRU SPINDLE COOLANT OFF
M19	SPINDLE ORIENT
M20	CHIP AUGER ON
M21	CHIP AUGER REVERSE
M22	CHIP AUGER OFF
M23	PROG. AIR BLAST ON
M24	PROG. AIR BLAST OFF
M25	URNS ON PART PROBE
M26	URNS OFF PART PROBE
M30	END OF PROGRAM
M40	SHIFT GEARBOX INTO LOW RANGE
M41	SHIFT GEARBOX INTO HIGH RANGE
M52	ATC POT DOWN
M53	ATC POT UP
M54	DRAWBAR ON
M55	DRAWBAR OFF
M58	ATC CW 1 POSITION
M59	ATC CCW 1 POSITION
M61	HOME ATC TO POCKET 1, ASSUMES "TOOL 0" IN SPINDLE
M62	ARM ATC GRAB TOOL (ON ELECTRIC ATC ALSO SWAPS TOOLS AND GOES UP)
M63	ARM ATC ARM ORIGIN
M64	PNEUMATIC ARM ATC ARM DOWN AND SWAP TOOLS
M65	PNEUMATIC ARM ATC ARM UP


Note: M-codes may change depending on options the machine is equipped with.

4.6 ALARMS

An alarm will be displayed once a fault occurs.

! Warning: If you do not heed an alarm that is issued and do not resolve the cause of the alarm, it can present a hazard to the machine, the work piece, the saved settings, and in certain circumstances, may cause injury.

4.61 Siemens Alarms

1. If a familiar alarm number / description appears carefully check the machine and resolve the cause of the alarm.
2. If you are unfamiliar with the alarm in question, proceed to the alarm list as follows:
 - a. Press 
 - b. Select **DIAGNOSTICS**
 - c. Select **ALARM LIST**
3. *Once "**ALARM LIST**" has been selected, press **HELP** key and additional information will be provided on the control screen.

4.62 Fryer PLC Alarms and Descriptions

There are certain PLC alarms in the 700000 range which are not in the **HELP** screen. These are **FRYER** Machine specific alarms that are for optional equipment installed on the machine. The alarms are listed below:

700000	ATC CAROUSEL NOT REFERENCED: EXECUTE M61
700001	LOW WAY LUBE [I32.6]
700002	LOW AIR PRESSURE [I32.2]
700003	HOME REQUIRED! PRESS CYCLE START
700004	PROBE ERROR / SIGNAL LOSS
700005	GEAR CHANGE FAULT
700006	SPINDLE OUT OF GEAR
700008	CHILLER FAULT
700009	HYDRAULIC PRESSURE FAULT
700011	THRU SPINDLE COOLANT FAULT, CHECK COOLANT SUPPLY
700013	EMERGENCY STOP PRESSED DURING TOOL CHANGE
700014	COUNTER-BALANCE CYLINDER PRESSURE LOW!
700016	CAROUSEL CANNOT INDEX POT NOT RETRACTED
700024	M52-TOOL POT DOWN TIMED OUT
700025	M53-TOOL POT UP TIMED OUT
700026	M69 CAUSED SERVO OFF
700027	M62 TIMED OUT CHECK TC HEIGHT, ORIENT, THERMAL MCATC
700028	M63 TIMED OUT CHECK THERMAL MCATC
700029	M54 DRAWBAR ON TIMED OUT
700030	M55 DRAWBAR OFF TIMED OUT
700032	CONTOUR HANDWHEEL ACTIVE
700033	Z MOTION AND ATC ARM NOT AT HOME POSITION
700034	RESET SUPPRESSED UNTIL TOOL CHANGE COMPLETION
700035	HOME RETURN: DEPRESS CYCLE START
700037	REPLACE PROBE BATTERY
700038	TOOL SETTER ACTIVE
700039	PART PROBE ACTIVE
700040	WAY OILER PRESSURE FAULT
700041	DOOR IS OPEN ~ CLOSE DOOR; PRESS CYCLE START TO CONTINUE
700043	DRAWBAR FAILURE

4.63 Clearing an Alarm

1. Carefully check the machine according to the description given in the alarm. Clarification of the alarm codes can be found by using the **HELP** as described above.
2. Resolve the cause of the alarm.
3. Press **RESET**
4. Certain alarms will require a reboot of the control to clear.

4.7 WORKING WITH FILES

4.71 File Types

- **NC** archive contains the machine **PARAMETERS**
- **PLC** archive contains the **LADDER LOGIC** for the machine functions
- **DRV** archive contains the **AXIS DRIVE SETTINGS**

4.72 Back-Up An 2300 Archive File to A USB Stick


For a download of the machine archive to a USB , press these three keys at the same time on the control:

CTRL + ALT + S

This will create a complete standard Easy Archive (**.ARD**) on a **USB**.

If a specific file or additional files need to be backed up to a **USB**, do the following:

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

1. Select the .
2. Select the **STARTUP**.
3. Press the **SYSTEM DATA** key. The data tree will open.
 - i. In the data tree, select the required files from which you want to generate an archive.
4. Press the **ARCHIVE** and **GENERATE ARCHIVE** keys.
5. The **GENERATE ARCHIVE: SELECT STORAGE LOCATION** window opens. Select the **USB** location for archiving.
6. Save the file as serial number of machine and the file name (i.e., for drive archive: "25123DRV")
7. Enter a name and press the **OK** key. The directory is created below the selected folder.
8. Press the **OK** key.
9. Select the format archive **ARD** for 2300, enter the desired name and press the **OK** key to archive the file/files.
 - a. A message informs you if archiving was successful.
10. Press the **OK** key to confirm.
11. An archive file in the **.ARD** (2300) format type is created in the selected directory.

*Note: When backing up an entire machine you should generate an individual file for NC, PLC, Drive, and HMI. When that step is completed, you should generate an archive for all these together.

4.73 Reloading an Archive File

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

NOTE: Set the password protection to "Current Access Level: Manufacturer". Refer to Section 4.3 above.

1. Select the  key.

2. Press the **ARCHIVE** and **READ IN ARCHIVE** keys.
3. Select the archive storage location (i.e., **USB**) and position the cursor on the required archive.
4. Note: When the option is not set, the folder for user archives is only displayed if the folder contains at least one archive.

OR

5. Press the **SEARCH** key and in the search dialog, enter the name of the archive file with file extension **ARD** if you wish to search for a specific archive and press the **OK** key.
6. Press the **OK** or **OVERWRITE ALL** key to overwrite existing files.

OR

7. Press the **DO NOT OVERWRITE** key if you do not want to overwrite already existing files.


OR

8. Press the **SKIP** key if the read-in operation is to be continued with the next file.
9. The **READ IN ARCHIVE** window opens and a progress message box appears for the read-in process.
10. You will then obtain a **READ ERROR LOG FOR ARCHIVE** in which the skipped or overwritten files are listed.
11. Press the **CANCEL** key to cancel the read-in process.

*Note: You may only archive one file at a time.

4.74 Backing Up Tool Data on the 2300 Control


Note: Setup data from part programs can only be backed up if they have been saved in the **WORKPIECES** directory. For part programs, which are located in the **PART PROGRAMS** directory, **SAVE SETUP DATA** is not listed.

1. Select the  operating area.
2. Position the cursor on the program whose tool and zero-point data you wish to back up.
3. Press the **>>** and **ARCHIVE** keys.
4. Press the **SETUP DATA** key.
5. The **BACKUP SETUP DATA** window opens. Select the data you want to back up.
6. Change the specified name of the originally selected program in the **FILE NAME** field, if needed.
7. Press the **OK** key.
8. The setup data will be set up in the same directory in which the selected program is stored as an INI file.

4.8 ADDING A SOFTWARE OPTION ON THE 2300 CONTROL

When you receive your machine all license numbers applicable to your order are activated prior to the machine leaving the factory. If you purchase a control option after the machine arrives at your facility you will receive a license number to active on your control. The license will either require you to go online and create a new license key, or this will be already done for you. If you receive a license certificate like pictured in figure one go to step 1, if not and you already have a license (see figure 2) then proceed to step 8 .

1. You need to obtain the hardware serial # (this not the same as the control serial number) follow these steps:

- Press 
- Press **SETUP**
- Select **LICENSE** (you may have to press the ^ or > key to see the soft key)
- Record the **CF CARD SERIAL #**

This number can also be found in the CF card located in your electrical cabinet. The number on the card is labeled as CFC SN. **CAUTION:** Machine must be powered down before the card is removed.


2. Once you have obtained your Control Hardware Serial Number you are ready to activate your new license number. Using the internet, log onto: www.Siemens.com/Automation/License
- Click on the link for **DIRECT ACCESS**
 - Enter the **LICENSE # AND DISPATCH NOTE #** from the paperwork into the areas indicated on the web page.




3. Click **NEXT**
4. On the next screen enter your hardware serial number.
5. Next select the control model. Your machine has a 2300.
6. The system will now return a software license key
7. Download PDF and save for your records. Also print the PDF so you can refer to it at the machine to type in new license key.
8. Already have printed license see below:



9. Follow step 1 to get to the license screen. Type in (overwriting old license key) current license key and press input. The field is highlighted, make sure to enter correctly.

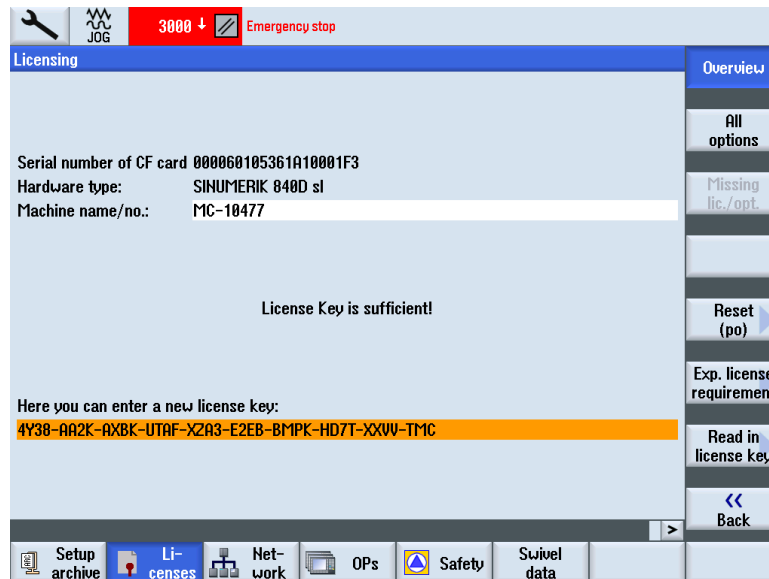

10. Press all options soft key
11. Search for the particular option you want to activate. Set the box with the select key. See figure 4.

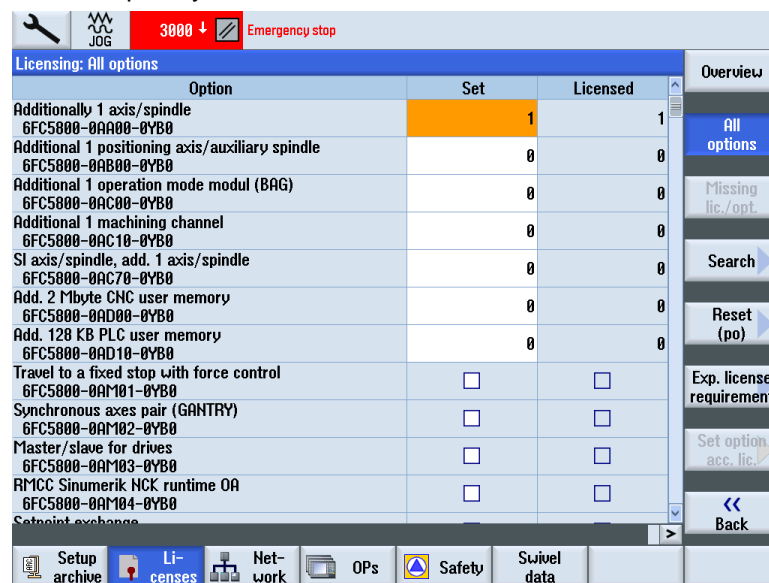

12. Press back soft key and power machine down. When you turn the machine back on the option should be activated.

4.9 SET UP THE NETWORK DRIVE IN THE 2300


! NOTE: *It is recommended that this procedure be performed by an experienced network administrator.*

The transfer of programs can be achieved by mapping a soft- key to a networked computer. The soft key will appear in the Program Manager screen of the controller.


The computer connected to the network must be configured with a unique username and password. This information will be required for inputting on the controller. A dedicated shared folder is required on the PC for the storage of files.


- Refer to Section 4.1 for directions to access parameter screens.

- Press 
- Select **SETUP**
- Select **START-UP**

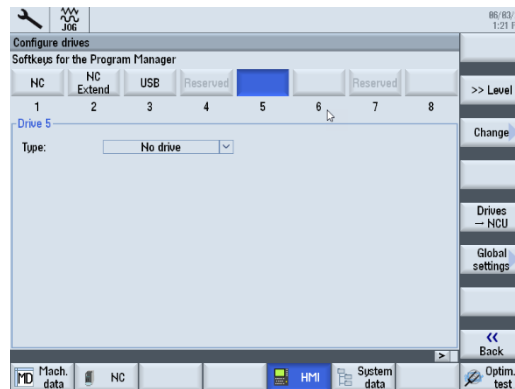

- Press the **HMI** and **LOG. DRIVE** keys. The **SET UP DRIVES** window opens.
- Select the open key that you want to configure (**example #5**).
- To allow entry fields to be edited, press the **CHANGE** key.
- Select the data for the corresponding drive or enter the necessary data.

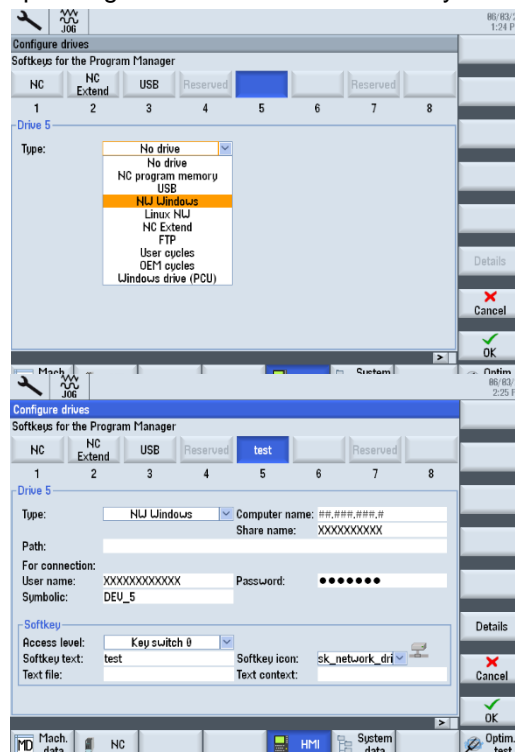

8. Press the **OK** key. The entries are checked. A window with the appropriate message opens if the data is incomplete or incorrect. Acknowledge the message with **OK** key. If you press the **CANCEL** key, then all of the data that has not been activated is rejected.
9. Restart the control in order to activate the configuration and to obtain the keys in the  screen.



5.0 - ARM STYLE ATC OPERATION & MAINTENANCE

5.1 ELECTRIC ARM TYPE ATC OPERATION

5.11 Safety Rules -- READ BEFORE OPERATING ATC

CAUTION! Always follow all Lock Out Tag Out procedures before performing any maintenance

- Due to the complexity and timing of the ATC, it should only be operated with the **M6** command.
- **Never interrupt the tool changer in the middle of cycle, wait for it to complete the tool change.**
- The carousel motor is a 3-phase motor and must be phased correctly for proper direction. The machine is phased properly at the factory before shipment, so if the carousel rotates in the wrong direction, switch any two incoming power wires at the disconnect. **Make sure the main power breaker is off!**
- **M58** moves carousel position CW one position, **M59** moves carousel position CCW one position.
- If the T code is programmed on the same line as the M6 command, make sure the M6 is before the T code (example: M6T4).

5.12 Manual Operation of the Tool Changer

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

The following is the process to manually step through the tool change operation in MDI.

NOTE: *Make sure you follow these steps in sequence to prevent damage to the ATC or machine.*

The proper sequence of a tool change and the respective M-codes are as follows:

1. T-code executes to move carousel to pending tool
2. **M52** tool pot down
3. **M19** orient spindle.
4. **G75 FP=1 ZO**, moves z axis to tool change position.
(Tool change position is stored in **Axis MD Z1** parameter **30600 - FIX_POINT_POS[0]**)
5. **M62** Arm moves under spindle to grab tool and carousel pot
6. **M54** Drawbar open to unclamp tool
7. **M62** Arm removes tool from spindle and carousel tool pot and swaps them
8. **M55** Drawbar off to clamp tool in spindle.
9. **M63** Arm to origin position.
10. **M53** Carousel tool pot up.

5.13 Setting Tool Change Height

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

The proper tool change height must be set for the ATC to perform correctly. The tool change height (machine coordinates from home position) is stored in parameter **30600**:

Axis MD Z1 parameter 30600 - FIX_POINT_POS [0]

! This must be checked if the home position is different due to the removal of the axis motor, home switch or dog.

Refer to Section 4.1 for directions to access parameter screens.

There is some allowance (**play**) allowed for the tool change height (about .03"). This is the difference between the V- flange groove of the tool and the V location of the arm. You will see this vertical play if you install a tool into the arm when the machine is in **E-Stop**. **Make sure you do not leave the tool there!**

1. Home the machine.
2. Manually move the axis to the tool change height specified in parameter **30600** or use **G75 FP=1 Z0** and the machine will position to the tool change location.
3. Orient the spindle with an **M19** command.
4. Install a tool in the spindle.
5. Command **M81** to set TC service mode. Allows axis movement when arm is not at origin.
6. Command **M52** for tool pot down
7. Command **M62** to move arm and grab tool.
8. Using the handwheel at its finest setting jog .001" increments to move the Z axis so the V-flange groove of the tool is in the center of the arm's V-notch. Be careful not to put stress on the ATC arm. **(This is "play" as described above.)**
9. When the correct **Z** axis tool change position is found, record the machine coordinate value, and retain for entry into parameter **30600** for the appropriate axis.
10. Command **M54** to release drawbar.
11. Command **M62** to exchange tools.
12. Command **M55** for drawbar off.
13. Command **M63** to move arm to origin position.
14. Command **M53** for tool pot up.
15. Command **M82** to disable TC service mode.
16. Update parameter **30600 FIX_POINT_POS [0]** with the new tool change height for **Z**.

5.14 Recovering from a Tool Change Failure

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

- If a tool change fails, record all of the alarm messages that are displayed on the alarm screen. Make sure the number is written down.
- The tool change recovery button will be flashing. Press E-stop. Remove tools out of spindle, arm and carousel pot that is extended for tool change.
- Turn on drives. Press Rest Button. Momentarily press the tool change recovery button multiple times until arm is a rest location and carousel pot is retracted into carousel.
- Make sure you catch any tool still in the spindle as it will be ejected. Press reset when complete. Check tool table to install tools in correct location.
- Repair any problems that have caused the failure.

5.15 ATC HOME Position and Tool Bin# Reset


To reset all the tool bin locations, follow this procedure:

1. Remove the tool from the spindle
2. In **MDI** command: Type in **M6T0** and press **CYCLE START**
3. Remove all new tools from the spindle
4. Go to command **M61** to index the carousel to bin #1
5. Go to tool table and select the **MAGAZINE** function.
6. Select **UNLOAD ALL** to remove the tools from the table.
7. Now select **TOOL LIST**. At this point all the current tool definitions are still in the table. They moved to the bottom below the highest tool number in your carousel.
8. You can now begin loading each tool definition up to the appropriate number that matches the physical location of the tool in the carousel. Do this by selecting **LOAD** and selecting a location number.


5.16 Spindle Orient Adjustment

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

This procedure will outline how to adjust the spindle orient position when an **M19** is commanded to perform a tool change. Read all instructions carefully and do not skip steps.

1. In **MDI** clear out any previous commands and type in:
G75 FP=0 Z0
M19
2. Command **M62** to move arm under the spindle.
3. With **Z** axis at maximum positive limit and **ATC** arm under spindle nose, make sure the spindle can be spun without spindle keys hitting **ATC** arm.
4. Press 
5. Press **DIAGNOSTICS**
6. Press **AXIS DIAG**, (If you do not see key press ">" arrow key to see more buttons.
7. Press **SERVICE AXIS** Use **Axis +** or **Axis -** key to display **AX4:MSP1/3.3.3/SPINDLE** see screen below:

Service axis/spindle		AX4:MSP1/3.3.3/SPINDLE	Axis +
Signal	Value	Unit	Axis -
Following error	-0.012	deg.	Select axis
Controller error	-0.012	deg.	
Contour deviation (axially)	-0.012	deg.	
Servo gain factor (calculated)	0.000	1000/min	
Active measuring system	1		
Status of measuring system 1	Active		
Status of measuring system 2	Park		
Pos.actual value measuring system1	257.812	deg.	
Pos.actual value measuring system2	0.000	deg.	
Position setpoint	257.800	deg.	
Abs. compens. value meas. system 1	0.000	deg.	
Abs. compens. value meas. system 2	0.000	deg.	
Compensation sag + temperature	0.000	deg.	
Act.speed value of active encoders	0.000	%	
Setpoint speed of drive	0.001	%	
Spindle speed set value programmed	0.000	rpm	
Spindle speed setpoint current	0.000	rpm	
Pos. offset to master axis/spindle act. value	0.000	deg.	
Pos. offset to master axis/spindle setpoint	0.000	deg.	Back

8. Press **RESET** and slowly turn the spindle until the spindle keys line up with the **ATC** carousel key.
9. Note what the degrees are reading on the highlighted line above and write it down. Compare it with the **Position Setpoint** below the highlighted line.
10. Press 
11. Press **SETUP**
12. Press **MACH DATA**
13. Press **AXIS SD** (you may have to press ">" to show additional buttons)
14. Use **Axis+** until spindle axis is displayed.
15. Scroll down to parameter **43240 \$SA_M19_SPOS**, this is the current orient position. Add the value you obtained in step **10** and input into this field.
16. Command **M63** to move arm to origin position.
17. Press **RESET** and make sure the spindle orient goes to the correct position before doing a tool change.


5.17 Arm Alignment

PROCEDURE TO BE PERFORMED BY QUALIFIED PERSONNEL ONLY

If the arm no longer moves in the proper angular alignment an adjustment may be required. The arm is held in place on the arm shaft with a compression clamp. In order to adjust this, follow this procedure:


1. Install tool in spindle
2. Orient spindle with **M19**.
3. Install tool in carousel pot.
4. Move carousel pot down with **M52**.
5. Move **Z** axis to tool change height with **G75 FP=1 ZO**.
6. Move arm to grab tools with **M62**.
7. Loosen socket head cap screws at bottom center of arm and align arm to grab tools fully. Once completed retighten the cap screws.
8. Move arm back to origin location with **M63**.
9. Remove tools
10. Put carousel pot back up with **M53**.
11. Turn off orient with **RESET** button.

ELECTRIC ARM TYPE ATC - CONTROL ELEMENT POSITION EXPLANATION DRAWING

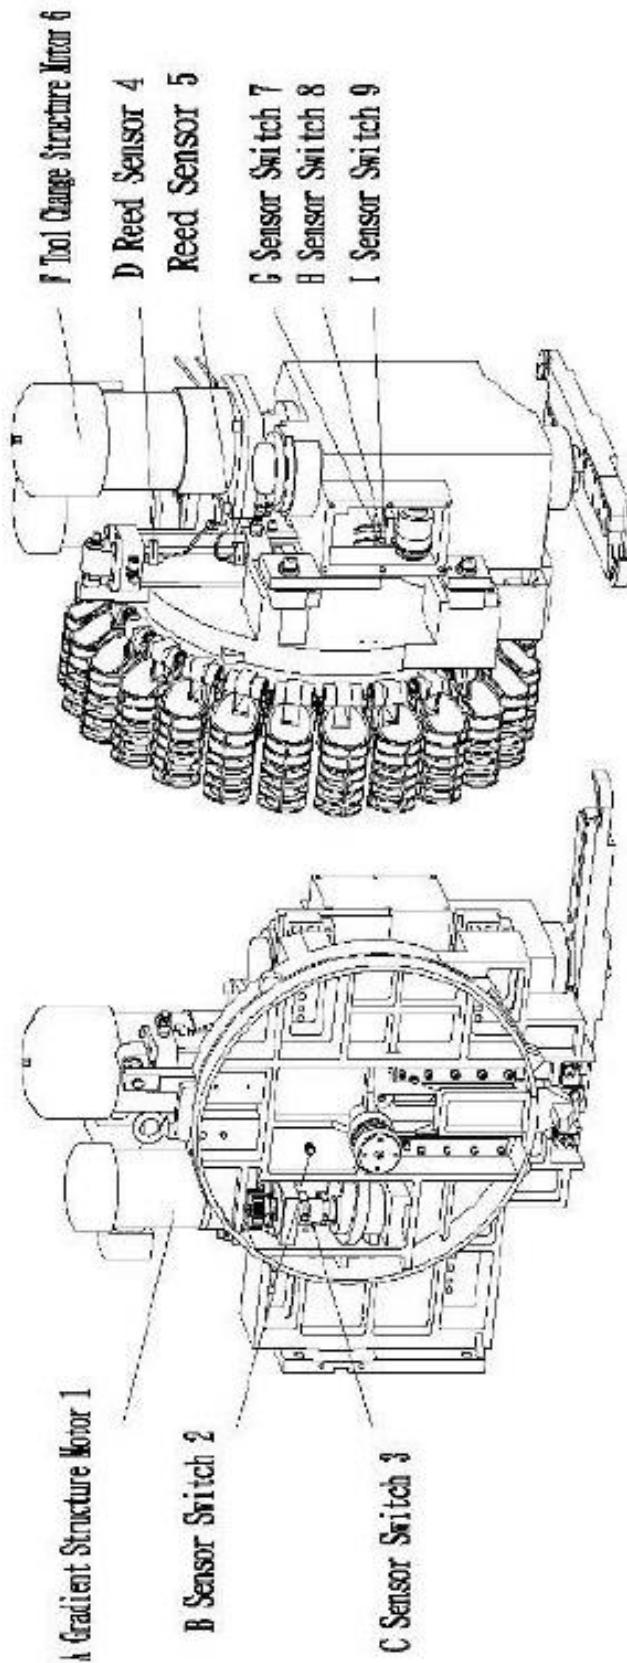

NO	CONTROL ELEMENT	FUNCTION	SPECIFICATION	DISK	QTY	REMARK
A	Gradient Structure Motor 1	Control tool disk position reverse turn	1/4HP*4P		1	3Ø220V/50 HZ
B	Proximity Sensor 2	Tool change structure origin point number one tool signal	Balluff PSC40F-13V00-3002		1	Ø12 DC24V(PNP)
C	Sensor Switch 3	Stop signal of disk gradient motor	Balluff PSC40F-13V00-3002		1	Ø12 DC24V(PNP)
D	Reed Sensor 4	Positioning signal of tool dropping (contracting of cylinder)	LSD-B2		1	CC24V
E	Reed Sensor 5	Positioning signal of tool reeading (contracting of cylinder)	LSD-B2		1	CC24V
F	Tool Change Structure Motor 6	Tool change structure power source	3/4 HP*4P		1	3Ø220V/50 HZ
G	Proximity Sensor 7	Stop signal of motor (tool change)	OMRON E2E-CF8B1		1	Ø4 DC24V(PNP/NO)
H	Proximity Sensor 8	Tool clamp signal (tool change)	OMRON E2E-CF8B1		1	Ø4 DC24V(PNP/NO)
I	Proximity Sensor 9	Origin point confirmation signal (tool change)	OMRON E2E-CF8B1		1	Ø4 DC24V(PNP/NO)

ELECTRIC ARM TYPE ATC - SEQUENCE DIAGRAM OF ELECTRIC ACTION

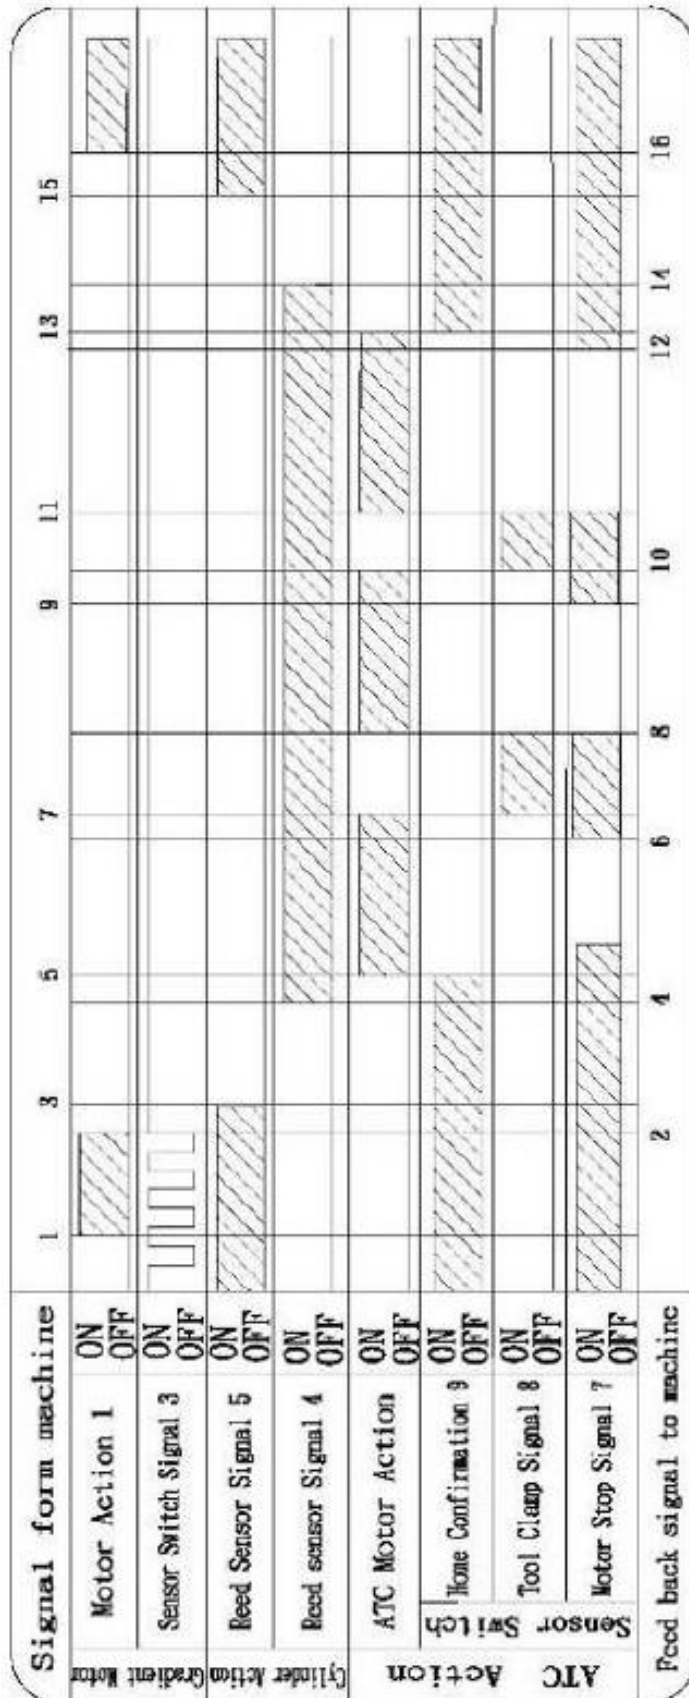


1	Tool selected on (Tool selection power is ON or CPM)	9	ATC motor starts to stop
2	Tool counter and positioning signal (to stop indexing motor)	10	Tool change confirmation, tool clamping signal, motor stop
3	Power on for tool (tool up/down)	11	Motor power on, and alarm to home position
4	Positioning signal of tool falling (contracting of cylinder)	12	ATC motor start to stop
5	Tool change motor start from home	13	Motor stop & home confirmation
6	ATC motor start to stop	14	Protruding of cylinder starts to position, tool pot home position
7	Tool clamping confirmation, tool release signal, motor stop	15	Protruding of cylinder applying signal (Tool change finish)
8	Tool release finish, motor power on	16	Indexing motor rotating to new order - pot


Voltage DC24V(Please choose positive or negative output voltage by PNP or NPN)




Voltage 220V 60HZ DC24V

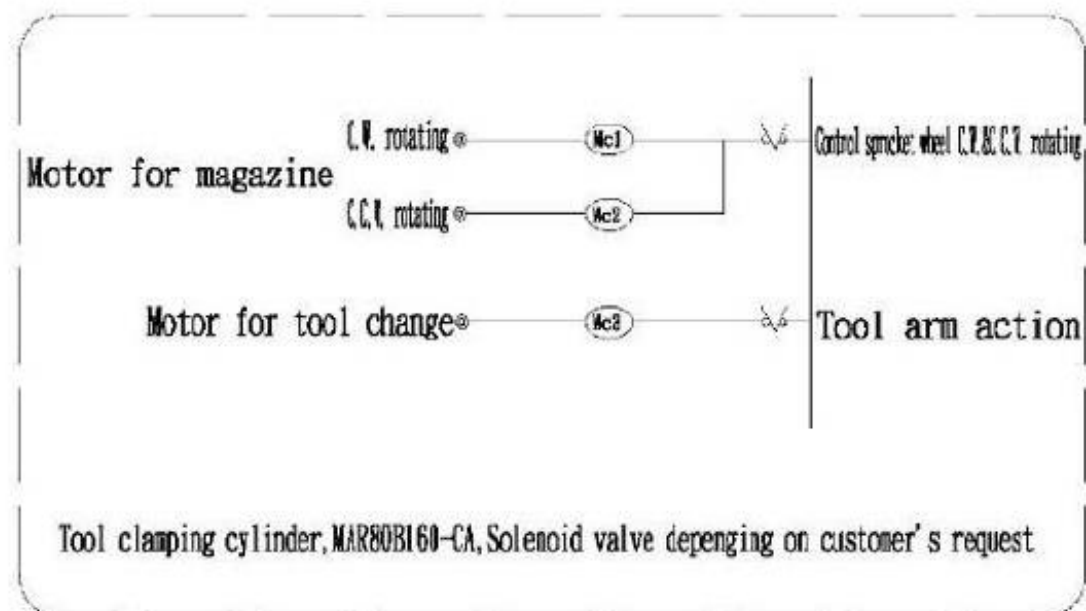

ELECTRIC ARM TYPE ATC – MOTOR & SWITCH WIRING DIAGRAM

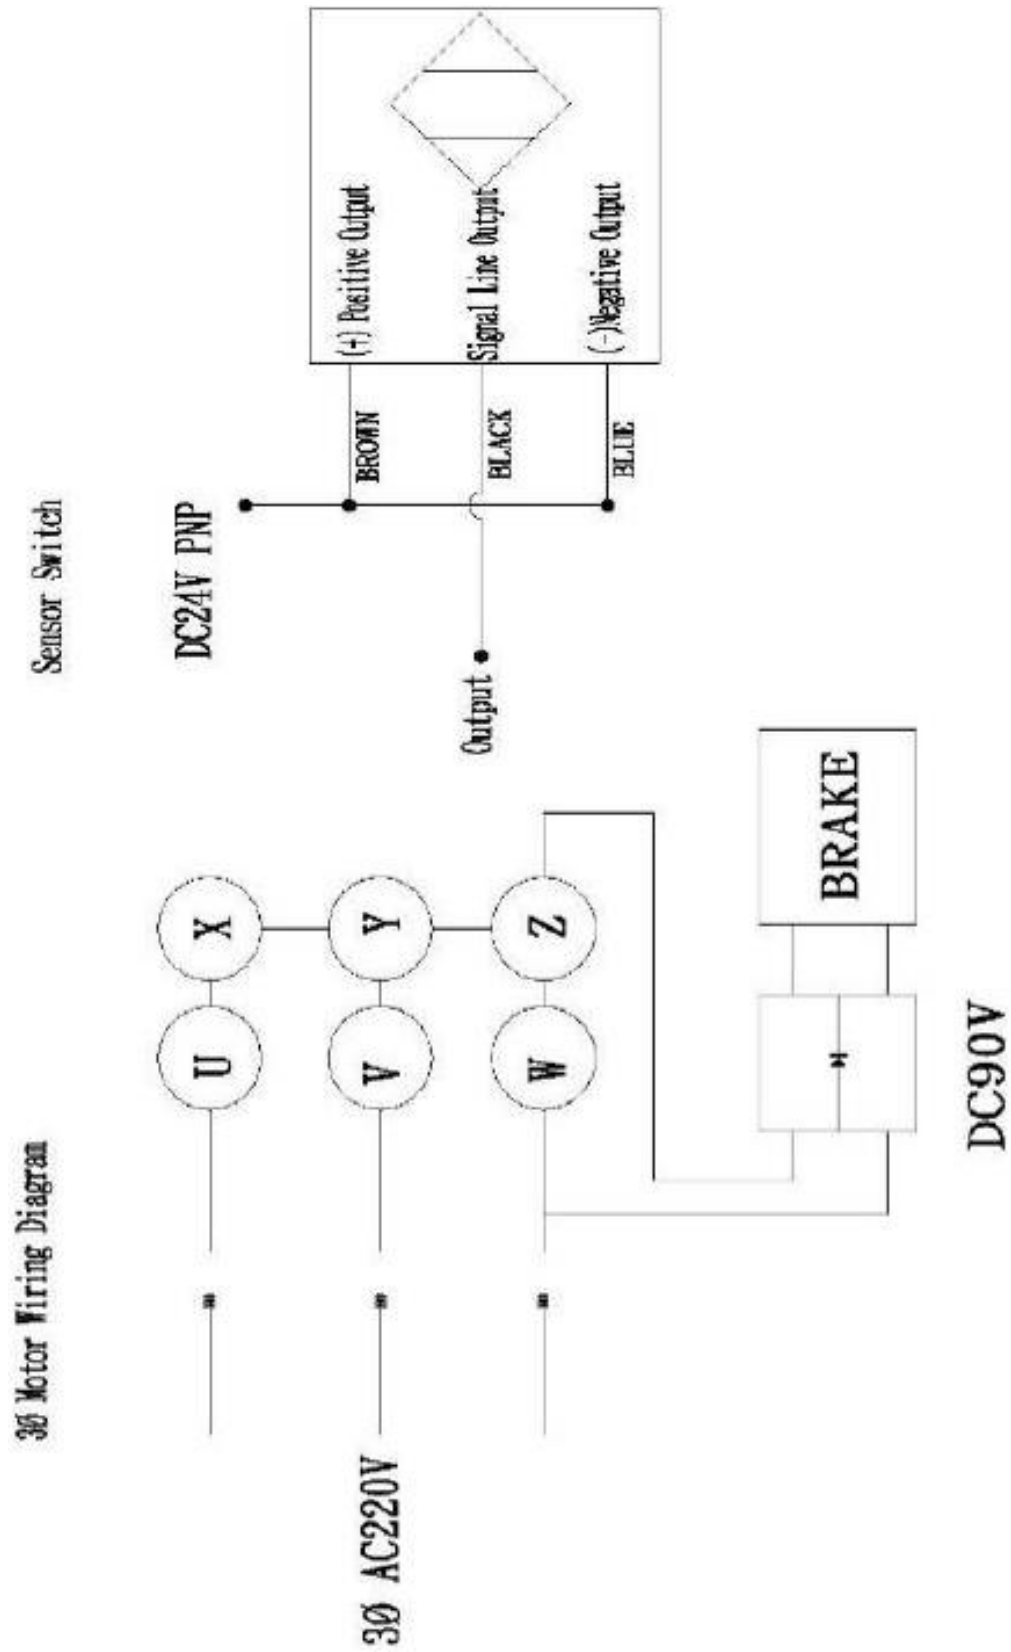


ELECTRIC ARM TYPE ATC - AIR PRESSURE SWITCH WIRING DIAGRAM

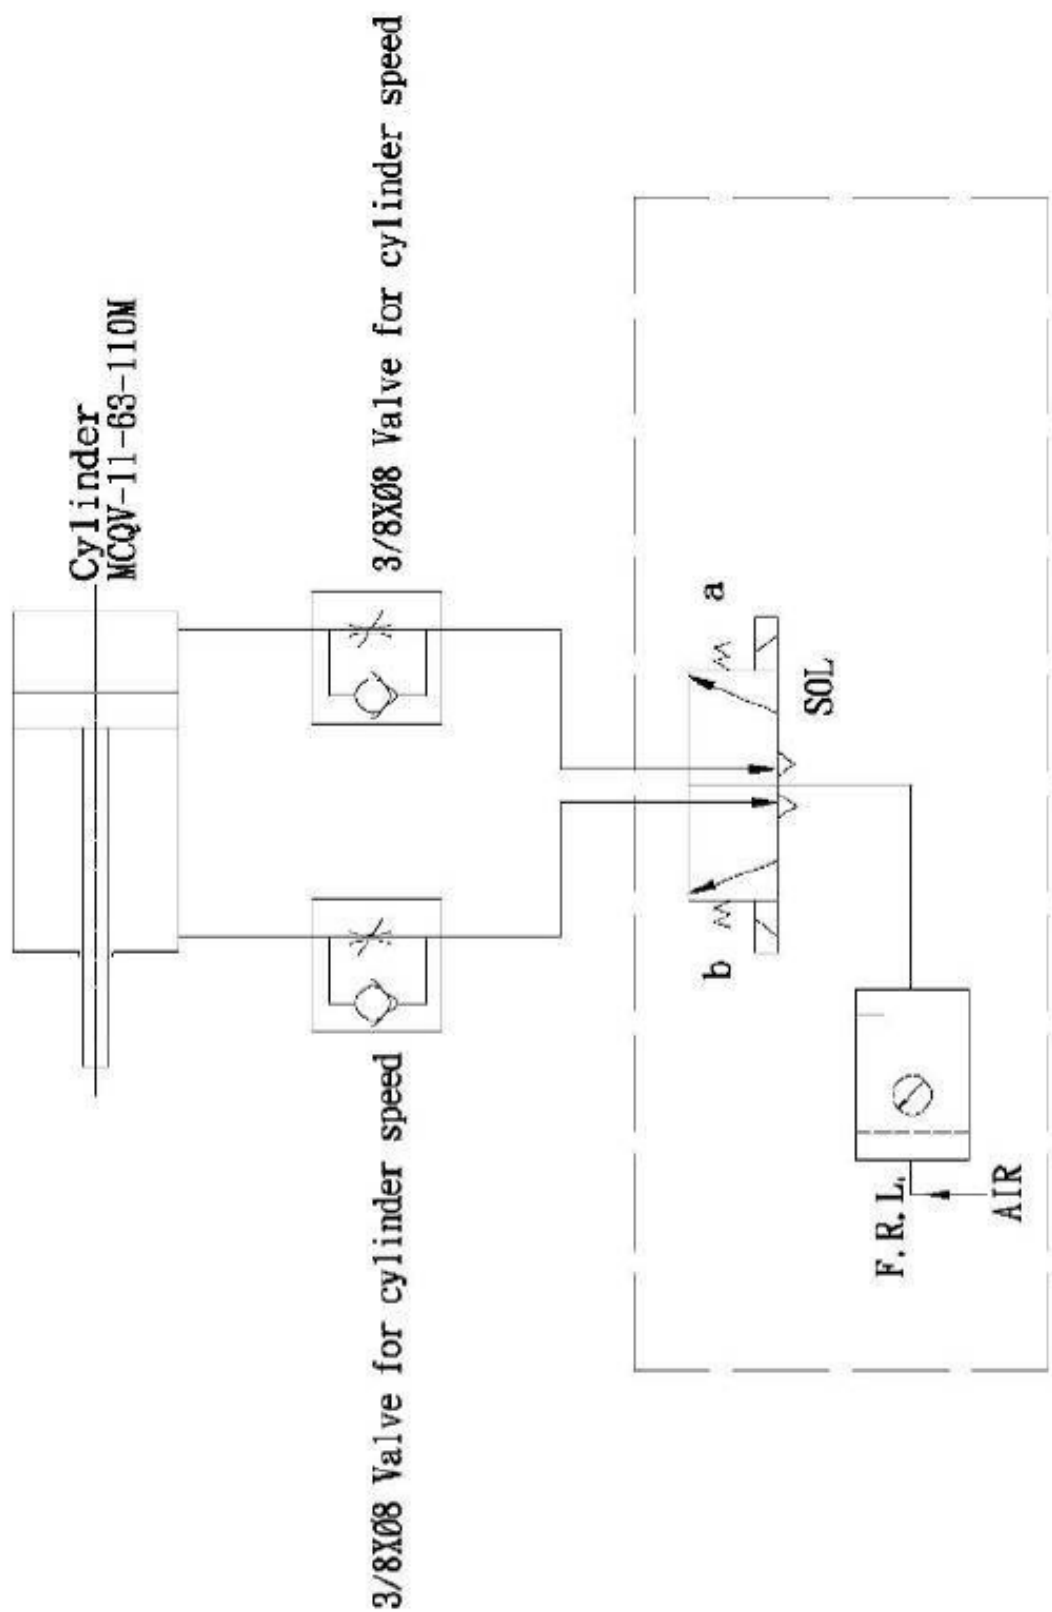


The solenoid valve shown within the dotted lines is shown for reference only and is not included as a standard accessory.

ELECTRIC ARM TYPE ATC – WIRE BOX DRAWING

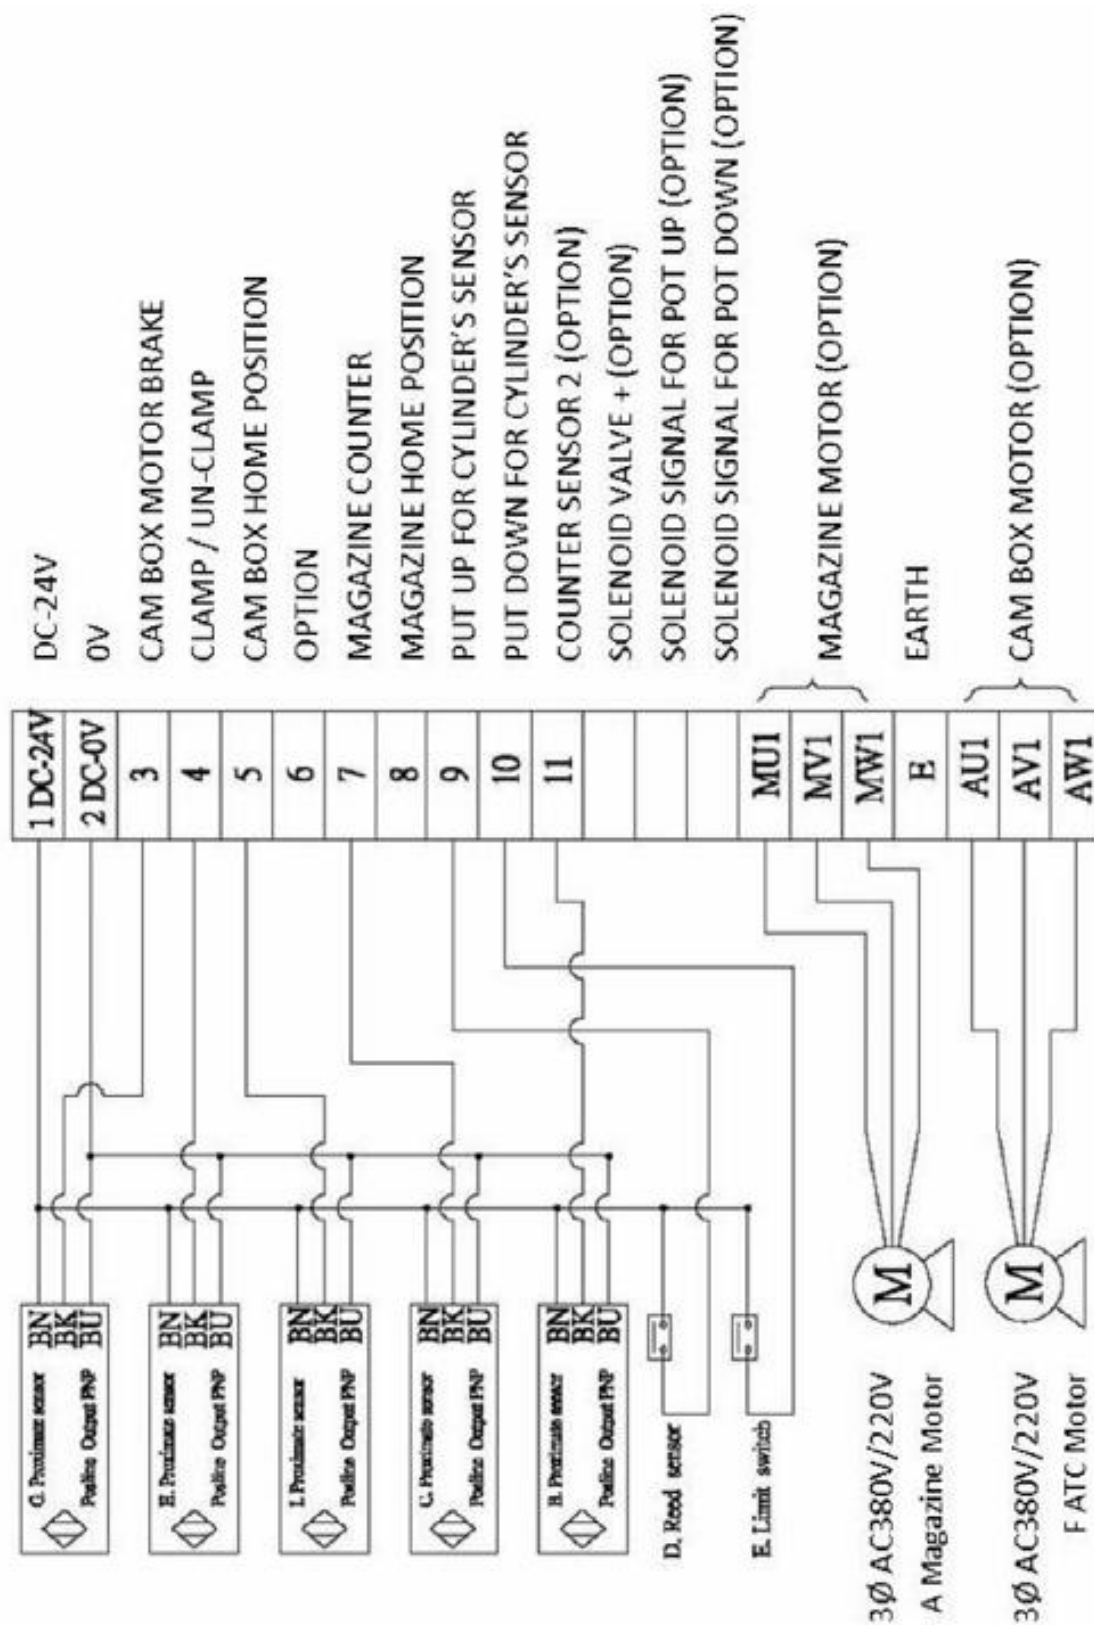



ELECTRIC ARM TYPE ATC – MAIN ASSEMBLY DIMENSIONAL DRAWING

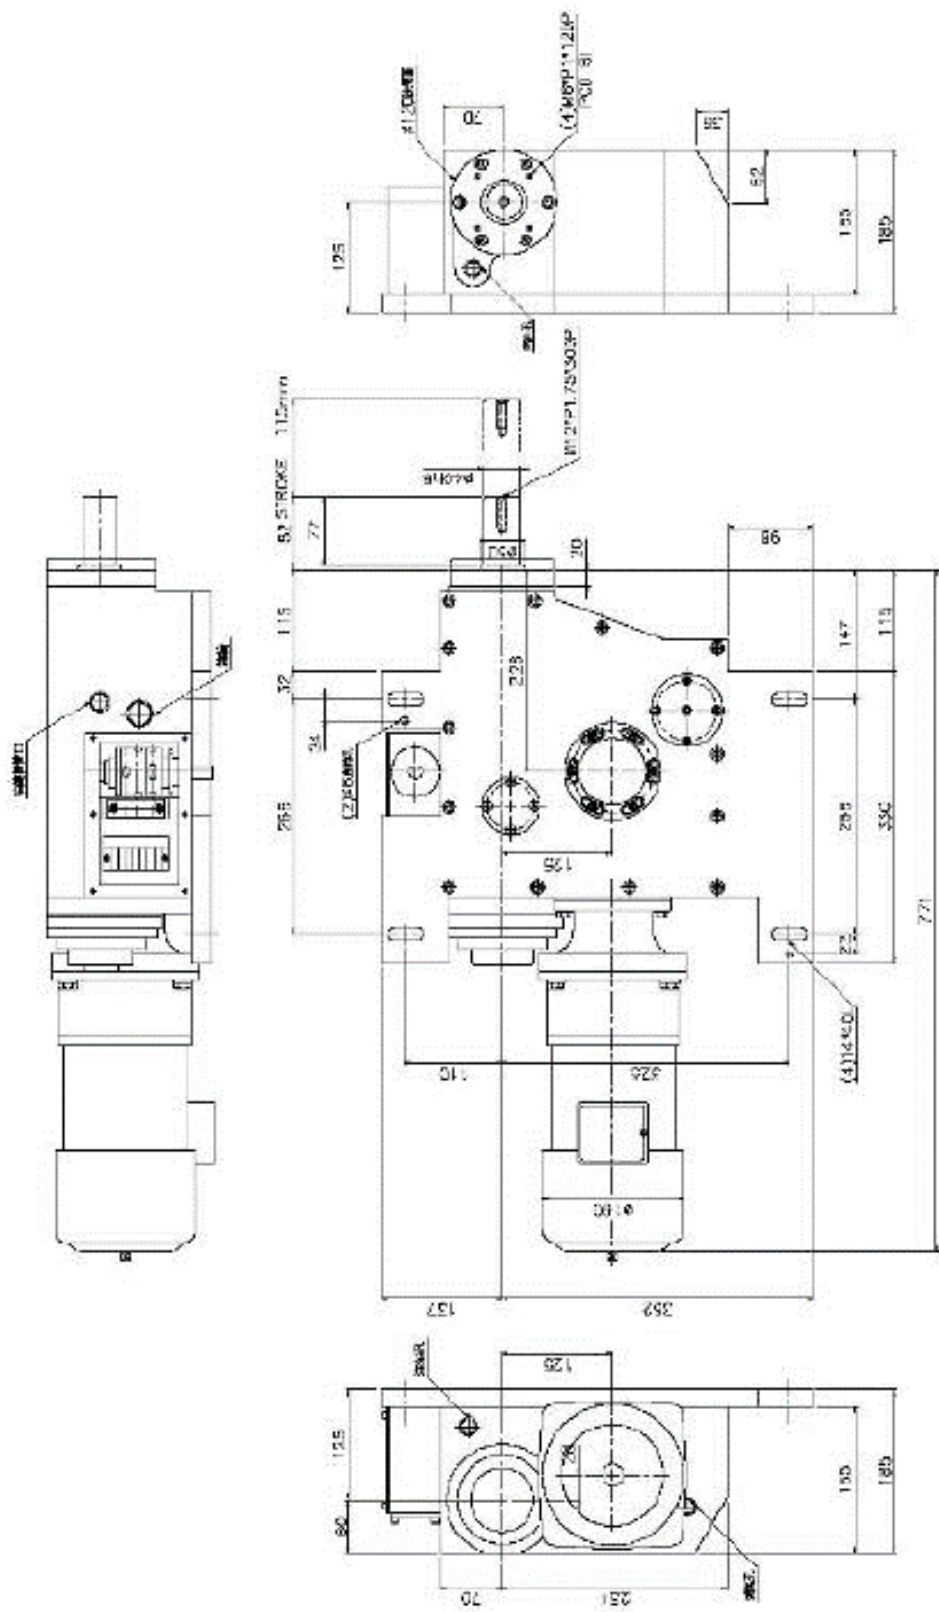

CAM DEGREE	65°
UP-DOWN STROKE	115mm
SIGNAL SPEC.	PNP×4-φ4
TOOL CHANGE TIME	50Hz=1.5sec
	60Hz=1.2sec
MOTOR SPEC.	1/2HP
	BRAKE DC-90V
	GEAR RATIO 1:8

DEX-2 TIME CHART

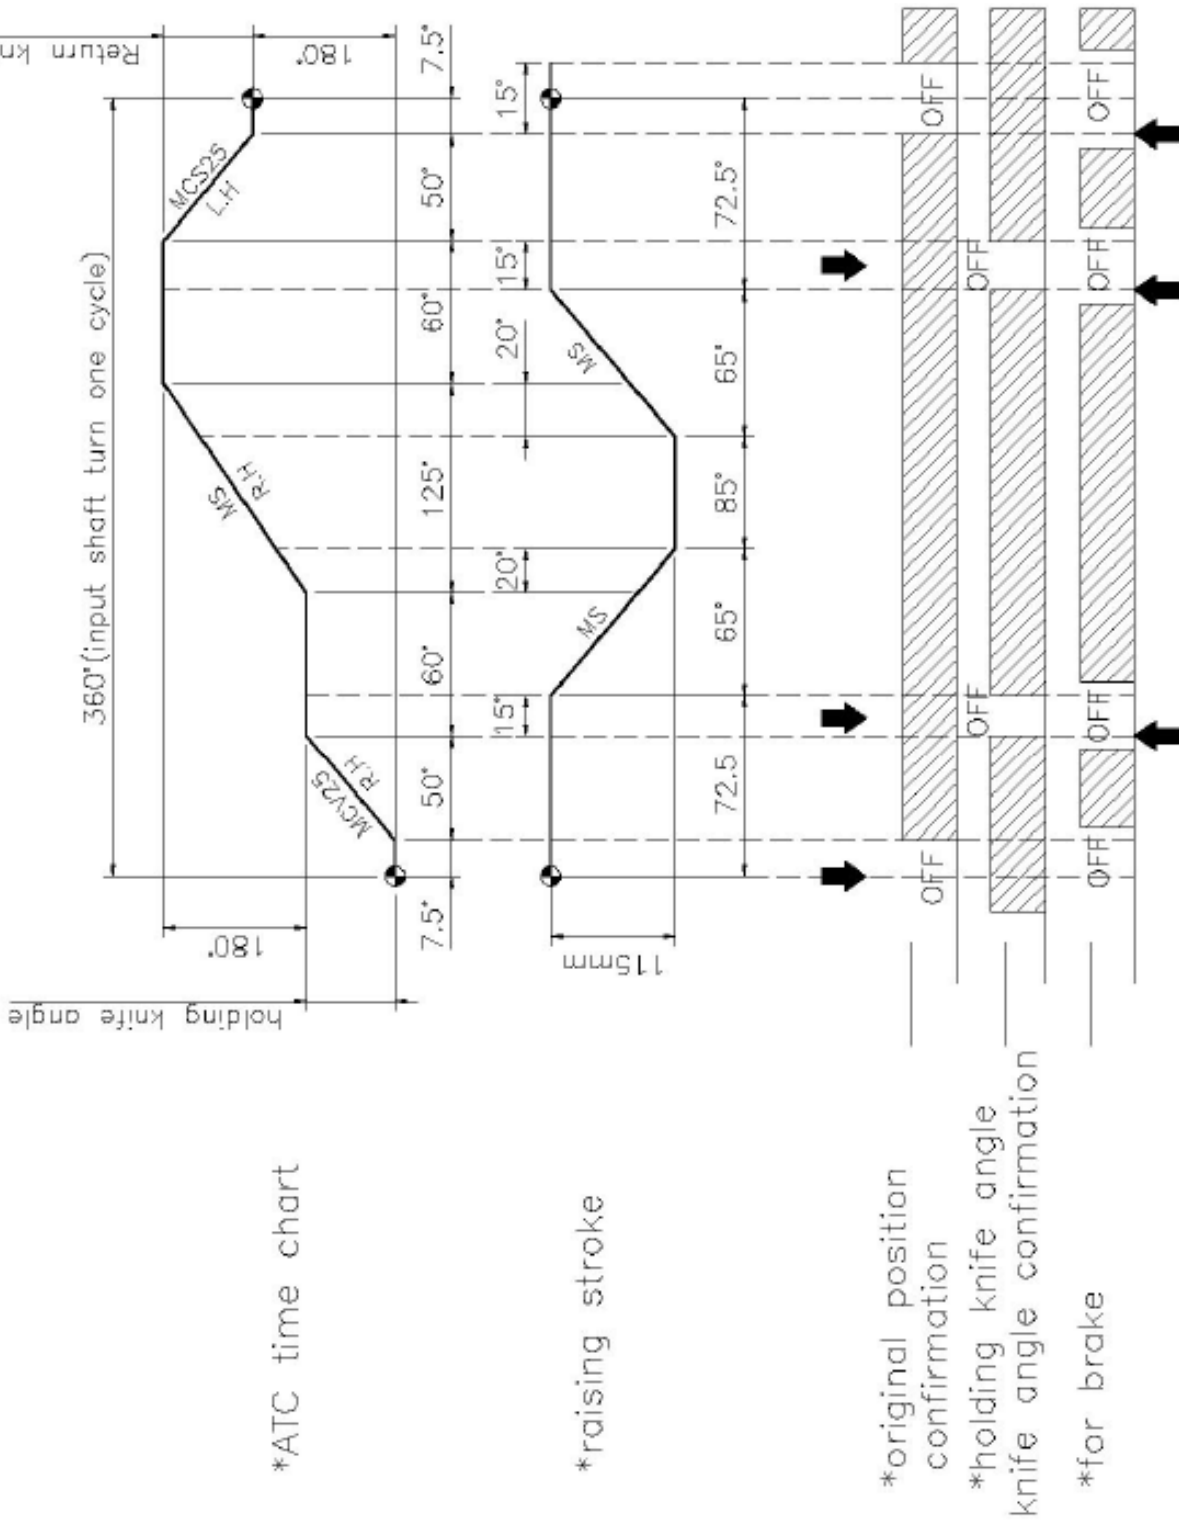


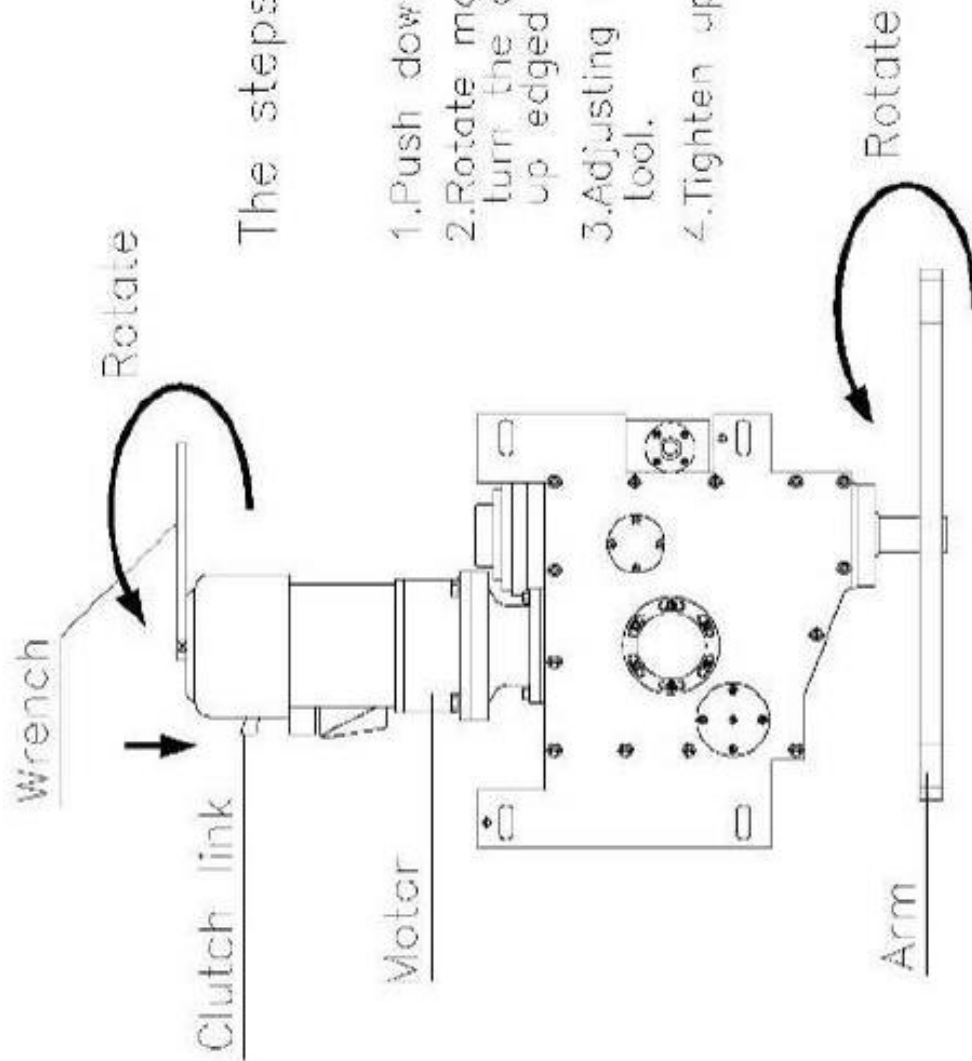

The steps of arm adjustment

1. Push down clutch link.
2. Rotate motor by using the wrench and turn the arm to the angle of setting up edged tool.
3. Adjusting the arm to hold the edged tool.
4. Tighten up the setup screws.

ELECTRIC ARM TYPE ATC - POWER OUTPUT DIRECTION DIAGRAM

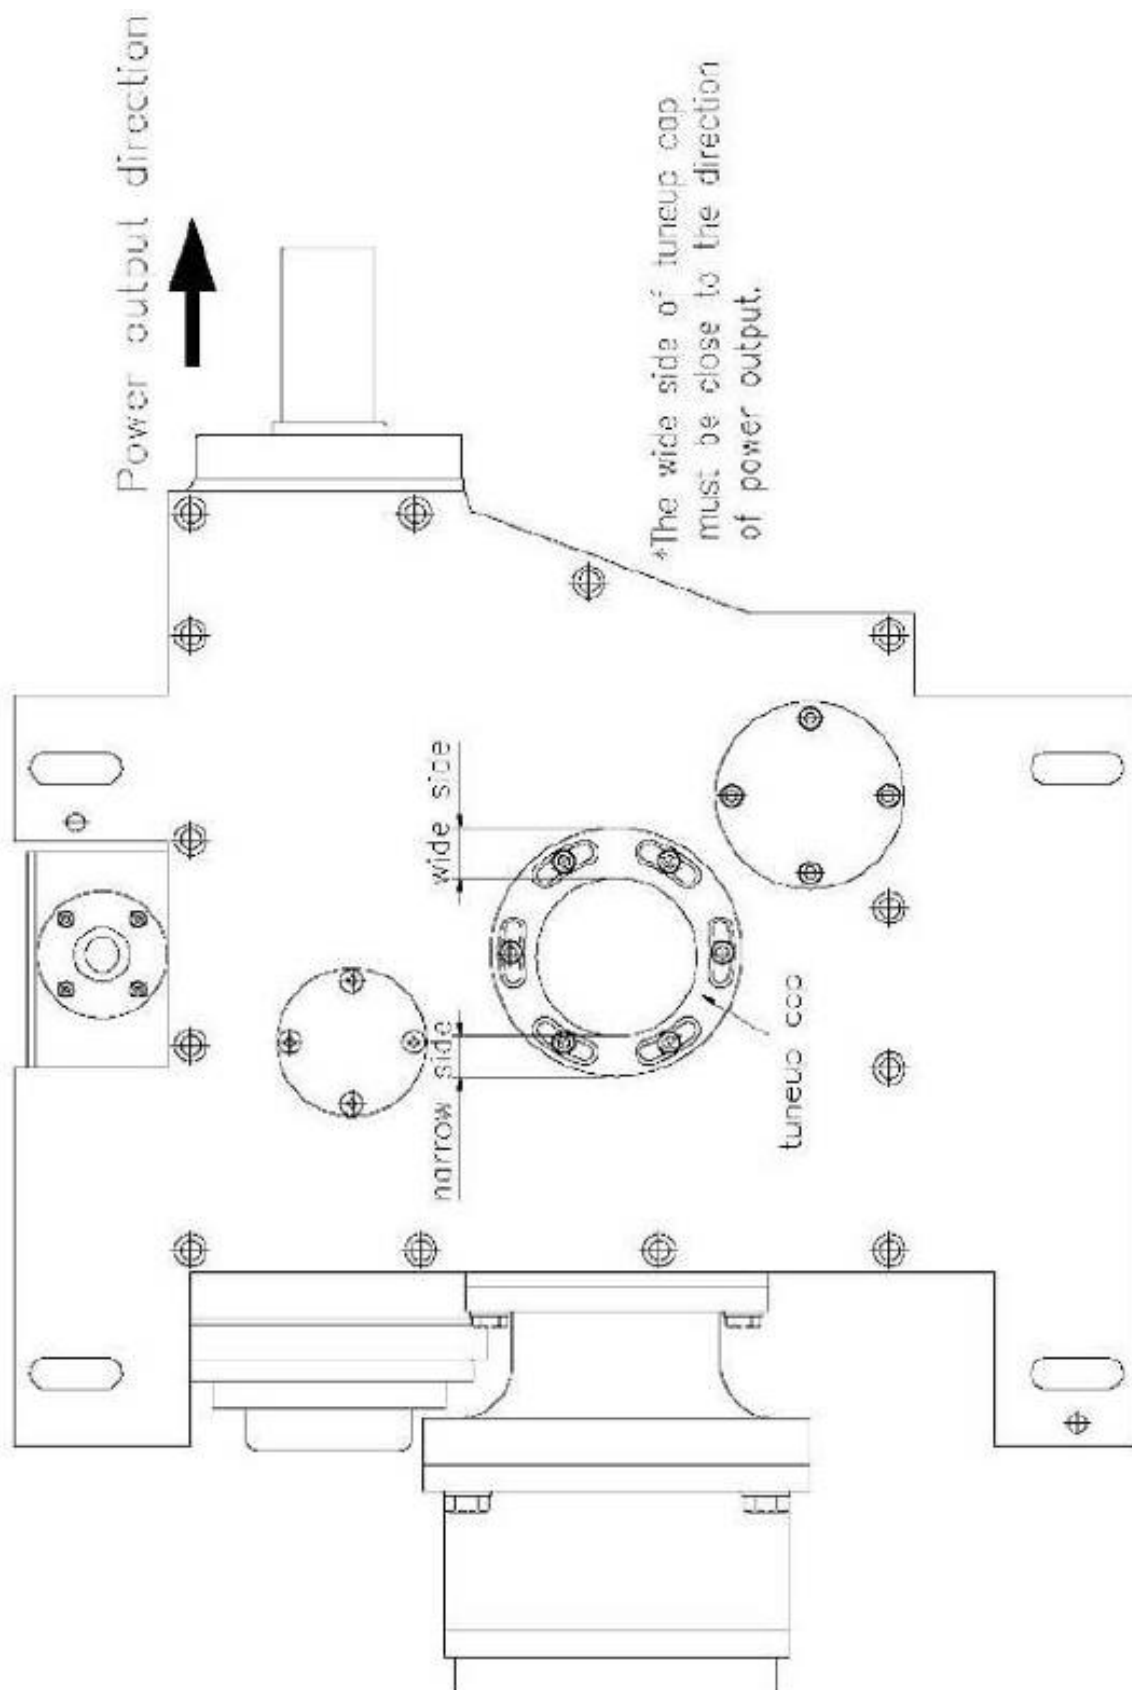

ELECTRIC ARM TYPE ATC – GEAR OIL SPECIFICATION

BRAND NAME	SPEC(VISCOSITY GAGE ISO VG)
SHELL	Omala EP 150-220
TOTAL	Garter EP 150-220
MOBLE	Mobil gear 150-220
ESSO	Spartan EP 150-220
CASTROL	ALPHA SP(EP) 150-220
CPC	85W/90

NOTES:

1. Check oil level before running equipment
2. Change oil after 2,400 hours of use
3. Use new oil with the proper viscosity

ELECTRIC ARM TYPE ATC – REPAIR PROCEDURES

1. To dismantle and reinstall the splined output shaft:
 - Turn to origin position, remove the taper pin (246) and M8 bolt (227) on the case cap.
 - Remove the case cap (101B).
 - Loosen hexagonal screw (225) and remove the front fix cap (111).
 - Remove the splined output shaft (106), and transmit wheel (107), suns nut (208) suns gasket (210) and remove the shaft.
 - Reassemble in reverse order.
2. To change the bearings on bearing tube: :
 - Turn to origin position, remove the case cap of taper pin (246) and M8 bolt (227) on the case cap.
 - Remove the case cap (101B).
 - Rotate the bearings tube (108) to the standby position.
 - Remove the side set screw (233).
 - Use the special tool to remove the bearings 4)20 (134), reinstall the new bearings, use the no air rubber to fastener the settled screw (233).
 - Reassemble in reverse order.
3. To take rocker apart: :
 - Turn to origin position, remove the case cap of taper pin (246) and M8 bolt (227).
 - Remove the case cap (101B)
 - Then remove the rocker of settled screw down (224)
 - Use the teardown tool, removed the rocker shaft (116)
 - Remove the thrust bearings AXK1108 (206), thrust bearing pad AS1108 (227) and needle bearings HK3516 (205).
 - The needle bearings 4)22(135) and needle bearings 4)24(136) taken apart the rocker is now replaced new product.
 - Reassemble in reverse order.

ATC TROUBLESHOOTING

Condition	Reason	Trouble Shooting
Tool disk stops in mid position.	1.Brake failed to work or was overloaded 2.Carousel count proximity switch too far from target.	1. Check that the electronic brake wiring is correct. If part failed to work 2. Move sensor switch closer to target
Tool disk rotates continuously.	1.Counting sensor switch failed. 2. Carousel count proximity switch too far from target.	1. Replace sensor switch 2. Move sensor switch closer to target.
Tool pot broken.	1. Tool disk rotated while tool pot down 2. Tool arm out of adjustment	1. Check operation of tool pot up/down proximity switches. 2. Adjust tool arm position.
Tool disk stuck.	Tool disk rotated while tool pot down	1. Check operation of tool pot up/down proximity switches.
Vibration during arm movement.	1.Oil level low. 2.Cylinder speed out of balance.	1. Fill lubricant oil. 2. Adjust cylinder pressure & speed with throttle valve.
Tool disk does not work during tool selection.	1. Induction switch does not work. 2. Reed switch broken. 3. Motor failure. 4. Electronic connection open. 5. Fuse opened.	1. Adjust reed switch to normal position. 2. Replace reed switch. 3. Repair/replace motor. 4. Check wiring & repair. 5. Check sensor switch. 6. Replace fuse.
Cylinder does not work during tool change.	1. Proximity switch for tool counter positioning broken. 2. Tool disk not in position. 3. Cylinder has no air. 4. ATC arm is not at origin position.	1. Replace proximity switch. 2. Check tool disk positioning. 3. Check air cylinder by manually operating solenoid valve. 4. Rotate motor manually to put ATC arm back to original position.
ATC motor over-heat	1. Break not working. 2. Motor short circuit.	1. Replace the brake. 2. Replace the motor.
ATC arm fails to move after tool is clamped. ATC fail to work after 180° degrees tool change. ATC home stop & home sensor switch do not work.	1. Proximity switch is in wrong position. 2. Proximity switch is broken.	1. Adjust proximity switch. 2. Replace proximity switch.
ATC arm stops out of position.	1. Proximity switch is in wrong position. 2. Positioning ring of proximity switch is at wrong angle	1. Adjust 3 switches at the same time to proper angle. 2. Rotate set ring, adjust 3 proximity switches to proper angle.
ATC tool arm not fully engaging tools.	ATC arm not aligned.	Loosen arm & align it.

5.2 ATC MAINTENANCE

5.21 TOOL POT REPLACEMENT PROCEDURE


1. Remove the 2 carousel covers as shown.



2. Remove the 8mm bolt and loosen but do not remove the 10mm bolt on the shaft cover. (Note: do not remove the 4 attachment bolts)



3. Pull out the plate to the M10 screw bolt position as shown.

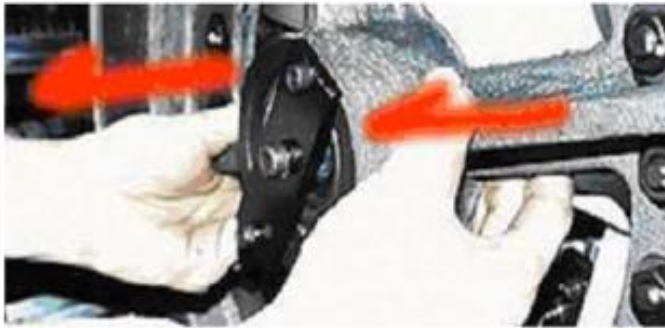


4. Remove the 6mm bolt next to the tool pot as shown.



ATC MAINTENANCE

5.21 TOOL POT REPLACEMENT PROCEDURE


5. Remove the broken pot by pushing the pot forward, rotating it upward, then extract it.

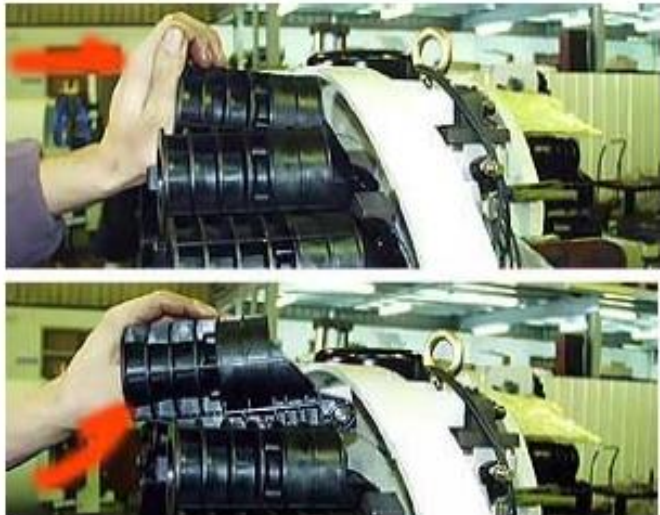

6. Confirm the attachment bolt and knob are correct by comparing to broken pot.



7. Install the new pot in reverse order of step 5.

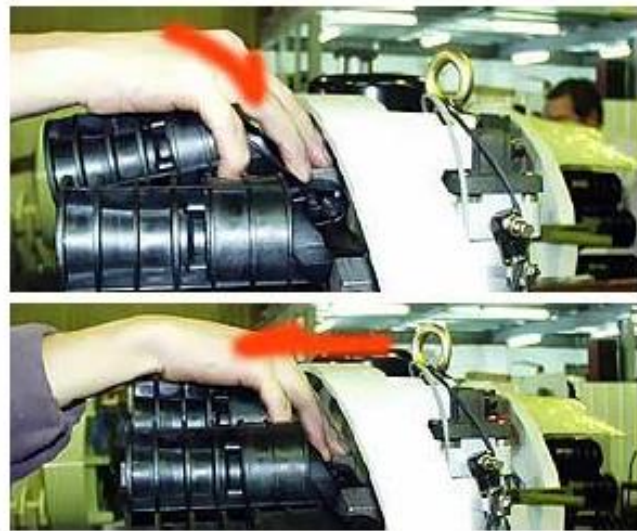

8. Replace the 6mm bolt next to the tool pot as shown.



ATC MAINTENANCE

5.21 TOOL POT REPLACEMENT PROCEDURE

9. Push the plate to the original position and replace/tighten the screws



10. Check that the tool disk is fully seated so it does not move in/out.



11 Check that the tool pot drops at the correct 90 degree angle by manually operating solenoid valve.



ATC MAINTENANCE

5.22 TO REPLACE ATC MAGAZINE MOTOR

1. Turn power off.
2. Disconnect the wires for the magazine motor in the junction box.
3. Remove the M8 bolts (4pcs) on motor seat, and then remove the motor.
4. Remove the S18 ring & M6 bolt from the damaged motor & install the parts on the new motor.
5. Please make sure the motor specification is correct before you replace it.
6. Reconnect the wires in the junction box.

5.23 REPLACE ARM MOTOR

1. Power off.
2. Disconnect the wires for the arm motor in the junction box.
3. Remove the M10 bolts (4pcs) on motor seat, and then the motor.
4. Please make sure the motor specification is correct before you replace it.
5. Reconnect the wires in the junction box.

5.24 CYLINDER REPLACEMENT

1. Turn off the power & cylinder air pressure source.
2. Take off 08 air pipe.
3. Take off induction switch & mark original position before removing it.
4. Remove the M8 bolt on the cylinder and the S12 ring on joint "I".
5. Make sure to the cylinder specifications are correct before you install. Install the induction switch to the original position.

5.25 INDUCTION SWITCH REPLACEMENT

1. Power off.
2. Disconnect the wires for the induction switches in the junction box.
3. Please loosen the seat of reed switch & take it out.
4. Replace new part & take care of the sensor position, push it to upward & downward until to end of both sides.
5. Follow the steps to set up wires in electric box.

5.26 REPLACING THE PROXIMITY SWITCH FOR THE TOOL MAGAZINE


1. Power off.
2. Disconnect the wires for the induction switches in the junction box.
3. Remove the front cover & outer metal cover.
4. Remove the M12 bolt on the proximity switch.
5. Replace the switches & make sure the gap distance is 4 mm.
6. Reconnect the wires in the junction box.

5.27 REPLACING THE PROXIMITY SWITCH FOR THE ARM

1. Power off.
2. Disconnect the wires for the induction switches in the junction box.
3. Remove the acrylic cover plate.
4. Replace the switch & make sure the gap distance is 4 mm.
5. Reconnect the wires in the junction box.

5.28 NOTES

1. Be sure to use the proper tools during maintenance & repair.
2. Take care to match the part specifications before replacement. Specifications are listed in the parts list.
3. Make sure the gap for the proximity switch & reed switch 4 mm.
4. Be sure to note the wire numbers & locations before disconnecting.

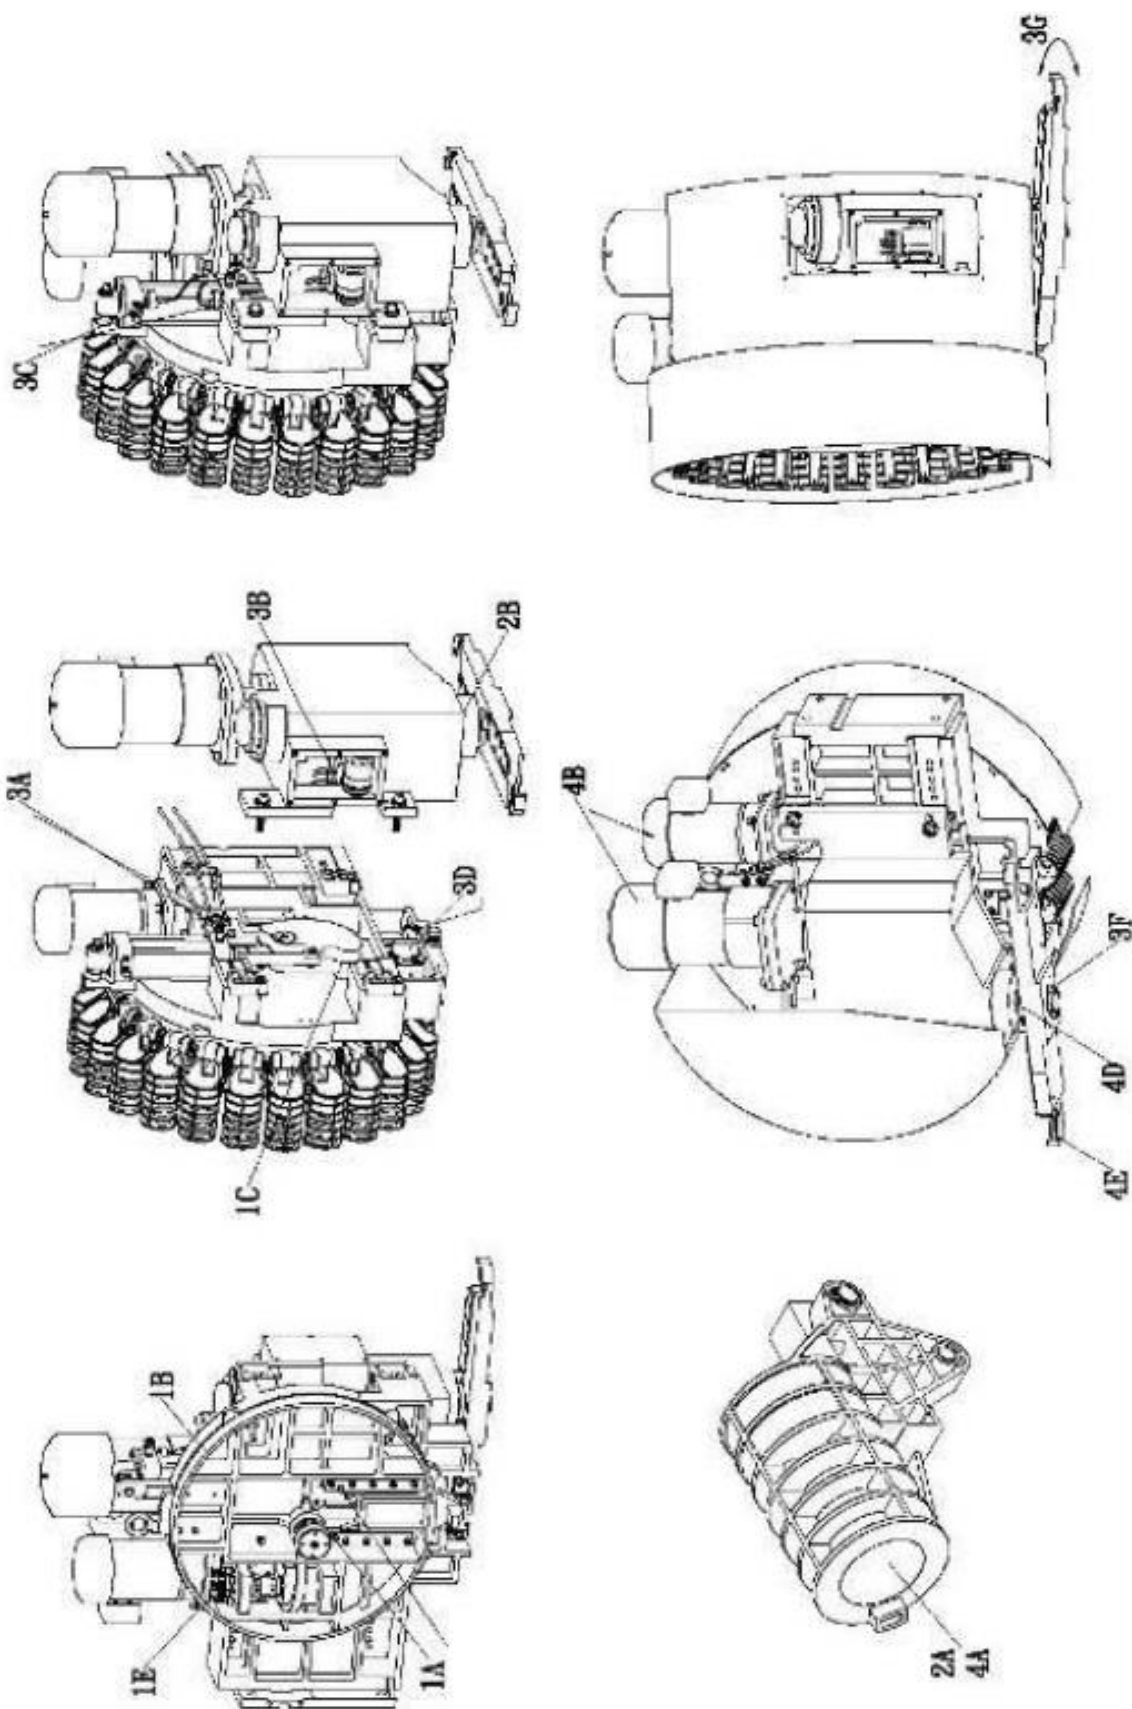


ATC MAGAZINE MAINTENANCE POINTS

G. Magazine maintenance main points									
1	Lubri- cation	A	Carousel pot guideway		Take off number cover, fill oil manually	Grease Gun	Half year		Grease
		B	Pot slide		Take off sheet metal, fill	Grease Gun			Grease
		C	Arm slide block & position pin		Take off sheet metal cover, clean & fill oil manually				Grease
		D	Cam Slide		Take off ATC cover, fill lubrication oil manually	Grease Gun			Grease
		E	Motor Gear		Take off front cover & outer sheet	Grease Gun			Grease
2	Cleaning	A	Inner taper face of pot		Clean pot		Once a month		
		B	Change ATC oil		Drain the old oil, and fill				SHELL TELLUS 32
3	Loosen Check	A	Sensor switch for magazine		Check manually		Half year		
		B	Sensor switch for ATC		Check manually				
		C	Sensor switch for cylinder		Check manually				
		D	Limit switch		Check manually & optically				
		E	Bolts		Check manually				
		F	Bolts on arm		Check manually				
		G	Shake the arm to decide if backlashes from him		Check manually & inaccuracy can't				
		H	Check the carousel body		Check manually				
		I	Check tool magazine		Check manually				
4	Other check	A	Pot ball is falling down		Check manually		Before power		
		B	Excessive noise or heat from motor		Check manually				
		C	Check the air pressure for the cylinder solenoid valve		Check manually				
		D	Oil leak from ATC output shaft		Check manually				
		E	V shape flange of ATC arm to wear and tear		Check manually				
		F	The oil level lower of ATC oil tank		Check manually				

6.0 – DRAWINGS & PARTS LIST


2300 CONTROL ELECTRICAL PANEL LAYOUT & PARTS LIST

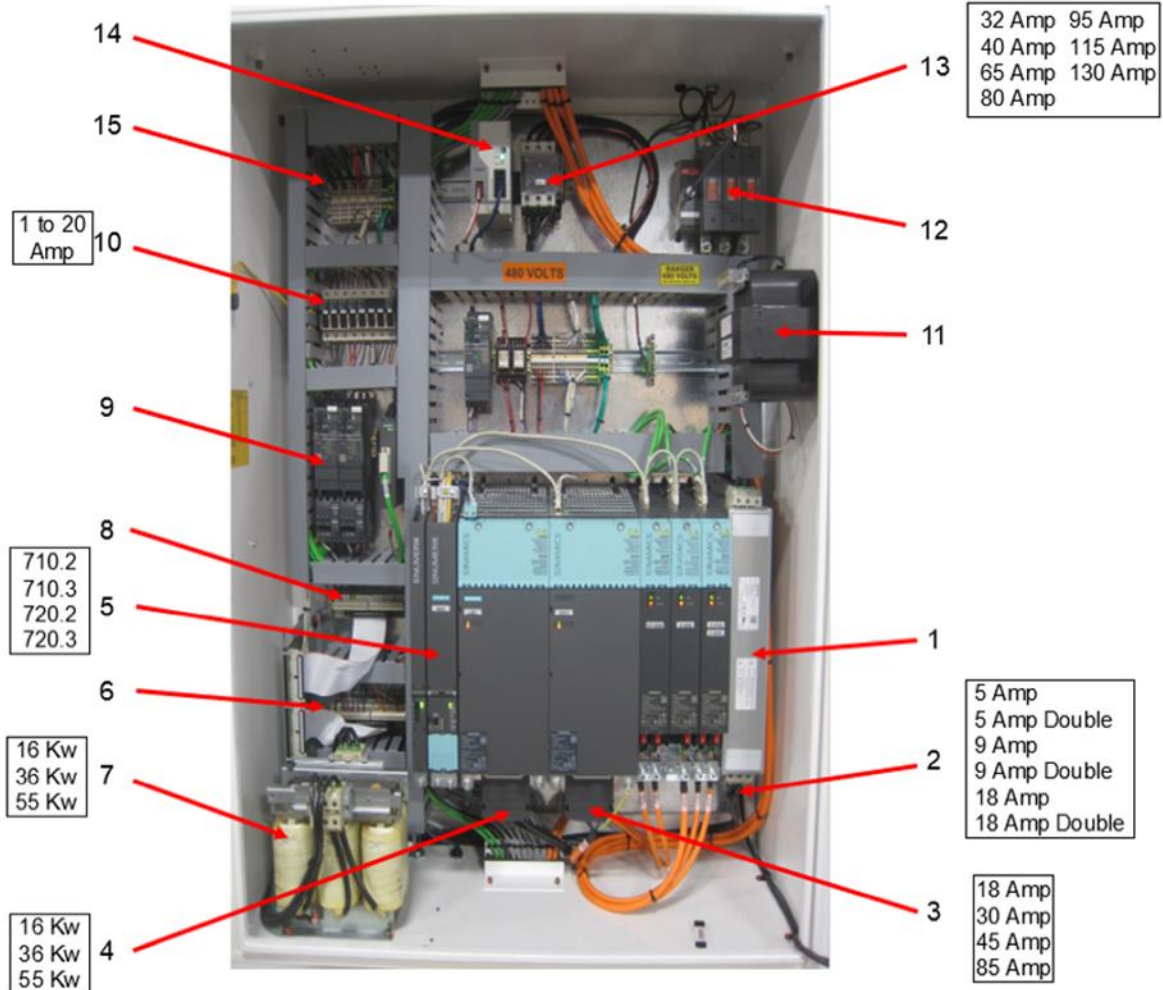

2300 CONTROL ELECTRICAL PANEL – PARTS


REF	PART NO.	DESCRIPTION	PARTS NAME	QTY
1		Siemens Touch Screen Filter		1
2		Siemens Servo		1
3		Spindle Module		1
4		Line Module		1
5		NCU		1
6	CMB-3112	PP72/48 I/O Board		1
7		Siemens Reader		1
8	MSE-1330	Wiedmuller Breakout Board		1
9	MSE-6624	Schneider Contactor Relay		1
10		Fuses		1
11	MSE-1610	.75 Kw Transformer		1
12		Fuse, Main		1
13		MCI		1
14	MSE-2940	24V Power Supply		1
15	MSE-6620	Schneider Contactor		1

2300 FRONT CONSOLE LAYOUT & PARTS LIST

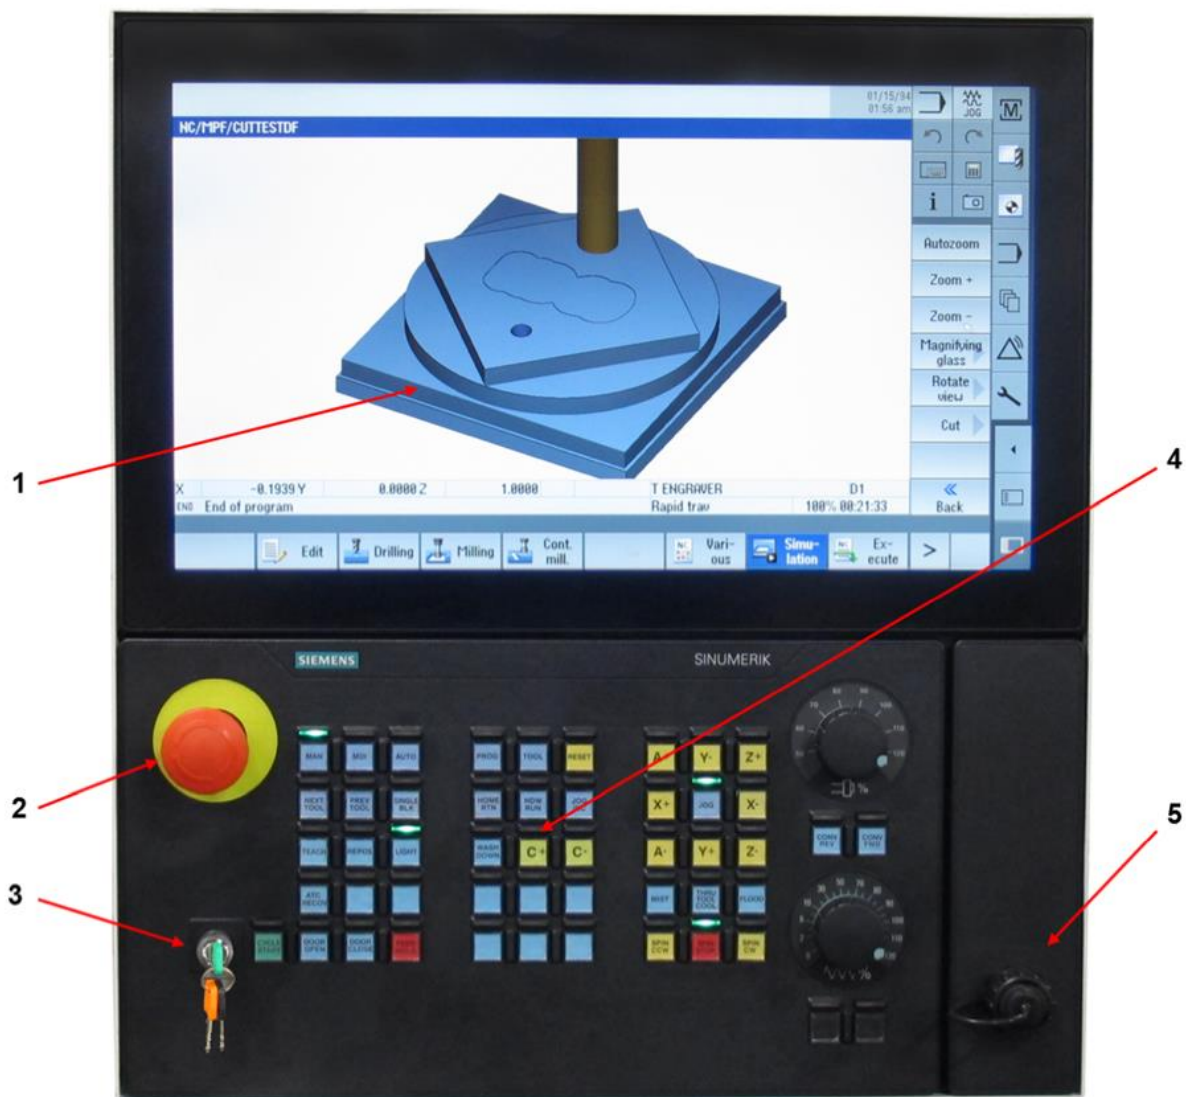


REF	PART NO.	DESCRIPTION	PARTS NAME	QTY
1		Siemens Monitor NCU		1
2	SWT-6210	E-Stop w/ Contact Block		1
3	MSM-8210	Keys (3)		1 set
4	CMB-3202	Siemens Control Panel		1
5	ASY-6206	Remote Handwheel Plug with Harness		1


6.3 ELECTRIC ARM TYPE 60 TOOL ATC DRAWING - 1

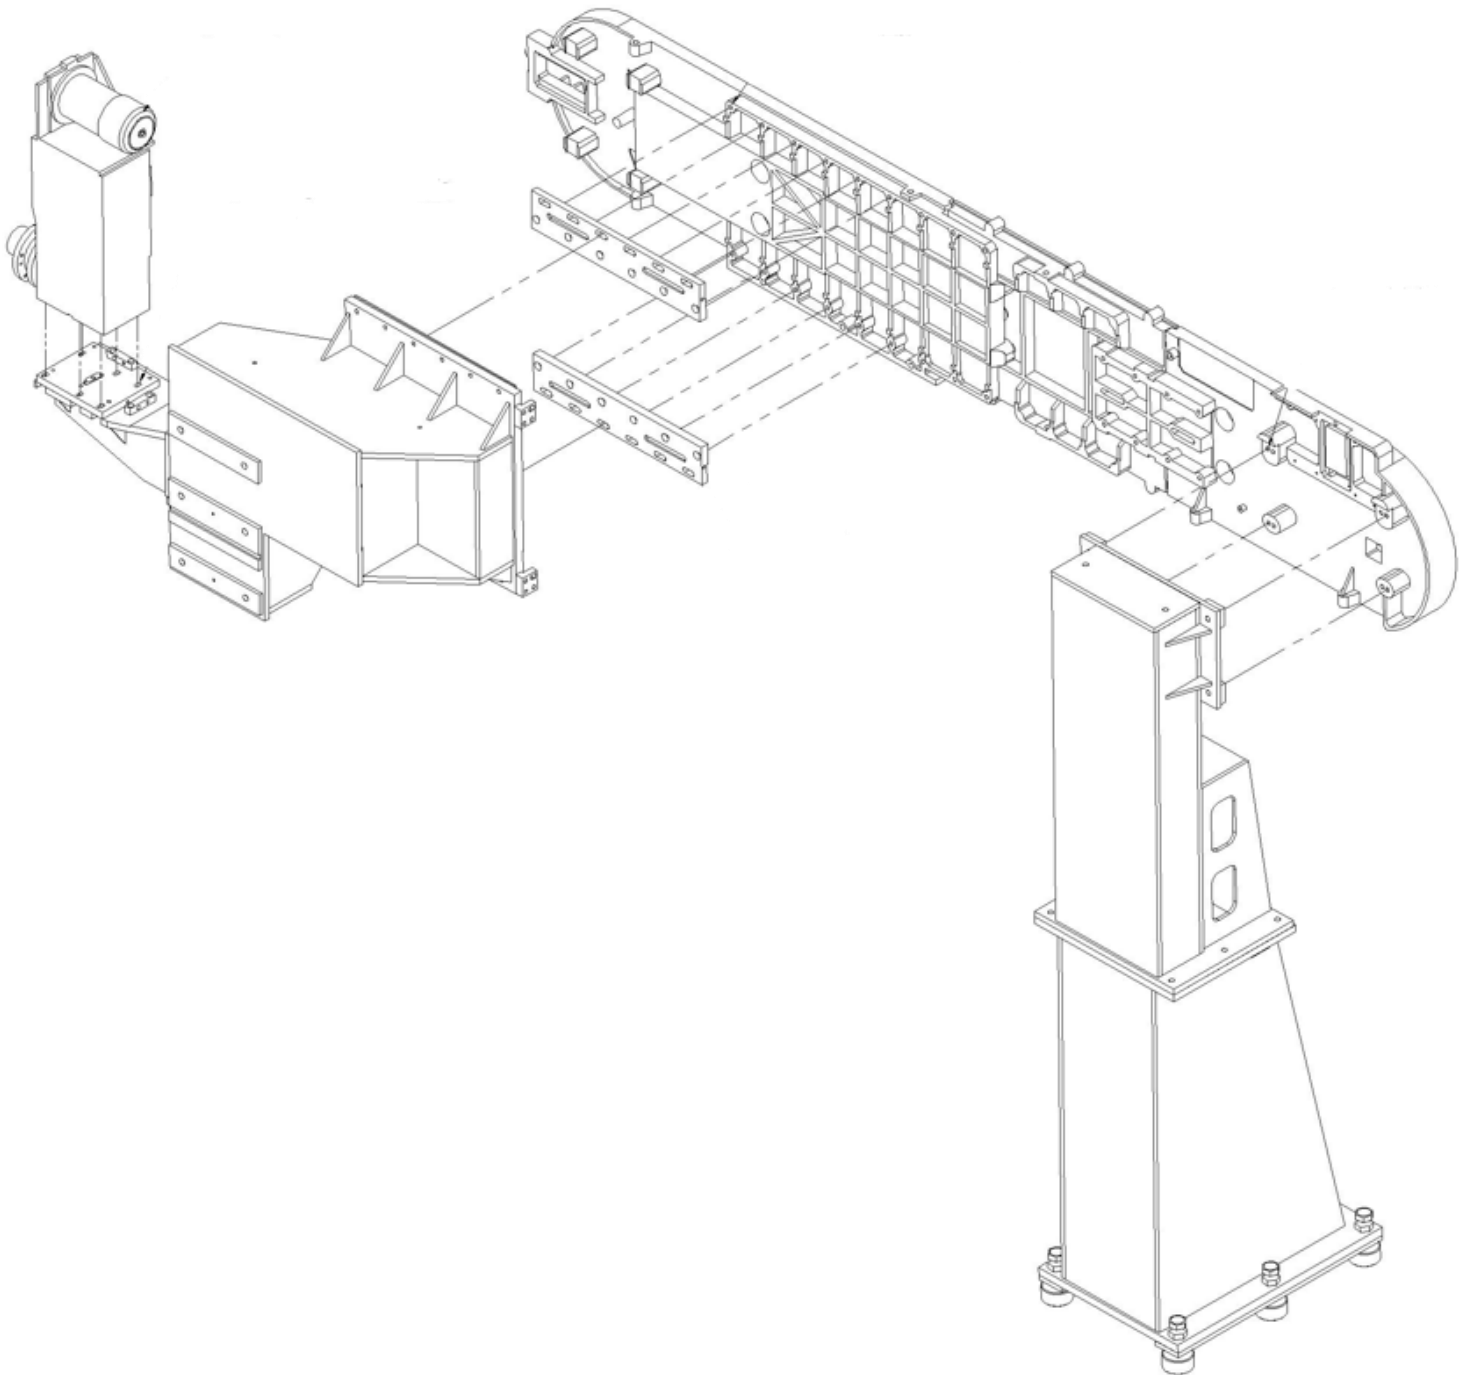


6.3 ELECTRIC ARM TYPE 60 TOOL ATC DRAWING - 2

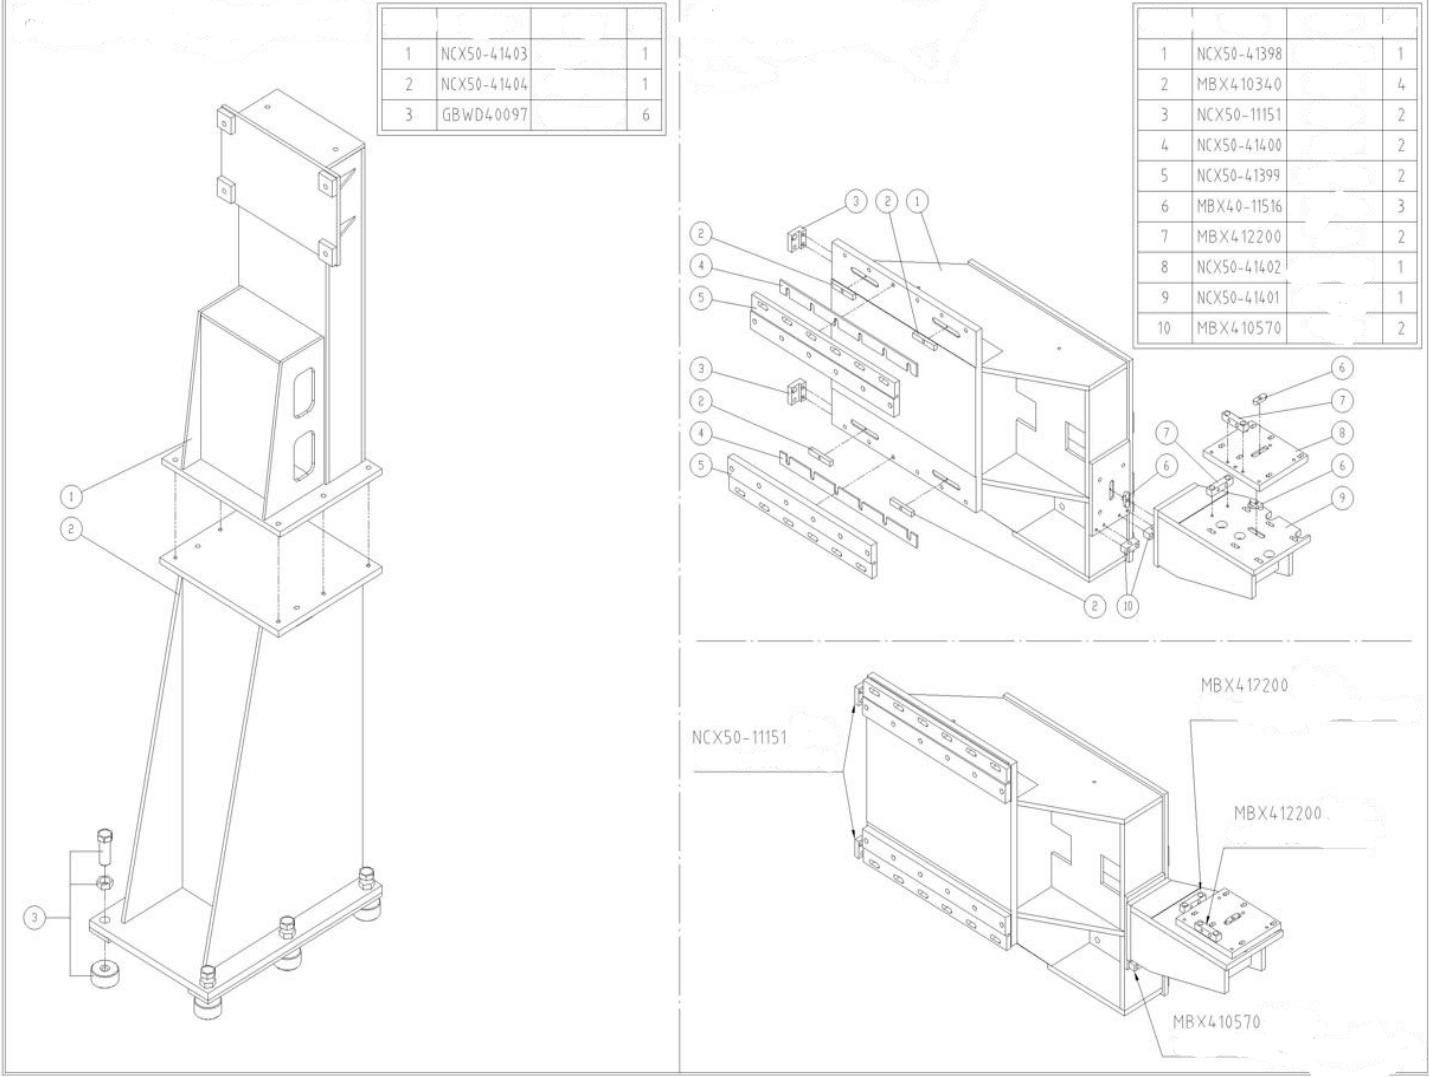


6.3 ELECTRIC ARM TYPE ATC DRAWING - 1

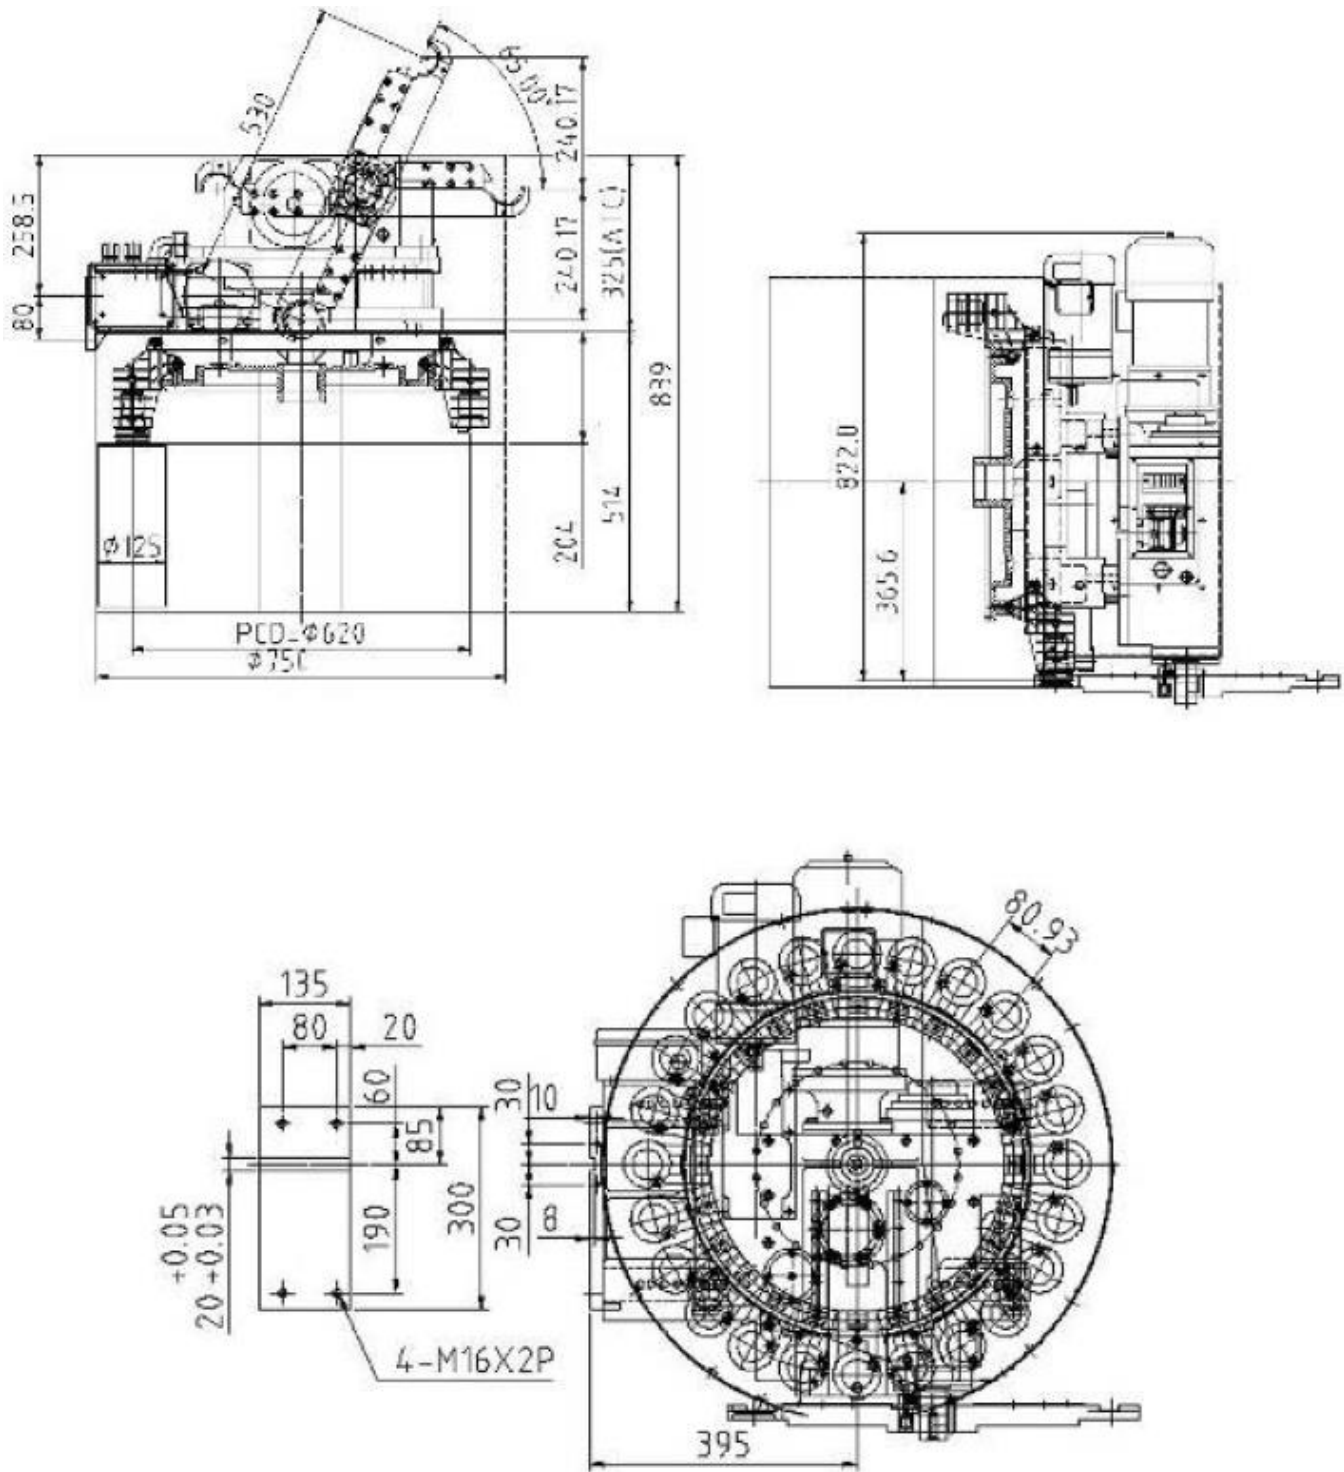

6.3 ELECTRIC ARM TYPE ATC DRAWING – 2

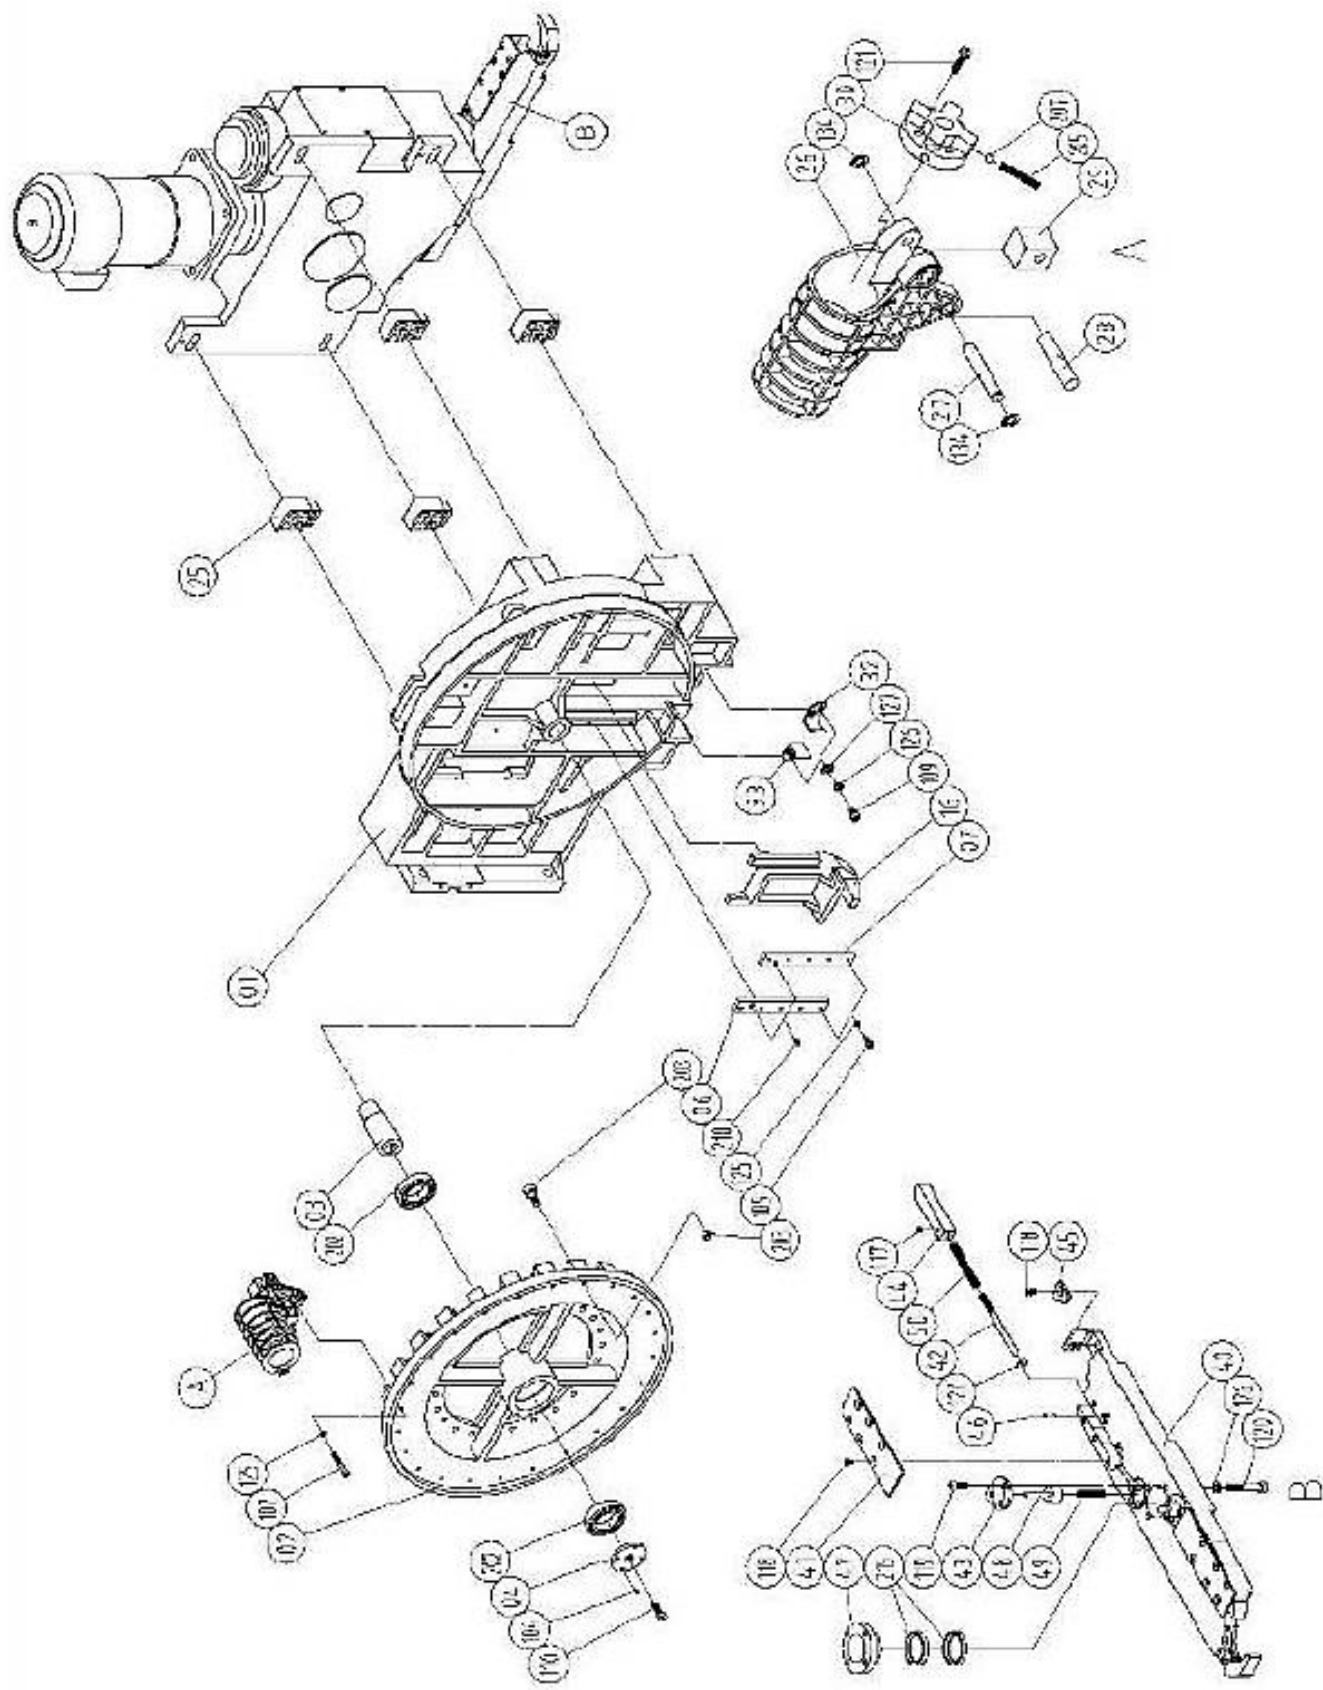

6.3 ELECTRIC ARM TYPE ATC DRAWING – 3

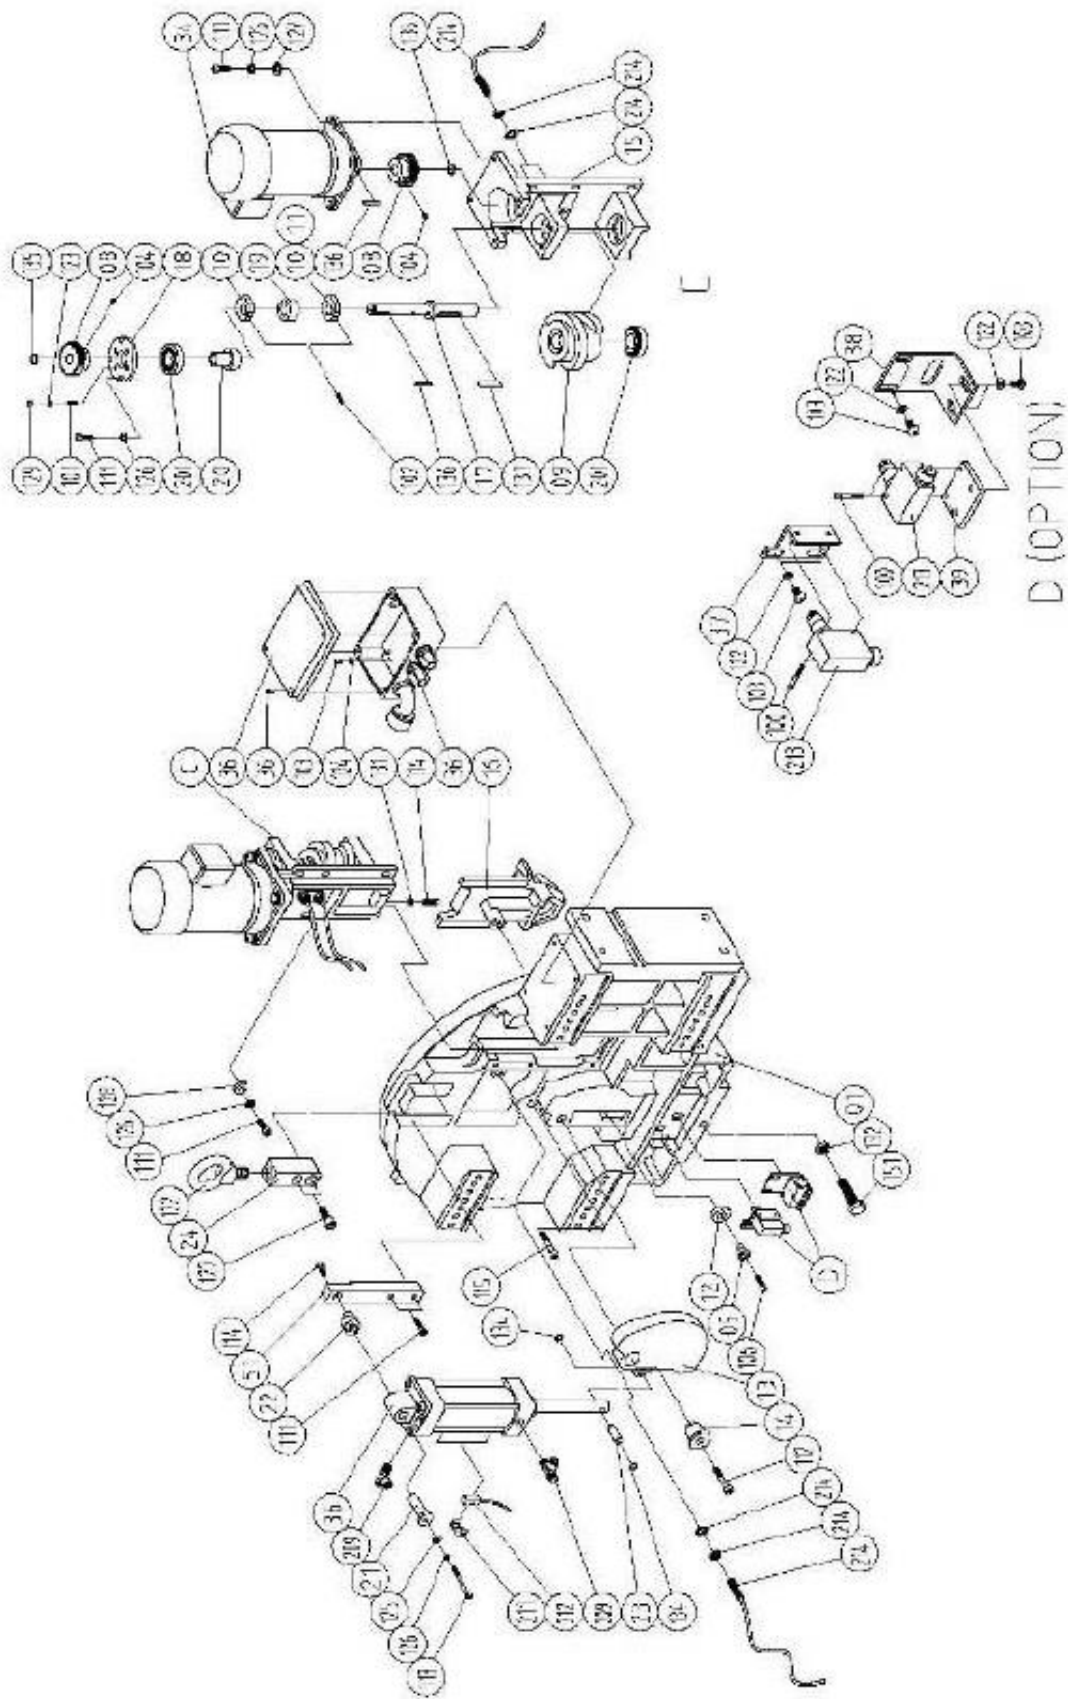

ELECTRIC ARM TYPE ATC - PARTS LIST

No.	Part No.	Part Name	Material / Spec.	QTY	Remark
01	MBX420200	New case	FC-25	1	24T
02	MBX420080	24T Disk plate	FC-25	1	
03	MBX410010	Disk rotate shaft	S45C	1	
04	MBX410030	Fixed cover of rotate shaft	S45C	1	
05	MBX410070	Sleeve of rocker arm	S45C	1	
06	MBX410090	Lock plate right slide seat	S45C	1	
07	MBX410100	Fixed plate of left slide seat	S45C	1	
08	MBX410150	Gear	S45C	2	
09	MBX410220	24 divide up turntable of cam	SCM435	1	
10	MBX410250	Single reaction block (On)	Powder metallurgy	1	
11	MBX411000	Single reaction block (Off)	Powder metallurgy	1	OPTION
12	MBX410290	Rotor of tool upside down	SC45	1	
13	MBX410740	A rocker arm of tool upside down	FCD55	1	
14	MBX410750	A rocker arm's arbor	S45C	1	
15	MBX410760	A cam seat	FCD50	1	
16	MBX410770	24T Tool upside down paw	FCD55	1	
17	MBX410780	An axle center of cam	S45C	1	
18	MBX410790	Bearing cover	S45C	1	
19	MBX410800	Collar	S45C	1	
20	MBX410810	Sleeve of bearing	S45C	1	
21	MBX410850	Fixed shaft of cylinder	S45C	1	
22	MBX410870	Eccentric shaft of cylinder	S45C	1	
23	MBX410880	Connect shaft of piston rod	S45C	1	
24	MBX411010	Fixed block of flying rings	S45C	1	
25	MBX450630	Interface board	AL-6061-T6	4	Ref (DEX65°× 530 L)
26	MBX460010	Tool pot (60°)	POM	24	
27	MBX460020	Rotate shaft of tool pot	S45C	24	
28	MBX460030	Lock shaft of tool pot	S45C	24	
29	MBX460040	Pull block of tool pot	Powder metallurgy	24	
30	MBX460240	Fixed block of pull stud	POM	24	
31	MBX460180	Spring	Piano wire	96	
32	MCX410230	Orientation seat of left pot	SPHC	1	
33	MCX410240	Orientation seat of right pot	SPHC	1	
34	MBX480140	Decelerator of gear motor	Hardware	1	
35	MBX480150	Cylinder of tool pot up & down	Hardware	1	
36	MBX480190	Wiring connect box	Hardware	1	
37	MBX411200	Limit switch fixed seat 1	SPHC	1	
38	MBX411210	Limit switch fixed seat 2	SPHC	1	
39	MBX411220	Limit switch fixed seat 3	SPHC	1	
40	MBX470130	Arm-530L	FCD-50	1	
41	MBX470340	Fixed plate	SPHC	2	
42	MBX470420	Slide block of stop tip	S45C	2	
43	MBX470460	Sleeve of stop tip	S45C	2	
44	MBX470480	Slide & fixed block	S45C	2	
45	MBX470490	Lock key	SS41	2	

ELECTRIC ARM TYPE ATC - PARTS LIST CONTINUED

46	MBX410280	ψ8 Stop tip	S45C	2	
47	MBX470690	Fixed collar	S45C	1	
48	MBX470720	Stop tip	SCM415	2	
49	MBX470740	Spring ψ1.2×9od×14T×41L	Piano wire	2	For stop tip
50	MBX470750	Spring ψ1.2×11od×20T×78.5L	Piano wire	2	For Slide block of stop tip
51	MBX410860	Cylinder fixed block	S45C	1	
100		Hexagonal bolt	M4×0.7P-25L	4	For limit switch
101		Stop bolt	M5×0.8P-20L	4	
102		Stop bolt	M5×0.8P-25L	2	
103		Hex. socket head screw	M5×0.8P-12L	4	Limit switch (OP)*10 PCS
104		Stop bolt	M6×1P-8L	6	
105		Hexagonal bolt	M6×1P-20L	10	
106		Hexagonal bolt	M6×1P-25L	1	
107		Hexagonal bolt	M6×1P-40L	24	Compose with 20T Disk*20PCS
108		External Hexagonal bolt	M6×1P-20L	1	Origin point reaction
109		Hexagonal bolt	M8×1.25P-16L	4	
110		Hexagonal bolt	M8×1.25P-20L	1	
111		Hexagonal bolt	M8×1.25P-25L	14	
112		Hexagonal bolt	M8×1.25P-45L	1	
113		Hexagonal bolt	M8×1.25P-65L	1	
114		External Hexagonal bolt	M8×1.25P-30L	1	
115		Hexagonal bolt	M10×1.5P-65L	1	
116		Hexagonal bolt	M12×1.75P-20L	1	
117		Stop bolt	M6×1P-6L	2	For arm
118		Shallow head screw	M6X1P-10L	14	For arm
119		Hexagonal bolt	M6×1P-16L	6	For arm
120		Hexagonal bolt	M8×1.25P-55L	4	For arm
121		Self-tap screw	3/16 × 1"	96	
122		An eye ring	M16	1	
123		Spring washer	M5	4	
124		Flat washer	M5	4	
125		Spring washer	M6	34	Compose with 20T
126		Spring washer	M8	20	
127		Flat washer	M8 × 2T	14	
128		Flat washer	M8 × 5T	6	
129		Nut	M5 × 0.8P	4	
130		Nut	M6 × 1P	2	
131		Nut	M8 × 1.25P	1	
132		Nut	M16 × 1.5P	1	
133					
134		C Ring (External)	S-10	50	Compose with 20T Disk* 42 PCS
135		C Ring (External)	S-18	2	
136		Single side round key	5 × 5 × 28L	2	
137		Double side round key	8 × 7 × 40L	1	
201	GKW030205	Angular ball bearing	30205JR(HIC)	2	
202	GKW006008	Deep groove ball bearing	6008 ZZ	2	
203	GKWCF0010	Bearing for cam (With M10 nut)	CF-10	24	20T- 20 PCS


ELECTRIC ARM TYPE ATC - PARTS LIST CONTINUED

204					
205	MBX460180	Spring	$\psi 1.2 \times 7.8 \text{od} \times 10 \text{T} \times 25 \text{L}$	96	20T- 80 PCS
206					
207		Steel ball	$\psi 8$	96	
208					
209	EDWN00001	Air throttle	$1/4 \times \phi 8$	2	
210	FEWN10002	Oil filler joint	1/8 PT	2	
211	MBX480450	Sensor fixed jig	PM-10	2	
212	EAWC00001	Magnetism reed switch	LS-BD2	2	
213	EAWA00001	Micro limit switch	YAMATAKA SL1-A	2	
214	EAWB00001	Proximity switch	BALLUFF-PSC40B	3	Sensor+Nut+Washer
215	GLW040045	Taper cone Collar	40×45	2	

6.4 ELECTRIC ARM TYPE ATC – INPUT SHAFT DRAWING & PARTS LIST

No.	Parts No.	Specification	Q'ty	Parts No.	Specification	Q'ty
101A	A-0203000001	Case	1	210	80782-0120	1
101B	A-0203000001H	Case cap	1	219	05X36*2*95	1
102	A-0204000001	Cam shaft	1	224	RI-36*101	12
103	A-0204000001	Turn-up cap	2	225	RI-36*101	2
104	A-0204000001H	Turn-up screw cap	2	227	RI-36*251	12
105	A-0204000001	Cam shaft sprocket	1	228	RI-36*101	2
111	A-0205000000	Case	1	241	F-1/2"	1
127	A-0210000001	Big endurella gear	1	242	CL-226	1
201	10030008	Round roller bearing 20M	2	248	PIB-T-3*32L	3
213	0-55*2	O ring 55*2	2	249	PIB-P-8*32L	2
214	G76	O ring G76	2			

INPUT SHAFT

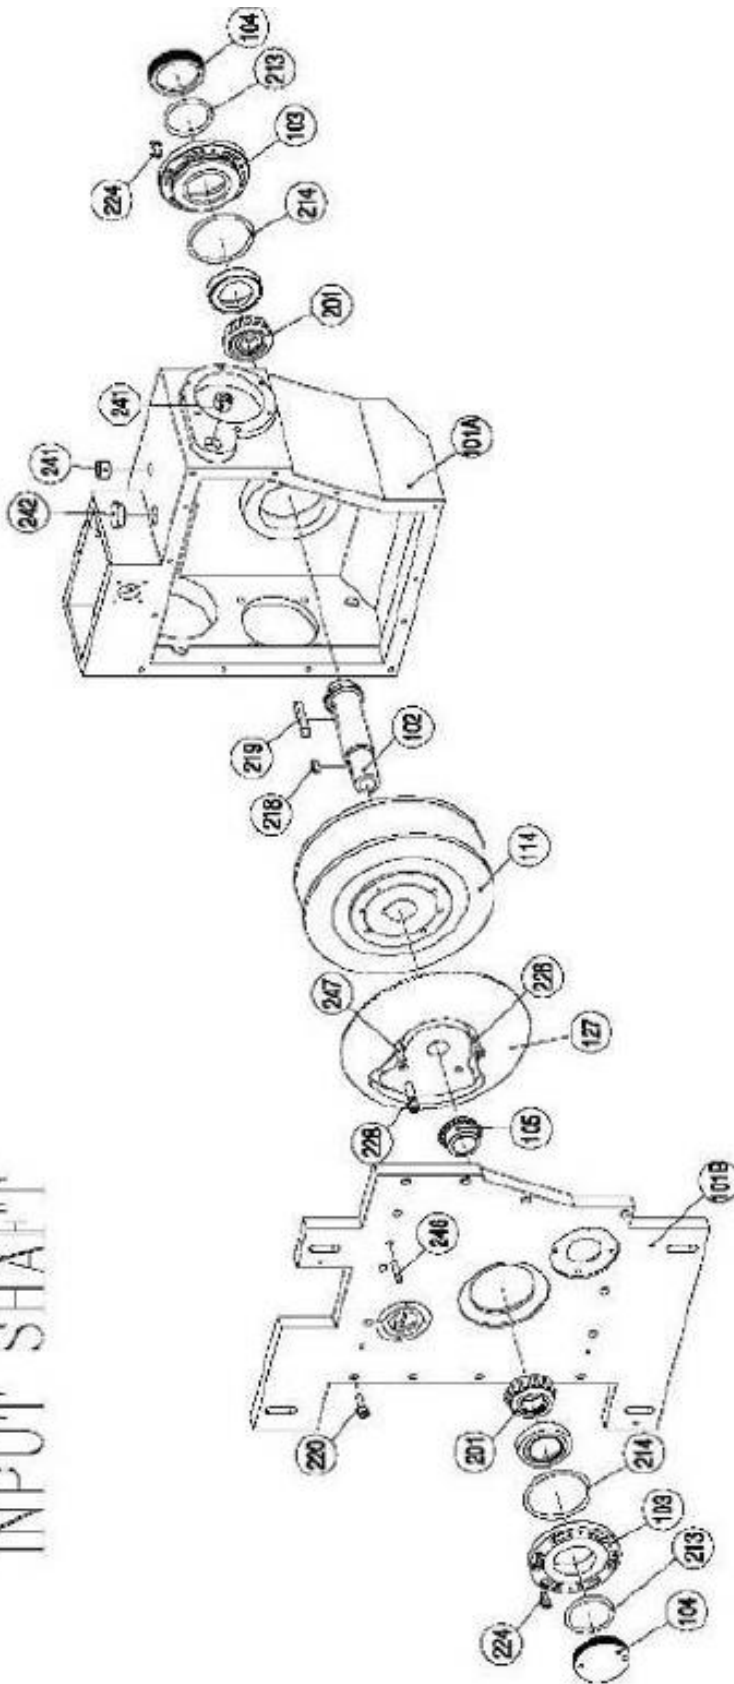


6.5 ELECTRIC ARM TYPE ATC – OUTPUT SHAFT & MOTOR DRAWING & PARTS LIST


OUTPUT PARTS

P.O.	Parts No.	Specification.	Qty
101A	A4025000001	Case	1
108	A4025000001	Spline/shaft shaft	1
107	A4025000001	Pressure wheel	1
109	A4025000001	Bearing tube	1
110	A4025000001	Bearing tube fixture	1
116	A4025000001	Bearing tube gasket	1
111	A1025000001	Front flx cap	1
112	A4025000001	Back flx cap	1
114	A4025000001	Bearing tube	8
103	F1020111	Input shaft key	2
105	A305	Shaft nut A305	1
106	A306	Shaft nut A306	1
110	A307	Shaft nut A307	1
111	A308	Shaft nut A308	1
112	A309	Shaft nut A309	1
113	A310	Shaft nut A310	1
114	A311	Shaft nut A311	1
115	A312	Shaft nut A312	1
116	A313	Shaft nut A313	1
117	A314	Shaft nut A314	1
118	A315	Shaft nut A315	1
119	A316	Shaft nut A316	1
120	A317	Shaft nut A317	1
121	A318	Shaft nut A318	1
122	A319	Shaft nut A319	1
123	A320	Shaft nut A320	1
124	A321	Shaft nut A321	1
125	A322	Shaft nut A322	1
126	A323	Shaft nut A323	1
127	A324	Shaft nut A324	1
128	A325	Shaft nut A325	1
129	A326	Shaft nut A326	1
130	A327	Shaft nut A327	1
131	A328	Shaft nut A328	1
132	A329	Shaft nut A329	1
133	A330	Shaft nut A330	1
134	A331	Shaft nut A331	1
135	A332	Shaft nut A332	1
136	A333	Shaft nut A333	1
137	A334	Shaft nut A334	1
138	A335	Shaft nut A335	1
139	A336	Shaft nut A336	1
140	A337	Shaft nut A337	1
141	A338	Shaft nut A338	1
142	A339	Shaft nut A339	1
143	A340	Shaft nut A340	1
144	A341	Shaft nut A341	1
145	A342	Shaft nut A342	1
146	A343	Shaft nut A343	1
147	A344	Shaft nut A344	1
148	A345	Shaft nut A345	1
149	A346	Shaft nut A346	1
150	A347	Shaft nut A347	1
151	A348	Shaft nut A348	1
152	A349	Shaft nut A349	1
153	A350	Shaft nut A350	1
154	A351	Shaft nut A351	1
155	A352	Shaft nut A352	1
156	A353	Shaft nut A353	1
157	A354	Shaft nut A354	1
158	A355	Shaft nut A355	1
159	A356	Shaft nut A356	1
160	A357	Shaft nut A357	1
161	A358	Shaft nut A358	1
162	A359	Shaft nut A359	1
163	A360	Shaft nut A360	1
164	A361	Shaft nut A361	1
165	A362	Shaft nut A362	1
166	A363	Shaft nut A363	1
167	A364	Shaft nut A364	1
168	A365	Shaft nut A365	1
169	A366	Shaft nut A366	1
170	A367	Shaft nut A367	1
171	A368	Shaft nut A368	1
172	A369	Shaft nut A369	1
173	A370	Shaft nut A370	1
174	A371	Shaft nut A371	1
175	A372	Shaft nut A372	1
176	A373	Shaft nut A373	1
177	A374	Shaft nut A374	1
178	A375	Shaft nut A375	1
179	A376	Shaft nut A376	1
180	A377	Shaft nut A377	1
181	A378	Shaft nut A378	1
182	A379	Shaft nut A379	1
183	A380	Shaft nut A380	1
184	A381	Shaft nut A381	1
185	A382	Shaft nut A382	1
186	A383	Shaft nut A383	1
187	A384	Shaft nut A384	1
188	A385	Shaft nut A385	1
189	A386	Shaft nut A386	1
190	A387	Shaft nut A387	1
191	A388	Shaft nut A388	1
192	A389	Shaft nut A389	1
193	A390	Shaft nut A390	1
194	A391	Shaft nut A391	1
195	A392	Shaft nut A392	1
196	A393	Shaft nut A393	1
197	A394	Shaft nut A394	1
198	A395	Shaft nut A395	1
199	A396	Shaft nut A396	1
200	A397	Shaft nut A397	1
201	A398	Shaft nut A398	1
202	A399	Shaft nut A399	1
203	A400	Shaft nut A400	1
204	A401	Shaft nut A401	1
205	A402	Shaft nut A402	1
206	A403	Shaft nut A403	1
207	A404	Shaft nut A404	1
208	A405	Shaft nut A405	1
209	A406	Shaft nut A406	1
210	A407	Shaft nut A407	1
211	A408	Shaft nut A408	1
212	A409	Shaft nut A409	1
213	A410	Shaft nut A410	1
214	A411	Shaft nut A411	1
215	A412	Shaft nut A412	1
216	A413	Shaft nut A413	1
217	A414	Shaft nut A414	1
218	A415	Shaft nut A415	1
219	A416	Shaft nut A416	1
220	A417	Shaft nut A417	1
221	A418	Shaft nut A418	1
222	A419	Shaft nut A419	1
223	A420	Shaft nut A420	1
224	A421	Shaft nut A421	1
225	A422	Shaft nut A422	1
226	A423	Shaft nut A423	1
227	A424	Shaft nut A424	1
228	A425	Shaft nut A425	1
229	A426	Shaft nut A426	1
230	A427	Shaft nut A427	1
231	A428	Shaft nut A428	1
232	A429	Shaft nut A429	1
233	A430	Shaft nut A430	1
234	A431	Shaft nut A431	1
235	A432	Shaft nut A432	1
236	A433	Shaft nut A433	1
237	A434	Shaft nut A434	1
238	A435	Shaft nut A435	1
239	A436	Shaft nut A436	1
240	A437	Shaft nut A437	1
241	A438	Shaft nut A438	1
242	A439	Shaft nut A439	1
243	A440	Shaft nut A440	1
244	A441	Shaft nut A441	1
245	A442	Shaft nut A442	1
246	A443	Shaft nut A443	1
247	A444	Shaft nut A444	1
248	A445	Shaft nut A445	1
249	A446	Shaft nut A446	1
250	A447	Shaft nut A447	1
251	A448	Shaft nut A448	1
252	A449	Shaft nut A449	1
253	A450	Shaft nut A450	1
254	A451	Shaft nut A451	1
255	A452	Shaft nut A452	1
256	A453	Shaft nut A453	1
257	A454	Shaft nut A454	1
258	A455	Shaft nut A455	1
259	A456	Shaft nut A456	1
260	A457	Shaft nut A457	1
261	A458	Shaft nut A458	1
262	A459	Shaft nut A459	1
263	A460	Shaft nut A460	1
264	A461	Shaft nut A461	1
265	A462	Shaft nut A462	1
266	A463	Shaft nut A463	1
267	A464	Shaft nut A464	1
268	A465	Shaft nut A465	1
269	A466	Shaft nut A466	1
270	A467	Shaft nut A467	1
271	A468	Shaft nut A468	1
272	A469	Shaft nut A469	1
273	A470	Shaft nut A470	1
274	A471	Shaft nut A471	1
275	A472	Shaft nut A472	1
276	A473	Shaft nut A473	1
277	A474	Shaft nut A474	1
278	A475	Shaft nut A475	1
279	A476	Shaft nut A476	1
280	A477	Shaft nut A477	1
281	A478	Shaft nut A478	1
282	A479	Shaft nut A479	1
283	A480	Shaft nut A480	1
284	A481	Shaft nut A481	1
285	A482	Shaft nut A482	1
286	A483	Shaft nut A483	1
287	A484	Shaft nut A484	1
288	A485	Shaft nut A485	1
289	A486	Shaft nut A486	1
290	A487	Shaft nut A487	1
291	A488	Shaft nut A488	1
292	A489	Shaft nut A489	1
293	A490	Shaft nut A490	1
294	A491	Shaft nut A491	1
295	A492	Shaft nut A492	1
296	A493	Shaft nut A493	1
297	A494	Shaft nut A494	1
298	A495	Shaft nut A495	1
299	A496	Shaft nut A496	1
300	A497	Shaft nut A497	1
301	A498	Shaft nut A498	1
302	A499	Shaft nut A499	1
303	A500	Shaft nut A500	1
304	A501	Shaft nut A501	1
305	A502	Shaft nut A502	1
306	A503	Shaft nut A503	1
307	A504	Shaft nut A504	1
308	A505	Shaft nut A505	1
309	A506	Shaft nut A506	1
310	A507	Shaft nut A507	1
311	A508	Shaft nut A508	1
312	A509	Shaft nut A509	1
313	A510	Shaft nut A510	1
314	A511	Shaft nut A511	1
315	A512	Shaft nut A512	1
316	A513	Shaft nut A513	1
317	A514	Shaft nut A514	1
318	A515	Shaft nut A515	1
319	A516	Shaft nut A516	1
320	A517	Shaft nut A517	1
321	A518	Shaft nut A518	1
322	A519	Shaft nut A519	1
323	A520	Shaft nut A520	1
324	A521	Shaft nut A521	1
325	A522	Shaft nut A522	1
326	A523	Shaft nut A523	1
327	A524	Shaft nut A524	1
328	A525	Shaft nut A525	1
329	A526	Shaft nut A526	1
330	A527	Shaft nut A527	1
331	A528	Shaft nut A528	1
332	A529	Shaft nut A529	1
333	A530	Shaft nut A530	1
334	A531	Shaft nut A531	1
335	A532	Shaft nut A532	1
336	A533	Shaft nut A533	1
337	A534	Shaft nut A534	1
338	A535	Shaft nut A535	1
339	A536	Shaft nut A536	1
340	A537	Shaft nut A537	1
341	A538	Shaft nut A538	1
342	A539	Shaft nut A539	1
343	A540	Shaft nut A540	1
344	A541	Shaft nut A541	1
345	A542	Shaft nut A542	1
346	A543	Shaft nut A543	1
347	A544	Shaft nut A544	1
348	A545	Shaft nut A545	1
349	A546	Shaft nut A546	1
350	A547	Shaft nut A547	1
351	A548	Shaft nut A548	1
352	A549	Shaft nut A549	1
353	A550	Shaft nut A550	1
354	A551	Shaft nut A551	1
355	A552	Shaft nut A552	1
356	A553	Shaft nut A553	1
357	A554	Shaft nut A554	1
358	A555	Shaft nut A555	1
359	A556	Shaft nut A556	1
360	A557	Shaft nut A557	1
361	A558	Shaft nut A558	1
362	A559	Shaft nut A559	1
363	A560	Shaft nut A560	1
364	A561	Shaft nut A561	1
365	A562	Shaft nut A562	1
366	A563	Shaft nut A563	1
367	A564	Shaft nut A564	1
368	A565	Shaft nut A565	1
369	A566	Shaft nut A566	1
370	A567	Shaft nut A567	1
371	A568	Shaft nut A568	1
372	A569	Shaft nut A569	1
373	A570	Shaft nut A570	1
374	A571	Shaft nut A571	1
375	A572	Shaft nut A572	1
376	A573	Shaft nut A573	1
377	A574	Shaft nut A574	1
378	A575	Shaft nut A575	1
379	A576	Shaft nut A576	1
380	A577	Shaft nut A577	1
381	A578	Shaft nut A578	1
382	A579	Shaft nut A579	1
383	A580	Shaft nut A580	1
384	A581	Shaft nut A581	1
385	A582	Shaft nut A582	1
386	A583	Shaft nut A583	1
387	A584	Shaft nut A584	1
388	A585	Shaft nut A585	1
389	A586	Shaft nut A586	1
390	A587	Shaft nut A587	1
391	A588	Shaft nut A588	1
392	A589	Shaft nut A589	1
393	A590	Shaft nut A590	1
394	A591	Shaft nut A591	1
395	A592	Shaft nut A592	1
396	A593	Shaft nut A593	1
397	A594	Shaft nut A594	1
398	A595	Shaft nut A595	1
399	A596	Shaft nut A596	1
400	A597	Shaft nut A597	1
401	A598	Shaft nut A598	1
402	A599	Shaft nut A599	1
403	A600	Shaft nut A600	1
404	A601	Shaft nut A601	1
405	A602	Shaft nut A602	1
406	A603	Shaft nut A603	1
407	A604	Shaft nut A604	1
408	A605	Shaft nut A605	1
409	A606	Shaft nut A606	1
410	A607	Shaft nut A607	1
411	A608	Shaft nut A608	1
412	A609	Shaft nut A609	1
413	A610	Shaft nut A610	1
414	A611	Shaft nut A611	1
415	A612	Shaft nut A612	1
416	A613	Shaft nut A613	1
417	A614	Shaft nut A614	1
418	A615	Shaft nut A615	1
419	A616	Shaft nut A61	


6.6 ELECTRIC ARM TYPE ATC – SIGNAL PARTS DRAWING & PARTS LIST

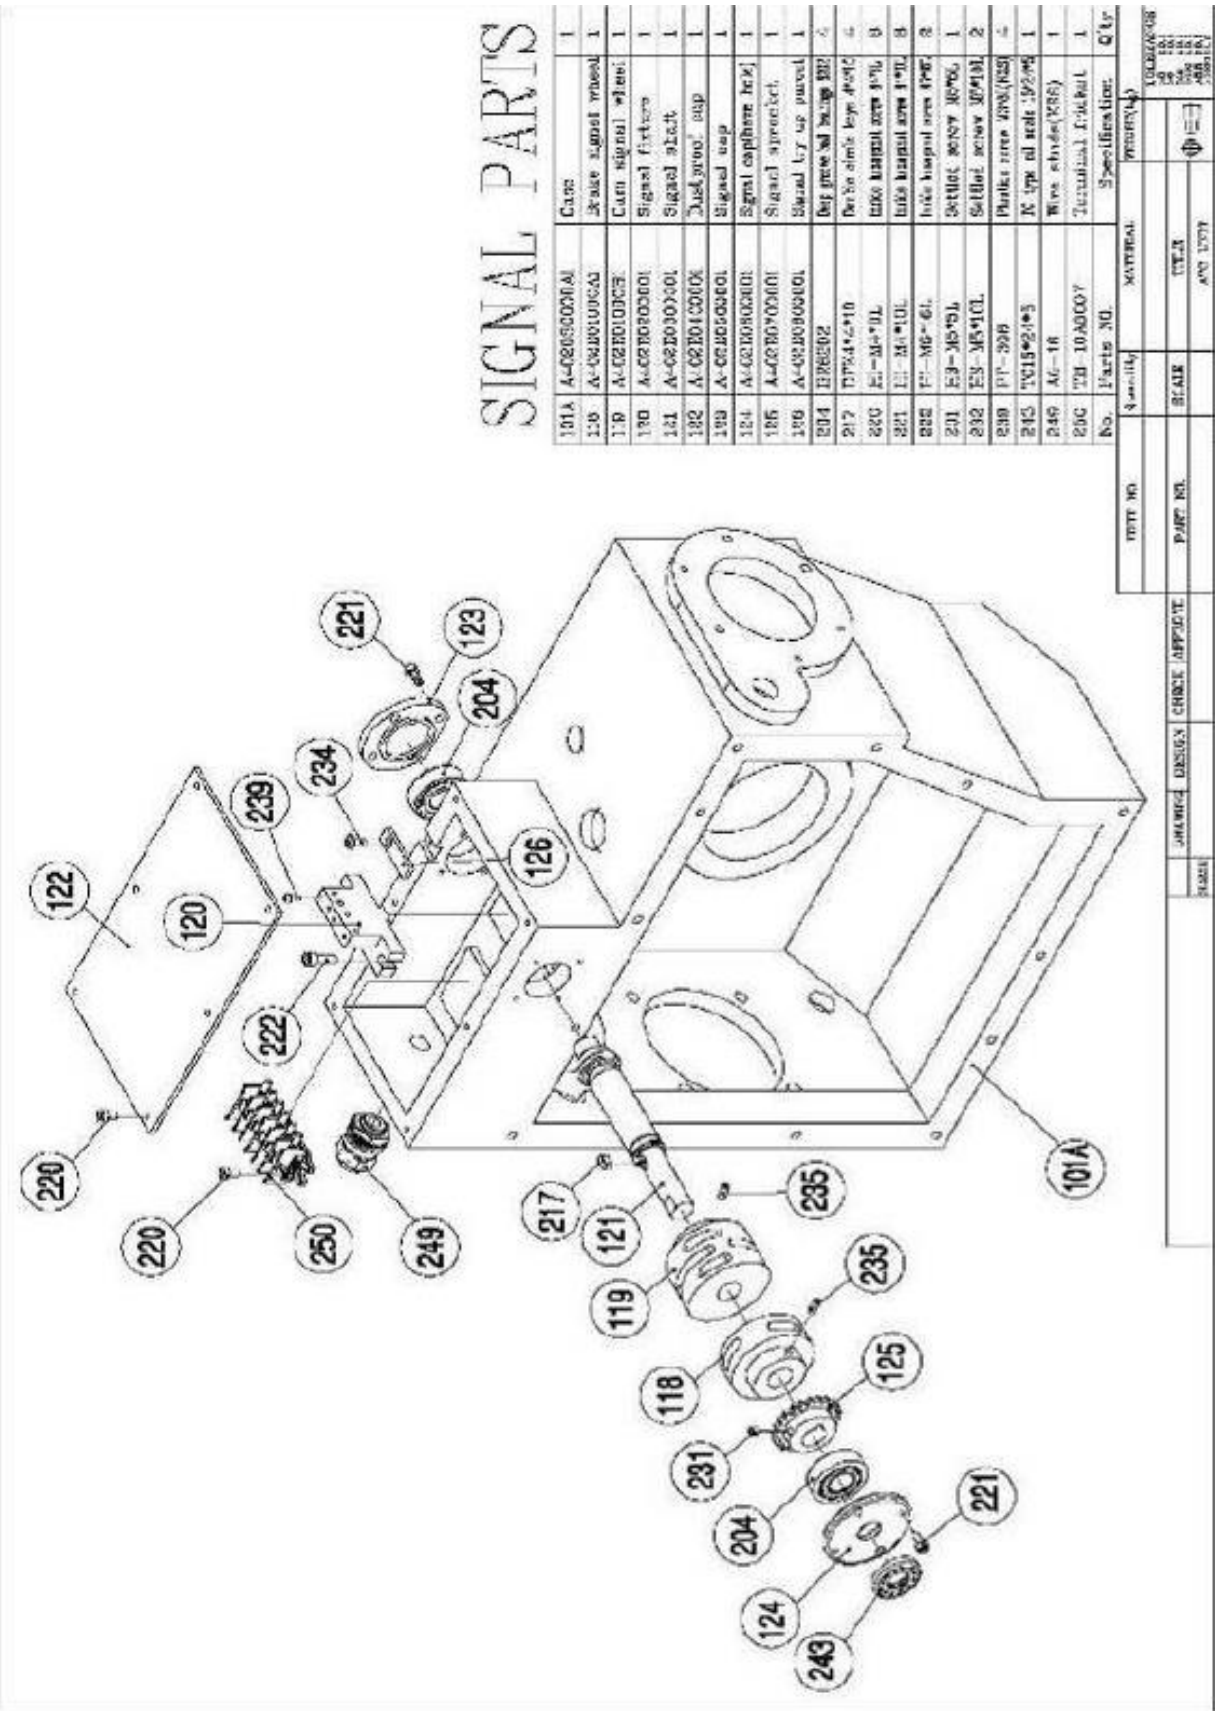


6.7 ELECTRIC ARM TYPE ATC – ROCKER & IDLER SPROCKET DRAWING & PARTS LIST

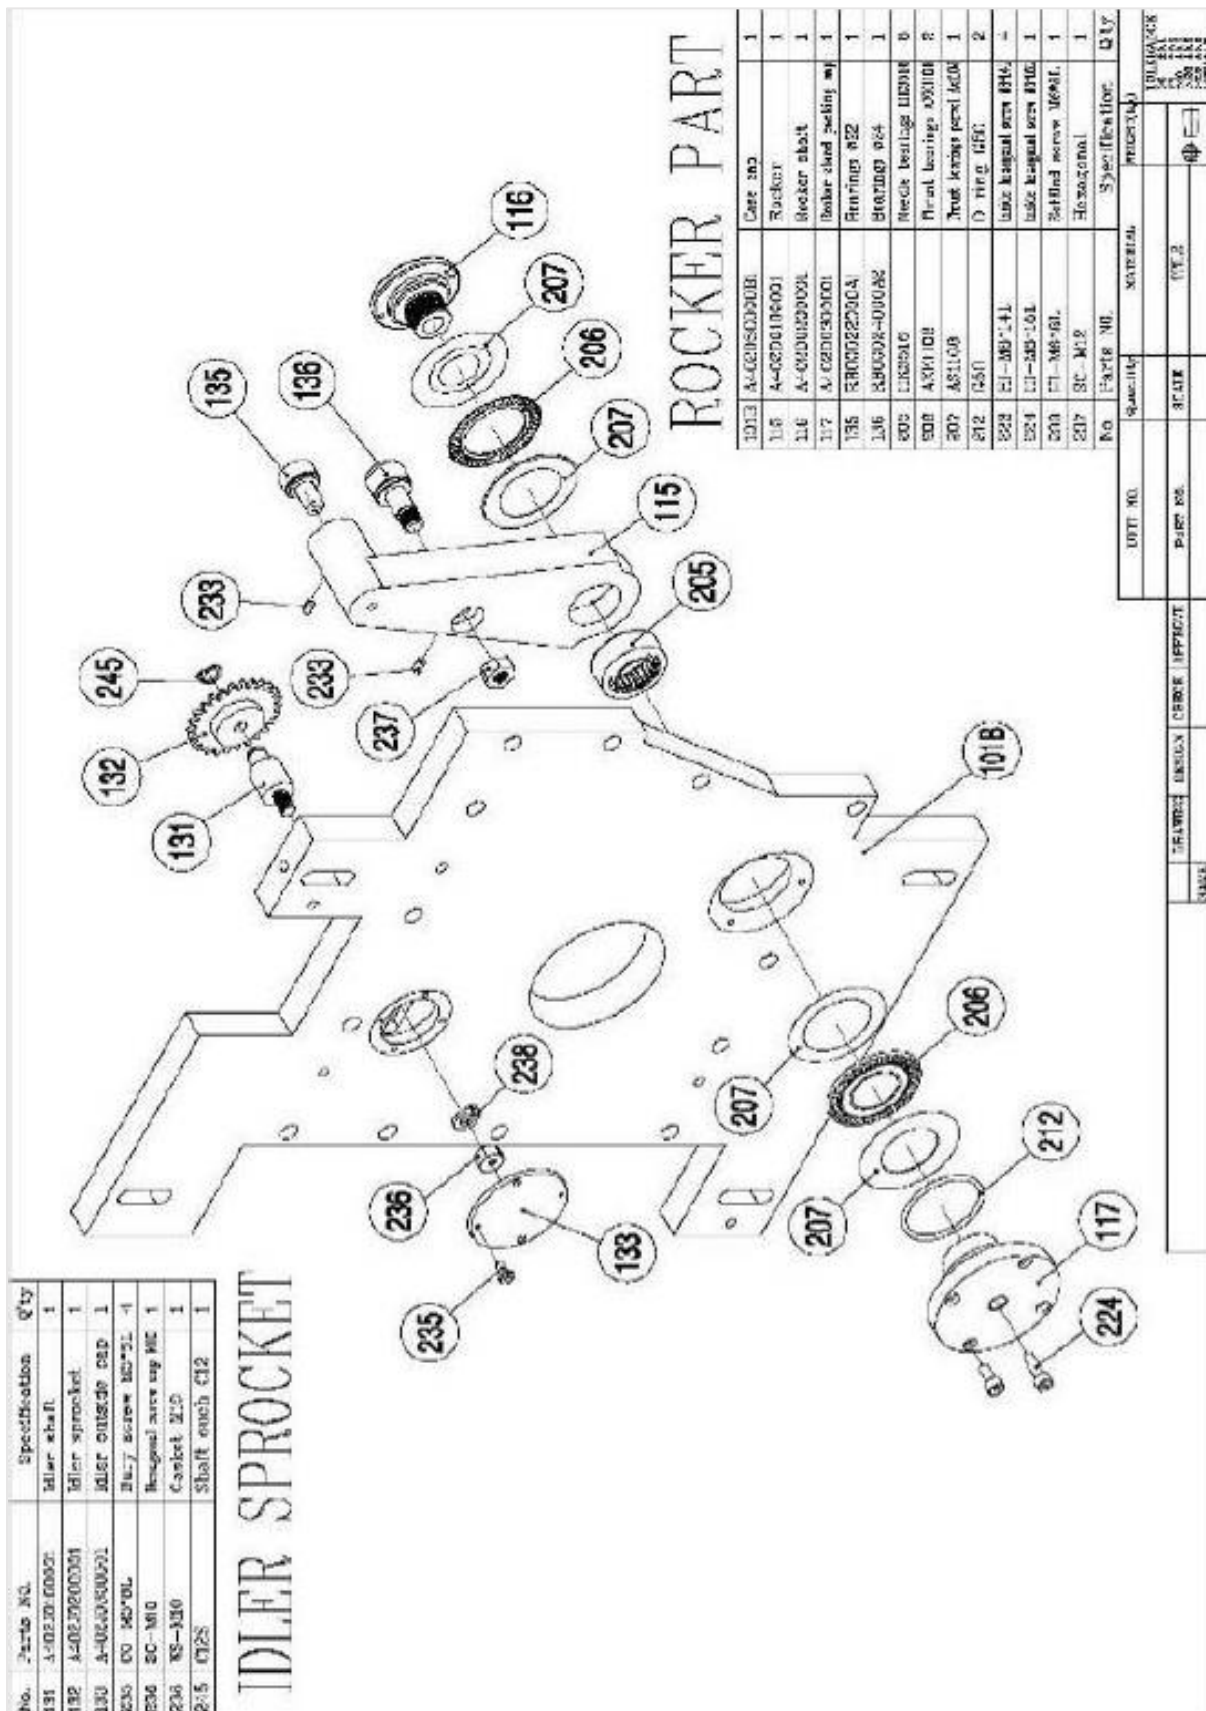

HB SERIES BASIC COMPONENTS DRAWING

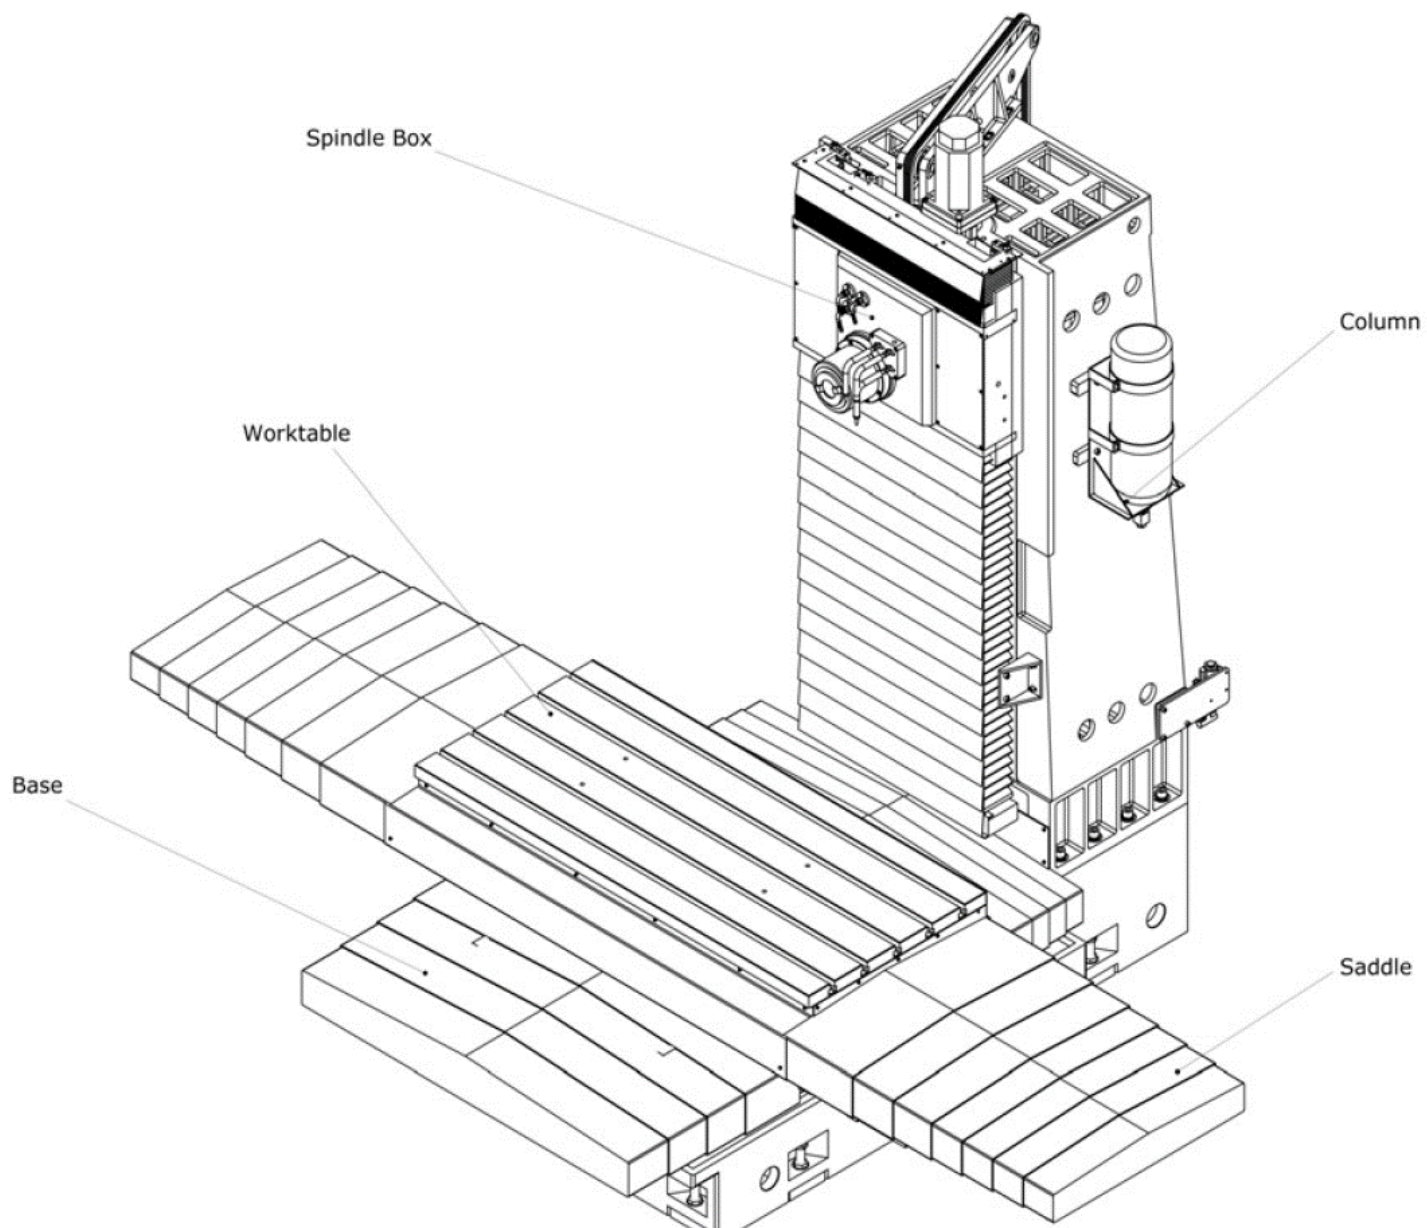


HB-70 BASE ASSEMBLY DRAWING & PARTS LIST

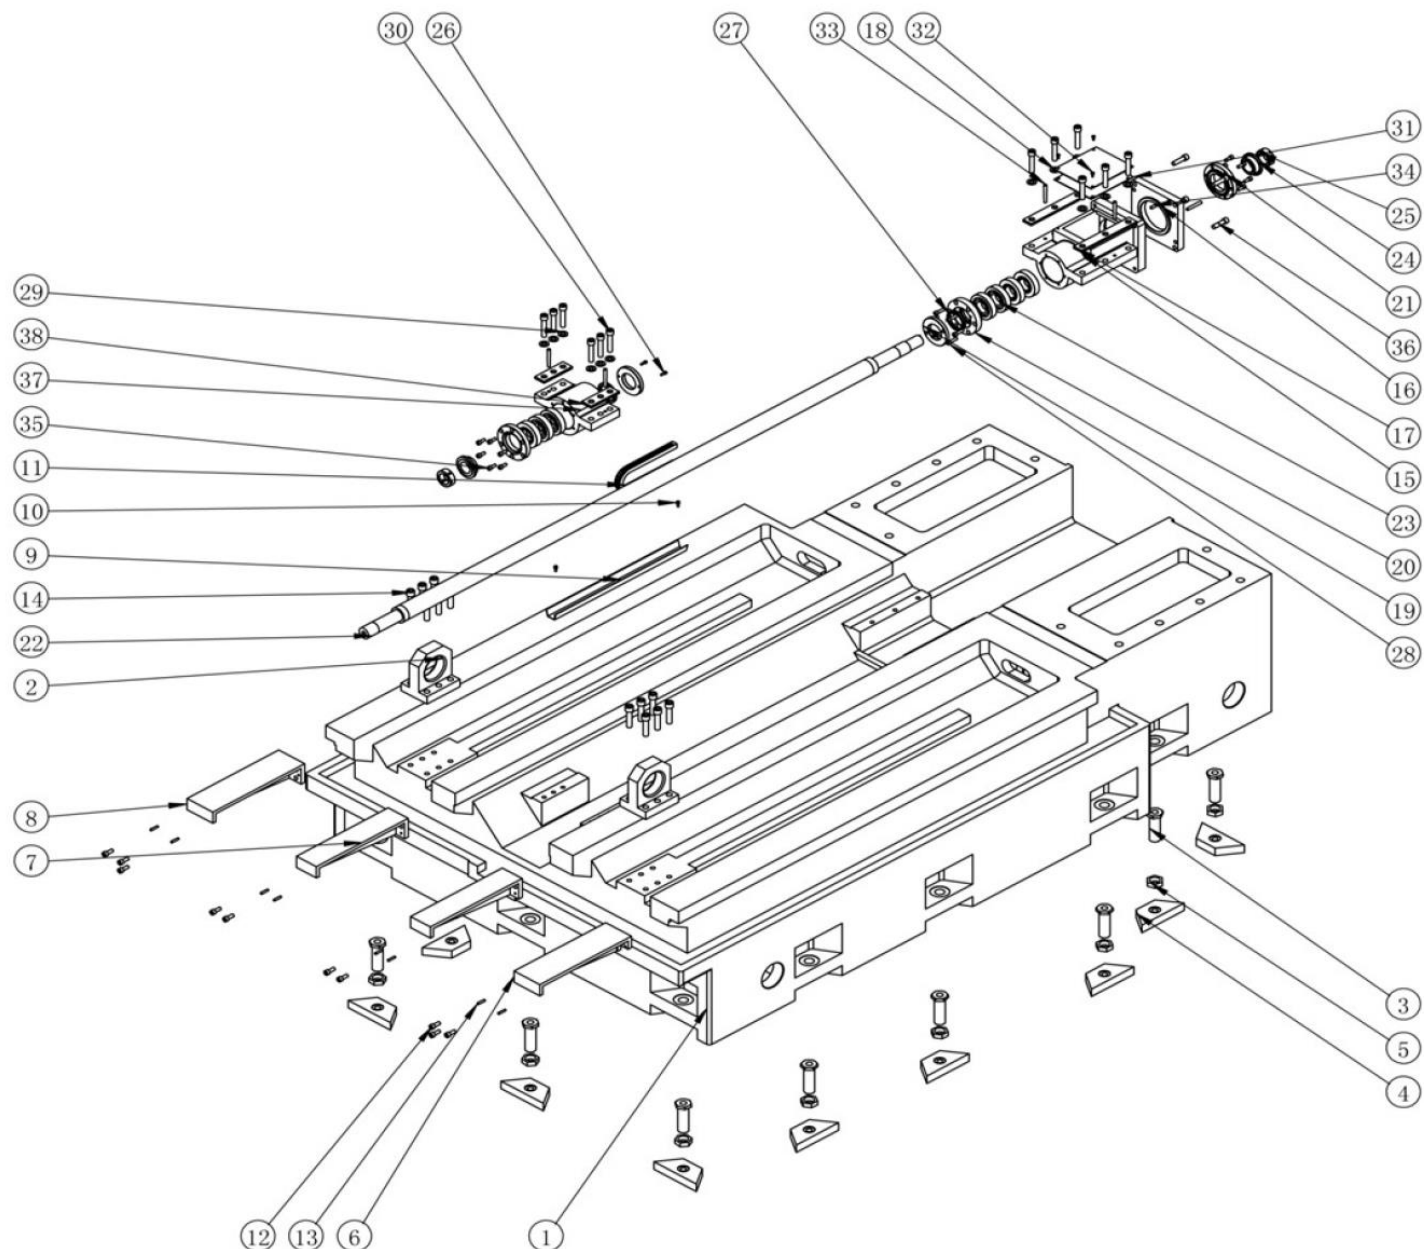

ITEM	PART NAME	QTY
1	Base	1
2	Lifting lug	2
3	Ground leveling screws (1690)	13
4	Ground pad (1690)	13
5	Ground screw nut	13
6	Support for telescopic protection	1
7	Support for telescopic protection	2
8	Support for telescopic protection	1

9	Guiding slot for Y axis oil tube	1
10	GB/T70.1-2000 (M6-12-12.9)	2
11	Towline for oil tube	1
12	GB/T70.1-2000 (M10-25-12.9)	10
13	GB/T118-2000 (6*30)	8
14	GB/T70.1-2000 (M16-65-12.9)	12
15	Motor mounting house	1
16	Motor mounting pad	1
17	Adjusting plate	2
18	Cover on mounting house	1
19	Collision block	2
20	Fixing cover for bearing	1
21	Cover on bearing	2
22	Y axis ball screw	1
23	Ball screw bearing 4090	7
24	Pressure pad on bearing	2
25	YSFM40*1.5	2
26	GB/T70.1-2000 (M5*16-12.9)	4
27	Lips-shape sealing ring (GB/T13871-1992)	2
28	GB/T70.1-2000 (M8*30-12.9)	6
29	Chamfered-type flat washer	12
30	GB/T70.1-2000 (M6*14-12.9)	12
31	Dust washer 1690	1
32	M5*12	4
33	GB/T118-200 (8*70)	4
34	GB/T118-200 (8*60)	2
35	GB/T70.1-2000 (M8)*45-12.9	12
36	GB/T70.1-2000 (M12)*45~12.9	4
37	Bearing box	1
38	Adjusting plate for bearing box	2

HB-70 SADDLE ASSEMBLY DRAWING & PARTS LIST

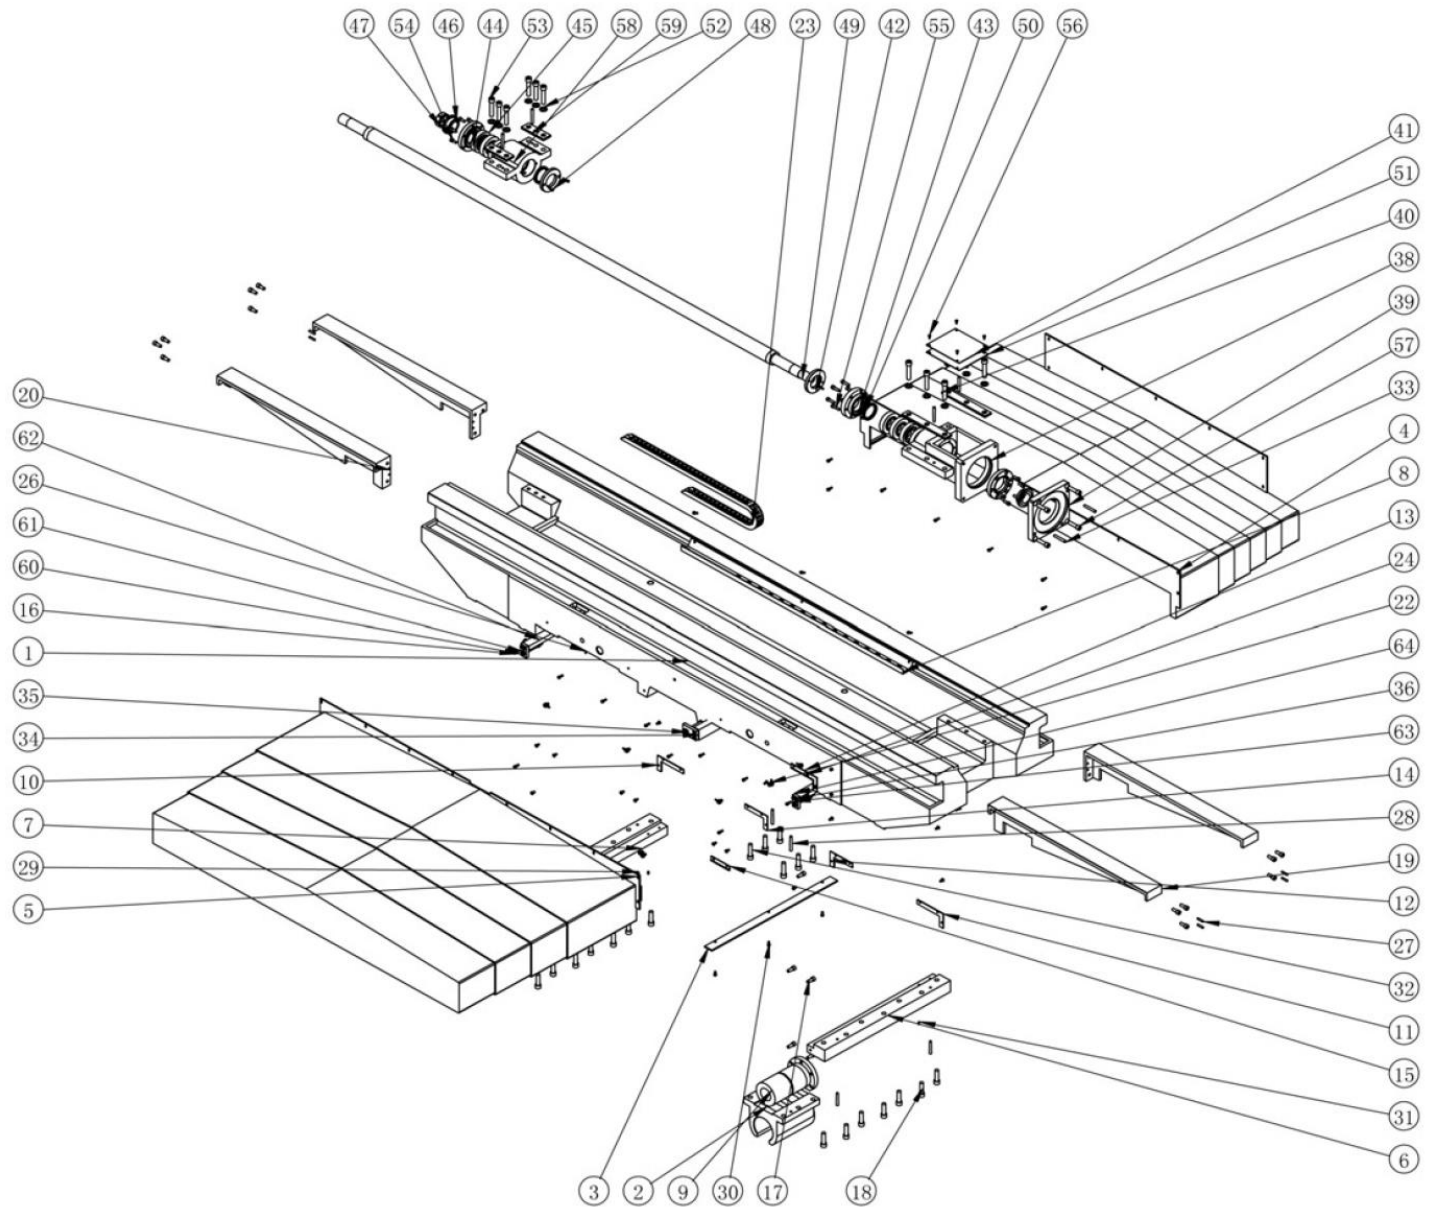


ITEM	PART NAME	QTY
1	Saddle	1
2	Screw nut bed	1
3	Supporting bar for side inlay of Y axis	1
4	Back protection of Y axis	1
5	Front protection of Y axis	1
6	Right clamp plate of Y axis	1
7	Left clamp plate of Y axis	1
8	Guiding slot for oil tube of Y axis	1
9	Screw nut of ball screw	1

10	Scraper on Y axis 1	1
11	Scraper on Y axis 2	2
12	Scraper on Y axis 5	2
13	Scraper on Y axis 6	1
14	Scraper on Y axis 4	1
15	Scraper on Y axis 3	1
16	GB/T70.1-2000(M6*16-12.9)	30
17	GB/T70.1-2000(M10*25-12.9)	17
18	GB/T70.1-2000(M14*50-12.9)	14
19	Left supporting for X axis protection	2
20	Right supporting for X axis protection	2
21	Distributing row	2
22	Right-angle connector	13
23	Towline for oil tube	1
24	M6*12	23
25	1690 Filter of saddle	4
26	Rivet	8
27	GB/T118-2000(6*30)	8
28	GB/T118-2000(8*70)	6
29	M12*10	4
30	GB/T70.1-2000(M6* 12-12.9)	3
31	M6*12	2
32	GB/T70.1-2000(M 14*55-12.9)	6
33	GB/T118-2000(8*60)	6
34	Side inlay of Y axis	1
35	Locating piece of side inlay	1
36	GB/T70.1-2000(M6*30-12.9)	6
37	M6*8	3
38	Motor mounting house	1
39	Motor mounting plate	1
40	Adjusting pad	2
41	Cover for motor mounting house	1
42	Collision chock	2
43	Positioning cover for bearing	1
44	Bearing gland	2
45	Ball screw bearing	7
46	Bearing pressure pad	2
47	YSFM40*1.5	2
48	GB/T70.1-2000(M5*15-12.9)	4
49	X axis ball screw	1
50	Ups-type sealing ring (GB/T3871-1992)	2
51	1690t washer	1
52	Chamfered-type plain washer	12
53	GB/T70.1-2000(M14*70-12.9)	12
54	GB/T70.1-2000(M8*20-12.9)	12
55	GB/T70.1-2000(M8*30-12.9)	6

56	M5*12	4
57	GB/T70.1-2000(M12*45-12.9)	4
58	Bearing box	1
58	Adjusting plate for bearing box	2
60	Stub	3
61	GB/T70.1-2000(M10)	9
62	Y axis inlay	1
63	Positioning bar for inlay	2
64	Y axis inlay.	1


HB-70 TABLE ASSEMBLY DRAWING & PARTS LIST

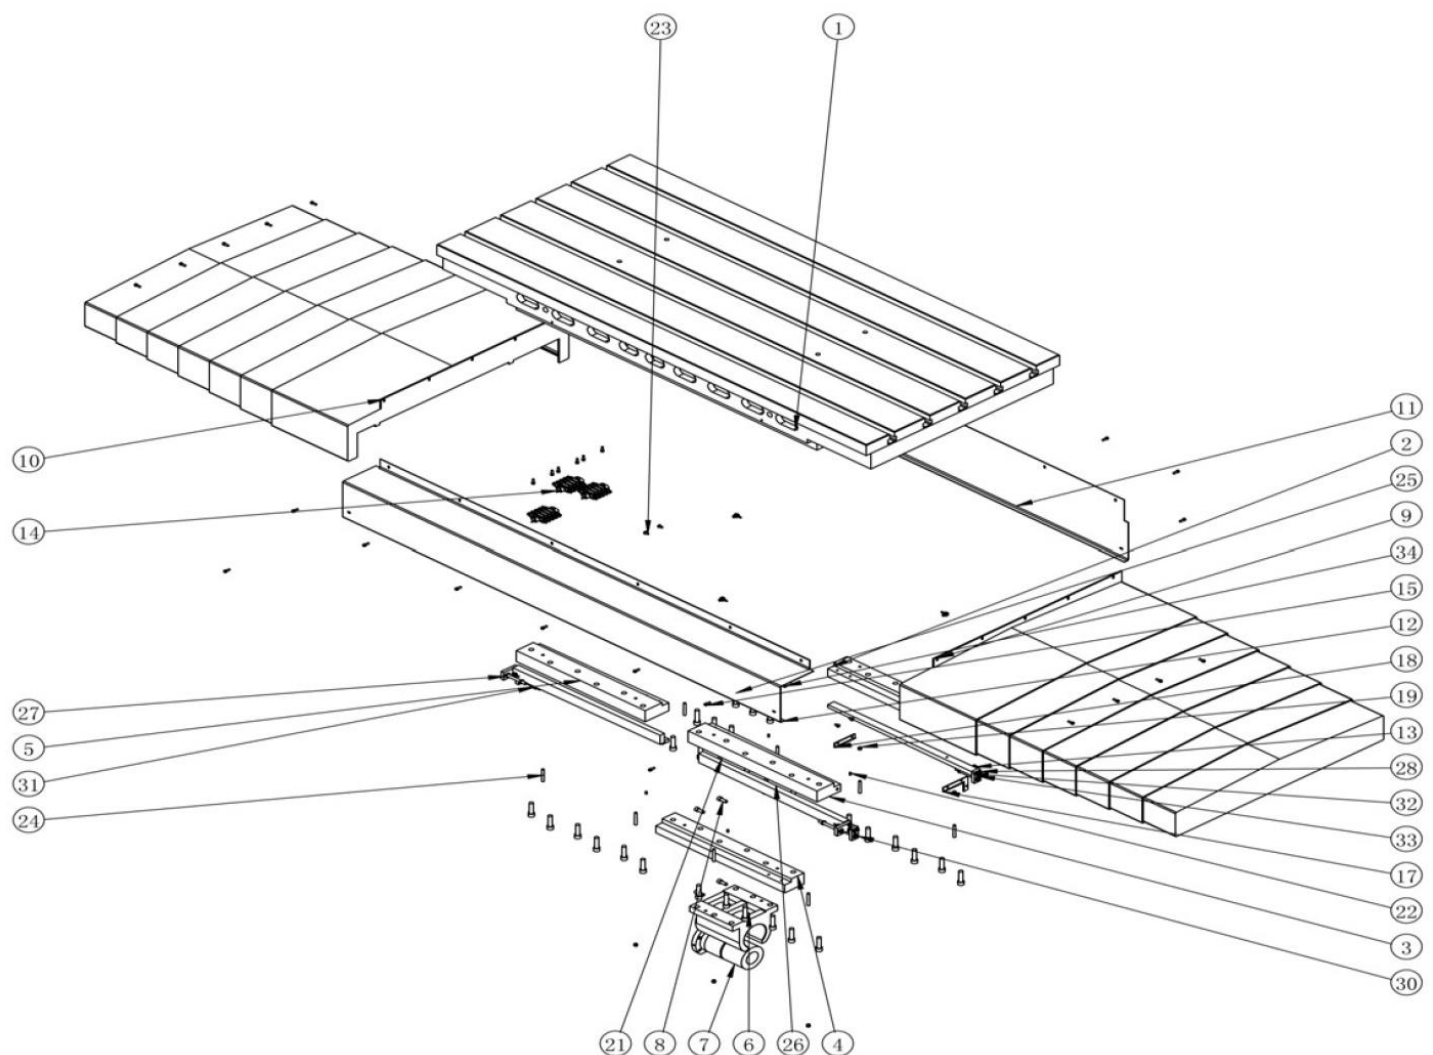

ITEM	PART NAME	QTY
1	Worktable (1890)	1
2	1690 X axis clamp plate	1
3	1690 X axis clamp plate	1
4	1690 X axis clamp plate	1
5	1690 X axis clamp plate	1
6	Screw nut bed	1
7	Ball screw nut	1
8	GB/T70.1-2000 (M10*25-12.9)	5
9	Right protection on X axis	1
10	Left protection on X axis	1
11	Back cover	1
12	Front protection	i
13	Right-angle connector	12
14	Distributing row	3

15	GB/T70.1-2000 (M6*16-12.9)	31
16	Scraper on X axis	1
17	Scraper on X axis	1
18	Scraper on X axis	2
19	M12*10	8
20	GB/T118-2000 (8*70)	2
21	GB/T70.1-2000 (M14*50-12.9)	24
22	M6*12	4
23	M6*12	10
24	GB/TI 18-2000 (8*70)	8
25	GB/T70.1-2000 (M14*55-12.9)	6
26	Side inlay on X axis	2
27	Positioning piece of side inlay	2
28	GB/T70.1-2000 (M6*30-12.9)	12
29	M6*8	6
30	Stub	6
31	GB/T6172-2000 (M10)	18
32	X axis inlay	2
33	Positioning bar for inlay	4
34	X axis inlay	2


HB-70 COLUMN ASSEMBLY DRAWING & PARTS LIST

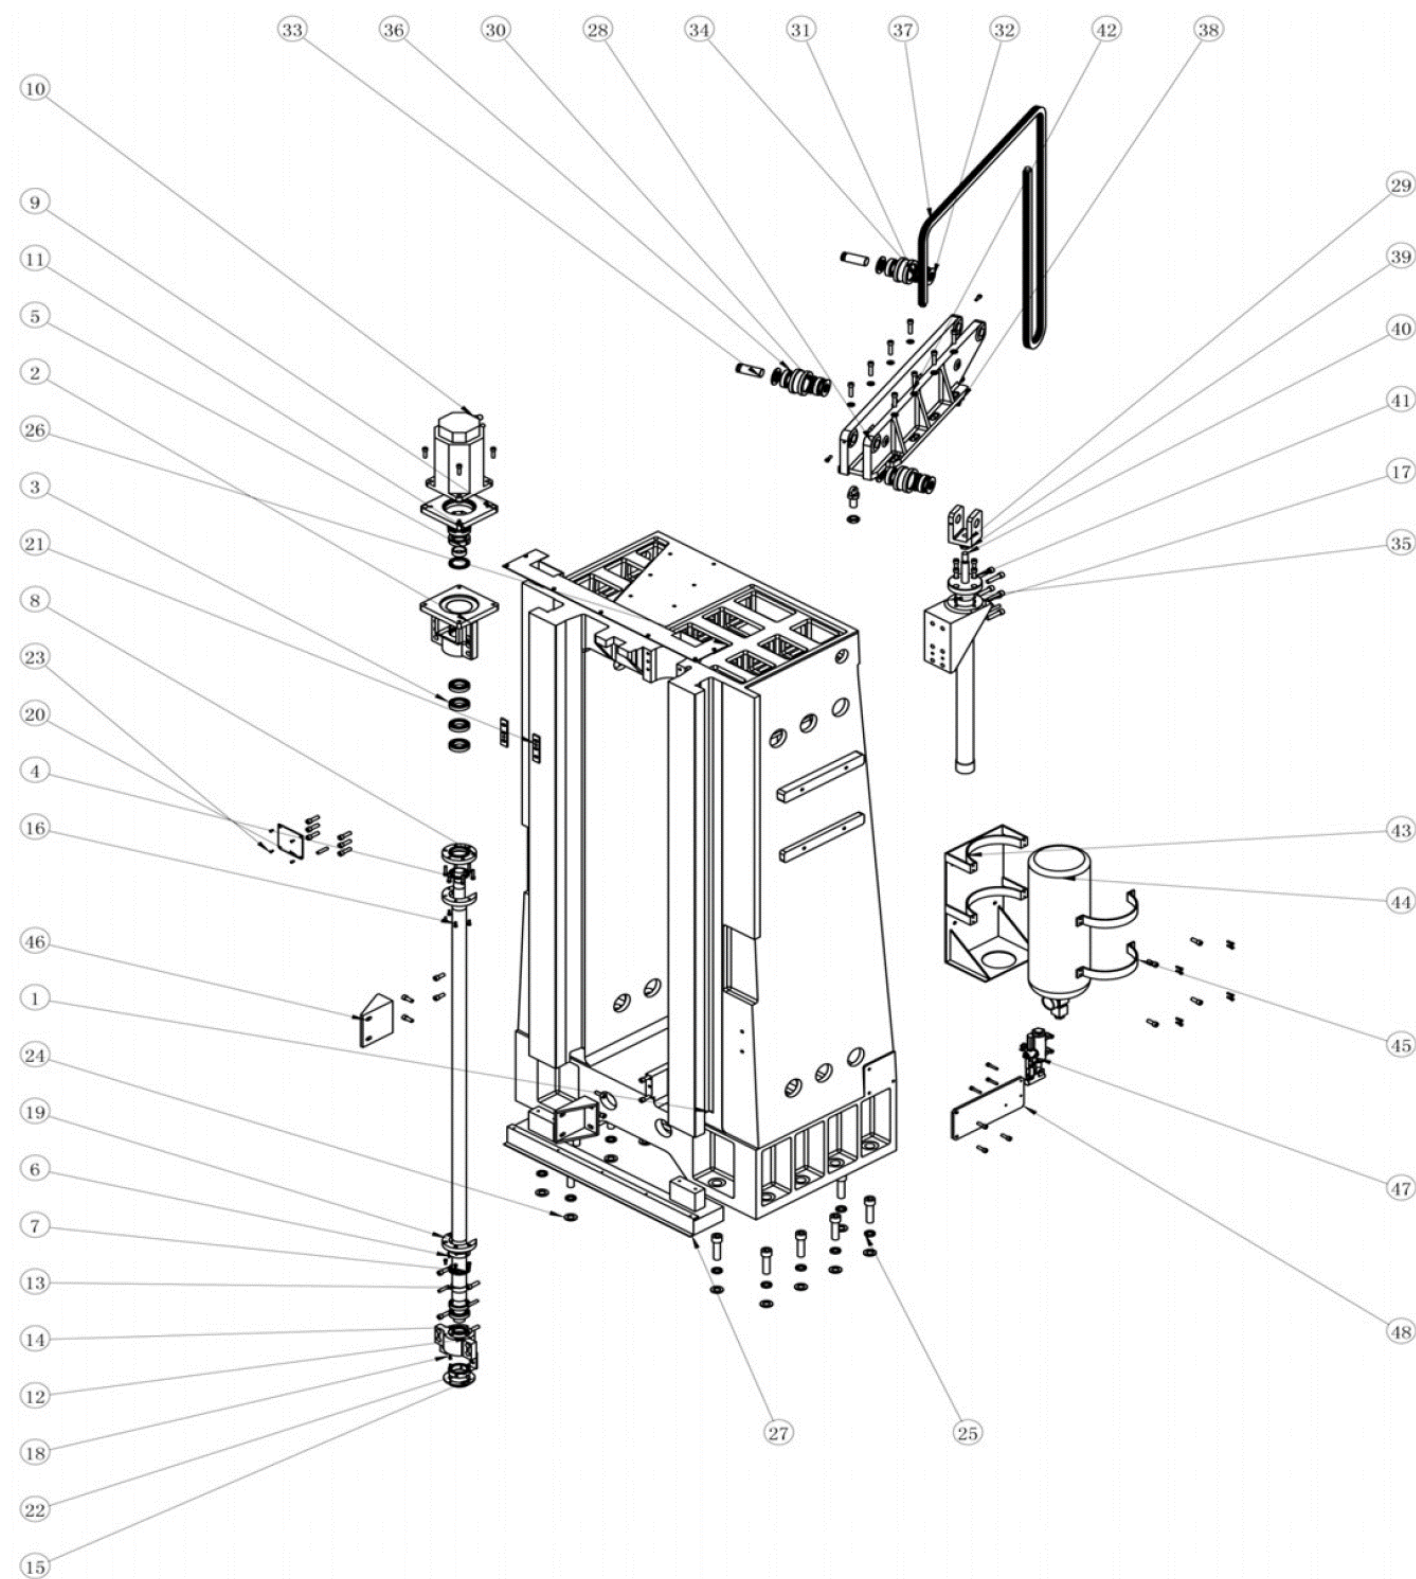

ITEM	PART NAME	QTY
1	Column	1
2	Motor mounting house of Y axis	1
3	Ball screw bearing 1072	6

4	Y axis ball screw	1
5	Ball crew spacer of Y axis 40-50-20	1
6	YSFM40*1.5	3
7	Lips-type sealing ring (GB%13871-1992)	3
8	Pressure cover of motor house	1
9	Motor mounting plate	1
10	Fanuc AC servo motor a22	1
11	BK3-150 coupling	1
12	Pedestal	1
13	X axis ball screw spacer 4045-55-1525	1
14	X axis ball screw spacer 40-50-10	1
15	Cap of bearing house	1
16	GB/T70.1-2000 (M8*40-12.9)	86
17	GB/T118-2000 (10*60)	6
18	M5*14	3
19	Collision block	2
20	Cover of motor house	1
21	Adjusting pad of motor house	2
22	Adjusting pad of bearing house	2
23	M5*12	4
24	Plain washer (Grade A, GB%T97.1-2002)	12
25	GB/T93-1987 (24)	12
26	Upper support of guide bar	1
27	Lower support of guide bar	1
28	Base of guide wheel	1
29	Supporting rack of guide wheel	1
30	Inner spacer of guide wheel	3
31	Outer spacer of guide wheel	3
32	Spacer ring of guide wheel	6
33	Shaft of Guide wheel	3
34	Guide wheel	3
35	Rack of Hydraulic cylinder	1
36	Deep groove ball bearing with dust cover	6
37	Balancing Chain	1
38	Guide wheel seat	2
39	GB/T6172-2000 (24)	3
40	Piston of balancing hydraulic cylinder	1
41	Balancing hydraulic cylinder	1
42	Chamfered plain washer (Grade A, GB%T97.1-2002)	8
43	Rack of nitrogen cylinder	1
44	nitrogen cylinder	1
45	Rack of nitrogen cylinder 2	2
46	Fixing support (for packing)	2
47	Manual Pump	1
48	Mounting plate of manual Pump	1


HB-70 SPINDLE AND QUILL ASSEMBLY

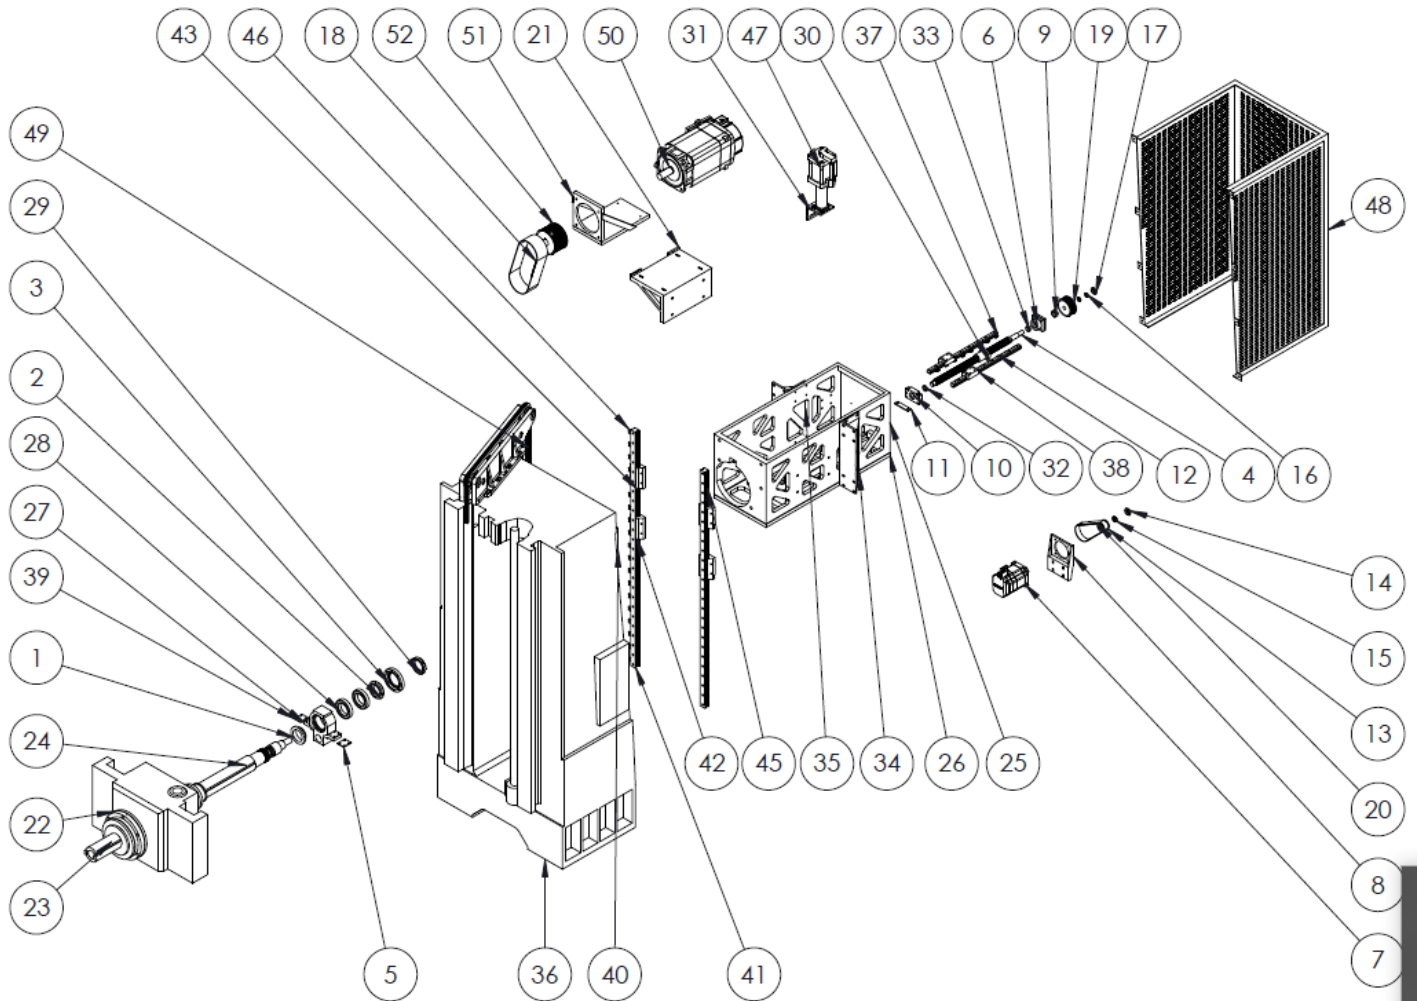

ITEM	Pan Name	Q'TY
1	non-rubbing seal 1	1
2	non-rubbing seal 2	1
3	cover	1
4	ballscrewFDDC 40	1
5	shim	1
6	FK-30 SUPPORT	1
7	1FK7083-5AF71 -1KGO motor	1
8	Bracket-ballscrew motor	1



9	lock nut YSRM30X1.5	1
10	BF-30	1
11	Shim-2	1
12	ramp T1	16
13	pulley-ballscrew motor	1
14	Lock plate 1	1
15	Tap lock 32	2
16	Tap lock 25	2
17	Lock plate 2	1
18	Spindle belt	1
19	Pulley -ballscrew	1
20	Ballscrew belt	1
21	Bracket -spindle motor	1
22	Posa Ram Casting	1
23	Boring spindle-1	1
24	Boring spindle-2	1
25	Box rev_4 - part2	1
26	Box rev_4 - parti	1






HR-70 BUILT-IN ROTARY TABLE DRAWING & PARTS LIST

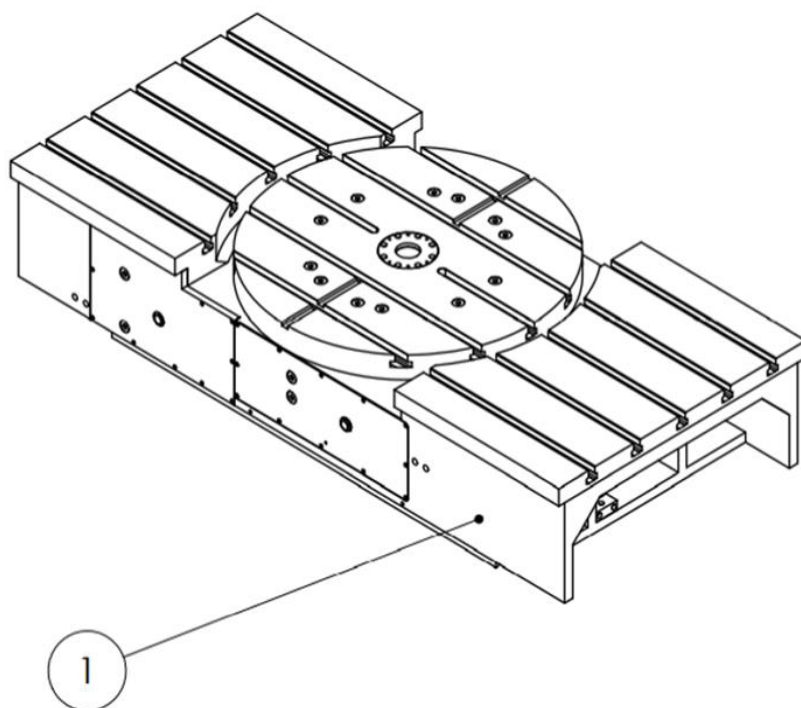

ITEM	PART NAME	QTY
1	Built-in Rotary Table	1

Model		HRT-1000AFY
Table size	mm	1219x1524
Diameter of Center-hole	mm	φ100H7x30
Overall Height	mm	450
Servo Motor Type		SIEMENS 1FK7105
Total Reduction Ratio		1:240
MIN. Increment	degree	0.001°
Max.R.P.M (Motor 2000rpm)		11.1
Indexing Accuracy	sec.	15"
Repeatability Accuracy	sec.	Unidirectional 2"
		Bidirectional 4"
Hydraulic System	kg/cm ²	35
Clamping Torque	kgf · m	1405
MAX. Work Load	kg	5000
MAX. Thrust Load (Table is clamped)	kgf · m	1405
Driving Torque	kgf · m	162
MAX. Work Inertia	kg · m ²	240

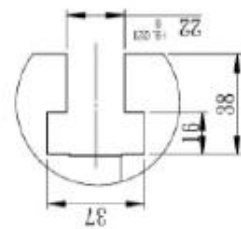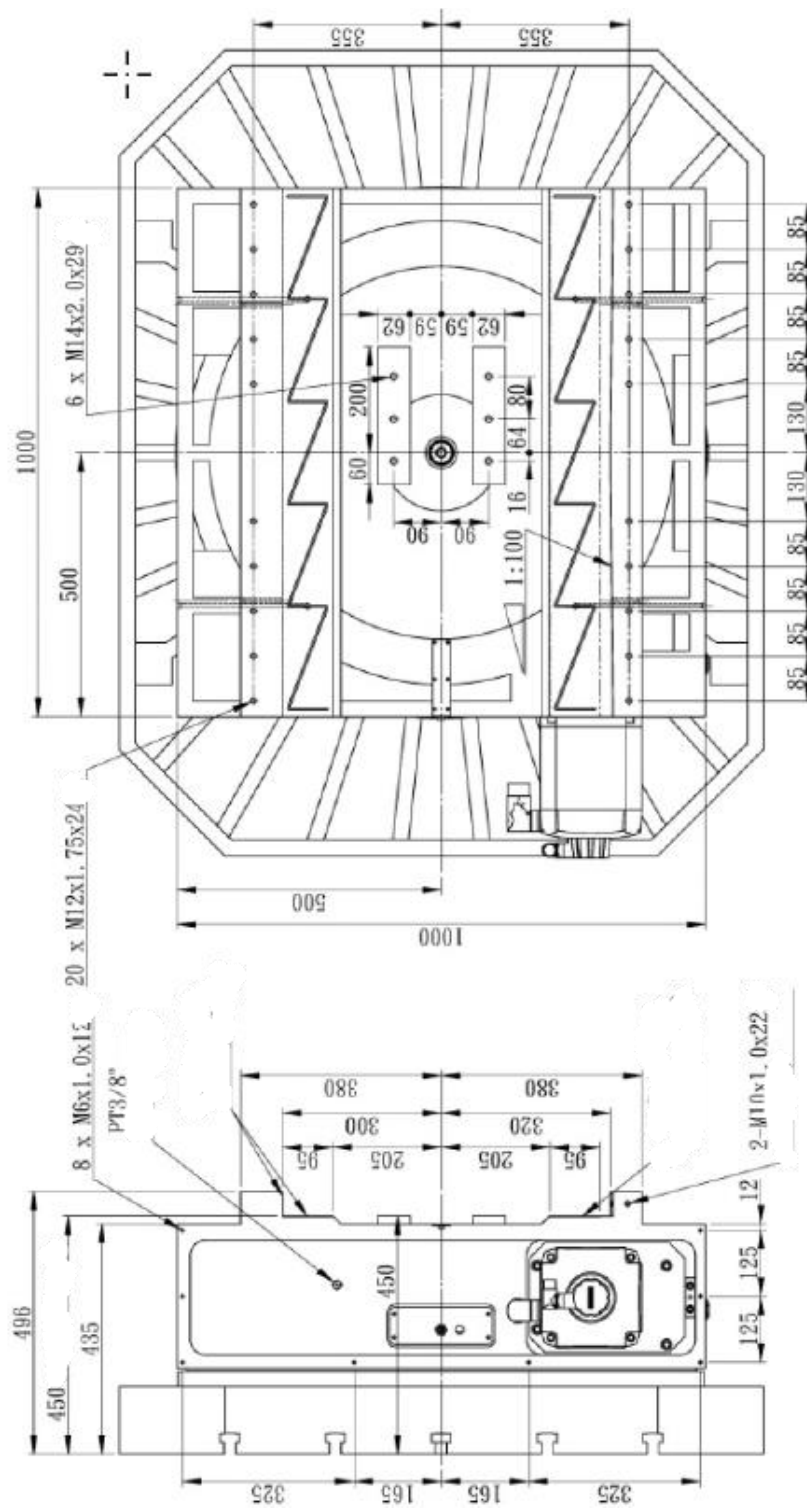

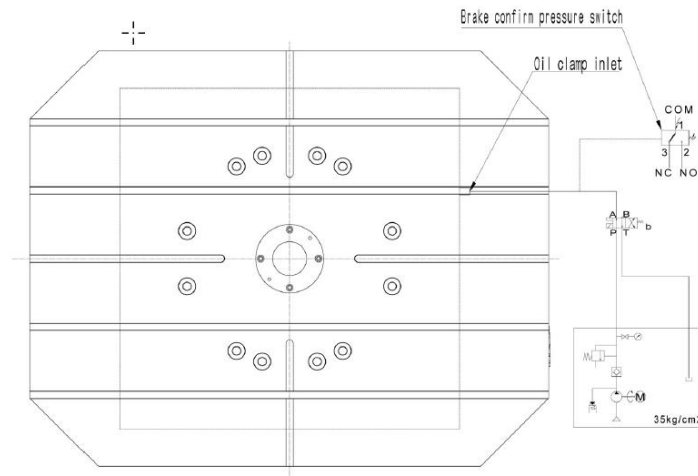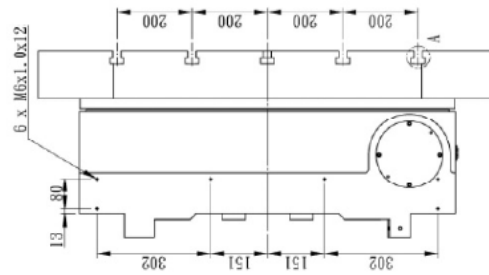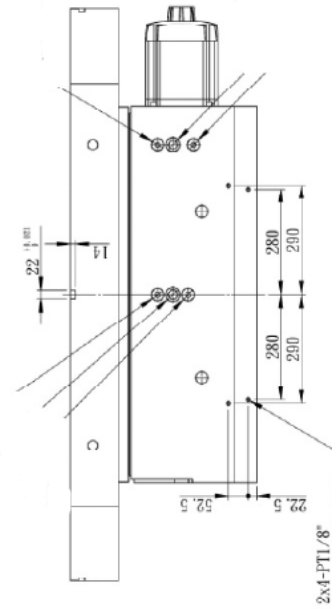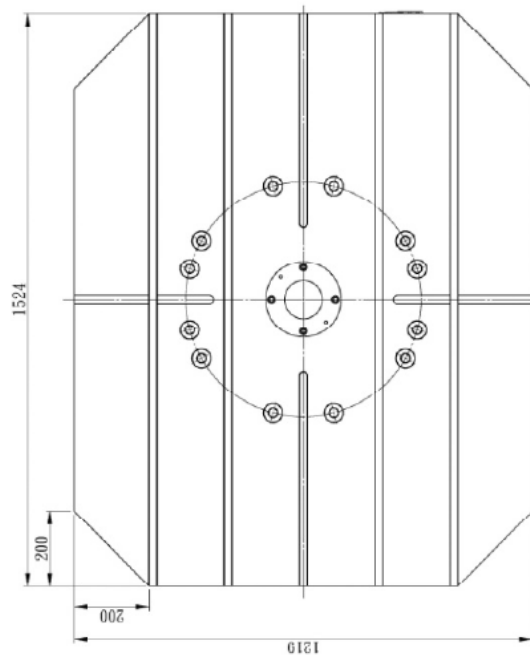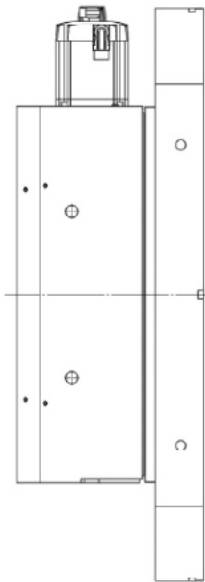

Attention item for install:
 1. Confirm hydraulic solenoid circuit & voltage.
 2. Confirm unclamp & clamp signal.
 3. Solenoid link b point. (When switch on the magnet is unclamp item)


Movement order:
 1. Unclamp signal (delay 1~2 second).
 2. Rotate angle.
 3. Clamp signal (delay 1~2 second).
 4. Workpiece

Lubrication replacement time & condition

- A. Normal operation: Change lubrication per six months.
- B. Continuous operation: Change lubrication per three months.
- C. Machine idle over six months, change lubricates oil before use.

Steps to change lubricates

- A. Draining oil after unscrewing oil outlet screw.
- B. Making sure oil reservoir is clean.
- C. Screwing the oil outlet cover.
- D. Opening oil inlet cover.
- E. Refilling recommended lubricate into oil reservoir.
- F. Be sure the lubricate is over center of oil window.

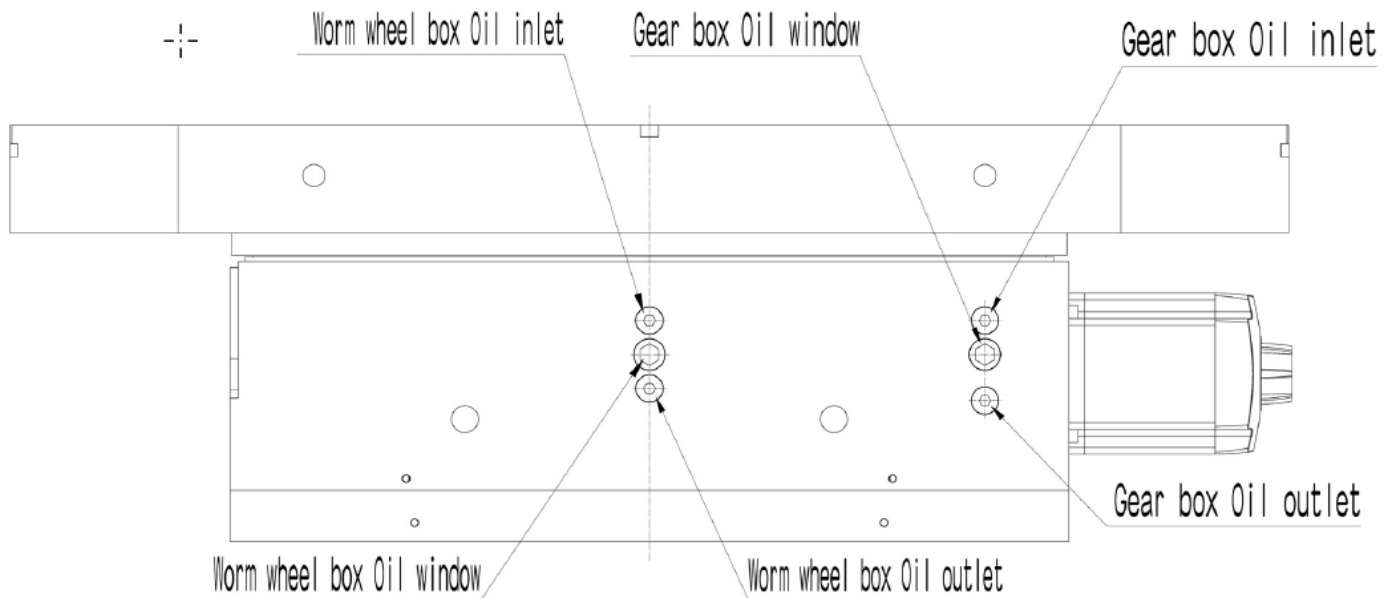

Recommended lubricants: AGMA-4EP, ISO Grade 100-150

CPC HD150

Texaco-Meropa 150

Shell-omela 100

Mobilgear 629


Mobilgear 600 XP150

ISO Grade-100~150

SUS Viscosity- At 210°F 75.5


Check the backlash



1. Turn off power and cut off pneumatic or hydraulic supply.
2. The backlash can be measured with a dial gauge by inserting a flat steel plate into a T-slot of the Rotary table and shaking the periphery there of left and right through the plate with hand.
3. Measure the backlash again and make sure the backlash is between 0.01mm~0.02mm, the adjustment is required when a backlash of above 0.05mm is observed.
4. The measurement is to be done on 8 spots of the table by rotating is every 45°.

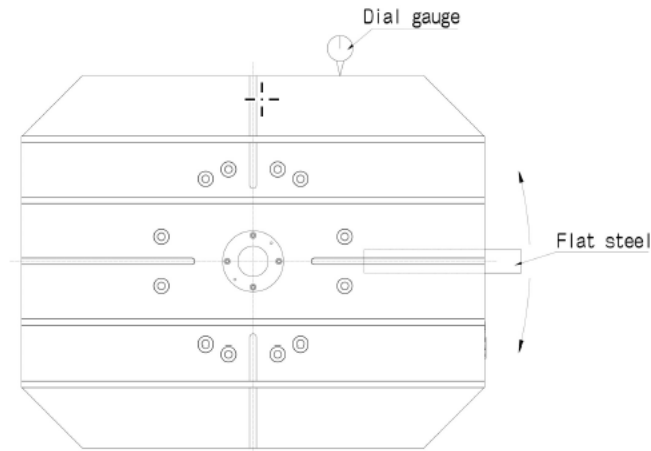

Worm gear and worm wheel backlash adjustment

- A. Loosen the screw(B) and remove the worm shaft top cover.
- B. Loosen the screws (C).
- C. Rotate the Adjust seat by clockwise till the Rotary Table rotating.
- D. Tighten the screws(C).
- E. Repeat the backlash check process again and to make sure the backlash is between 0.01 mm-0.02mm. If not, please re-try step A ~ E.
- F. Reinstall the worm shaft top cover after backlash adjusts successfully.

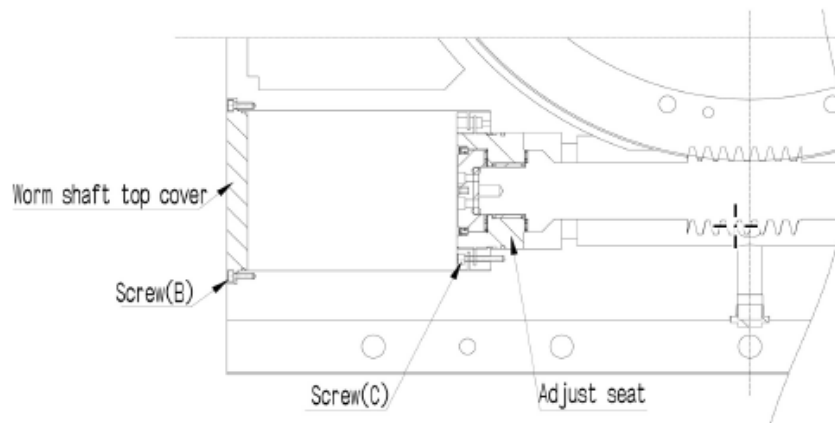

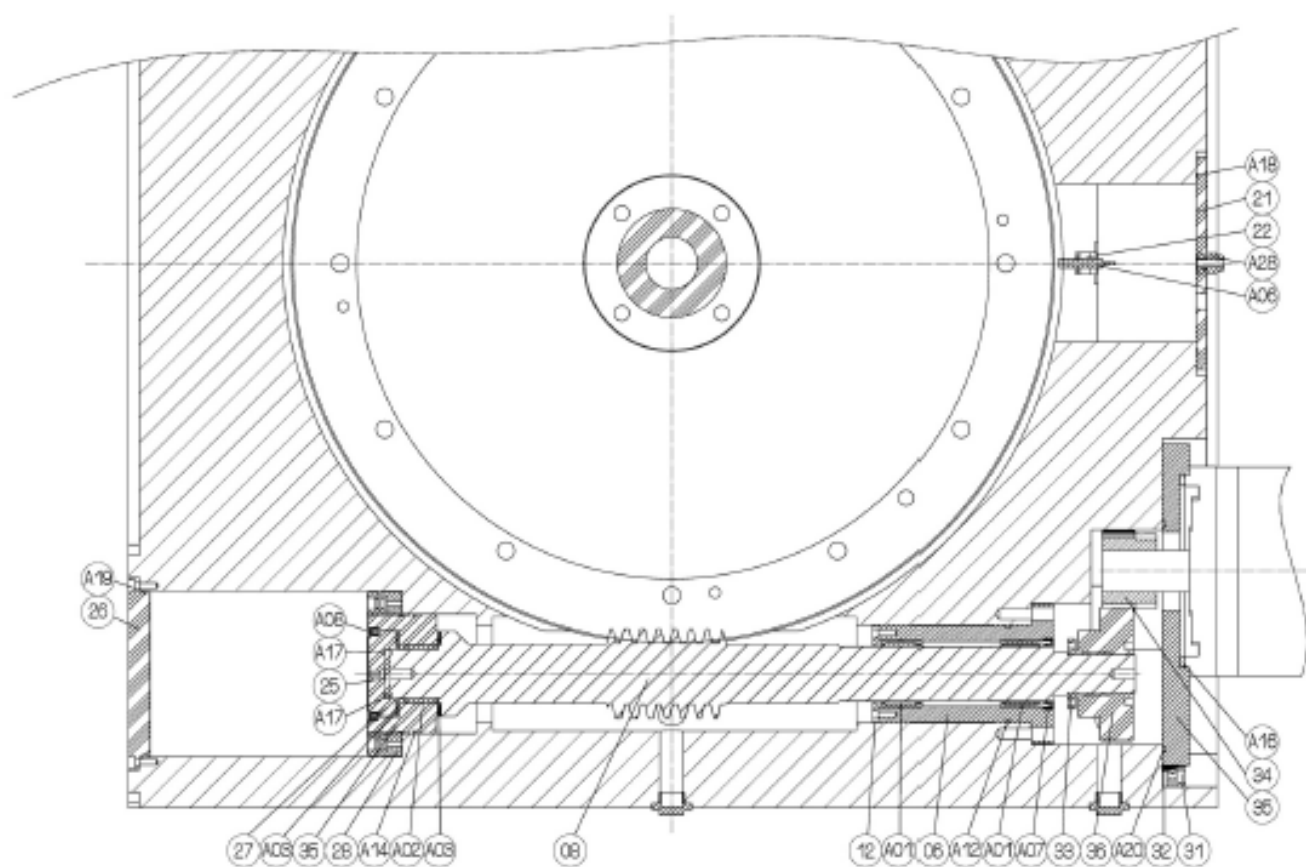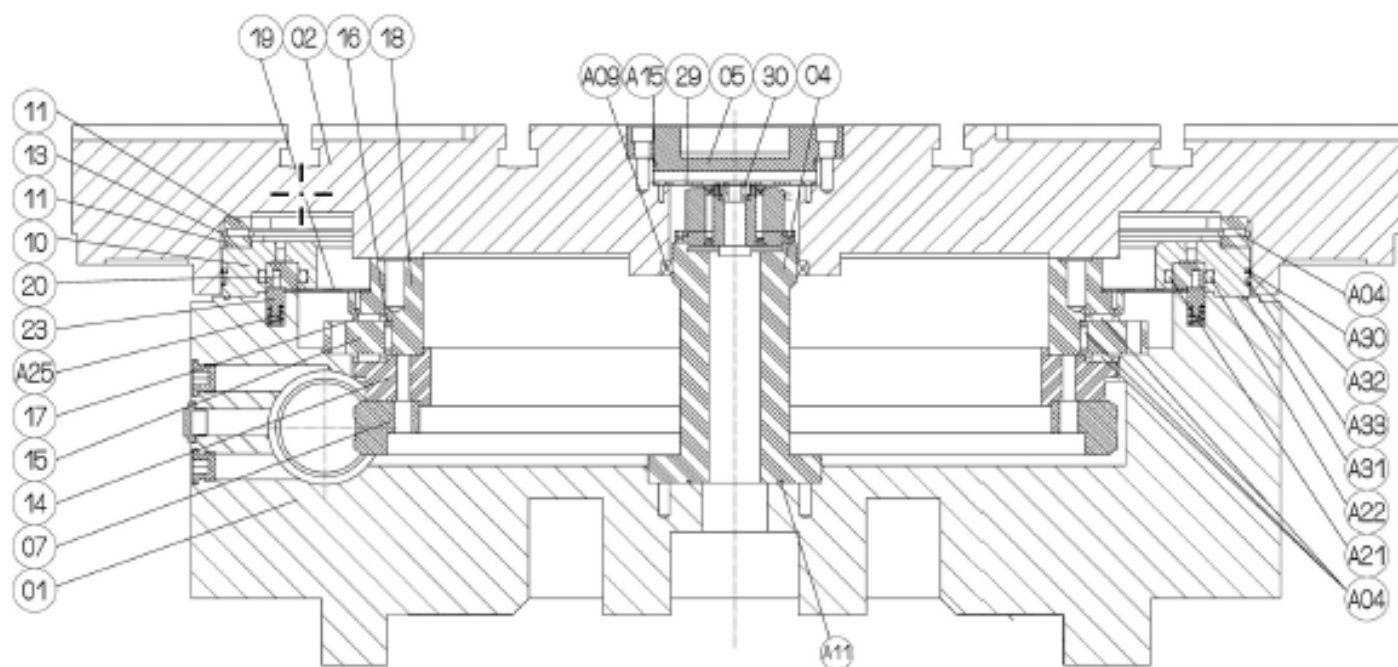

No.	Description	Q'ty	Material	Drawing No.	Drawing No.	Remark
01	Base	1	FC30	29570100100xx	HRT1000AFY-001 -00-xx	
02	Work table	1	FC30	29570100200XX	HRT1000AFY -002-00-xx	
03	Cover	1	SS41	29570100900XX	HRT1000AFY -009-00-xx	
04	Fixed seat	1	S45C	29500101900XX	HRT1000-019-00-xx	
05	Center sleeve	1	S45C	29500100400XX	HRT1000-004-00-xx	
06	Rolling wheel block	1	S45C	29500100500XX	HRT1000-005-00-xx	
07	Worm wheel	1	ALBC3	29500100900XX	HRT1000-009-00-xx	
08	Worm shaft	1	SNM21	29500101000xx	HRT1000-010-00-xx	
09	Dog	1	SS41	29500101400XX	HRT1000-014-00-xx	
10	Compression hng	1	SS41	29532700300XX	HRT1000HT-003-00-xx	
11	Bearing washer	24	SCM415	29532700400XX	HRT1000HT-004-00-XX	
12	Blank	1	SS41	29532700600XX	HRT1000HT-006-00-xx	
13	Needle ball retainer	1	SS41	29532701200XX	HRT1000HT-012-00-xx	
14	Bearing compress ring	1	SCM440	29636100500XX	APCR1000P-005-00-XX	
15	Bearing ring	1	SCM440	29636100600XX	APCR1000P-006-00-XX	
16	Needle ball retainer	1	SS41	29636100700XX	APCR1000P-007-00-XX	
17	Needle ball retainer	2	SS41	29636100800XX	APCR1000P-008-00-XX	
18	Spindle	1	SCM440	29636100900XX	APCR1000P-009-00-XX	
19	Brake disk	1	SUS301	29636101000xx	APCR1000P-010-00-xx	
20	Piston	1	S45C	29636101100xx	APCR1000P-011-00-xx	
21	Zero point cover	1	SS41	29559102700XX	H RT400A-027-00-XX	
22	Bracket	1	SS41	29553900500XX	HRT800HC-005-00-XX	
23	Top pin	16	S45C	21034102300XX	CNC630R-023-00-XX	
24	Adjust seat	1	S45C	21034102501XX	CNC630R-025-01 -XX	
25	Washer	1	S45C	21034102601XX	CNC630R-026-01 -XX	
26	Worm gear cover	1	SS41	21034102800XX	C NC630R-028-00-XX	
No.	Description	Q'ty	Material	Drawing No.	Drawing No.	Remark
27	Compression ring	1	SCM440	21034103700xx	CNC630R-037-00-xx	
28	Lock nut	1	S45C	21034103800xx	CNC630R-038-00-xx	
29	Fixed plate	1	S45C	21035702300xx	CNC1200HV-023-00-xx	
30	Hydraulic cylinder	1	SS41	21035702400xx	CNC1200HV-024-00-xx	
31	Slanting wedge	1	S45C	20000160600xx	T1606-00-xx	
32	Slanting wedge	1	S45C	20000160700xx	T1607-00-xx	
33	Topper sleeve	1	S45C	21033402500xx	CNC320R-025-00-xx	
34	Gear	1	SCM21	21034103004xx	CNC630R-030-04-xx	
35	Motor fixed plate	1	SS41	29500100700xx	HRT1000-007-00-xx	
36	Gear	1	SCM415	29636102400xx	APCR1000P-024-00-xx	

NO.	Description	Specification	Q'ty	Use	Remark
A01	Needle bearing	TAF506235	2		
A02	Needle bearing	KT455330	1		
A03	Needle bearing	NTB5578	2		
A04	Bearing pin	φ 7x20L	540		
A05	Pressure switch	APSD-40-1	1		
A06	Sensor	BES M08MG-UOC20B-BV03	1		
A07	Oil seal	TC50x65x10	1		
A08	Oil seal	TC70x85x8	1		
A09	Oil seal	TC115x135x13	1		
A10	O-ring	P11	1		
A11	O-ring	G80	1		
A12	O-ring	G85	1		
A14	O-ring	G105	1		
A15	O-ring	G145	1		
A16	O-ring	G170	1		
A17	O-ring	AS568-029	2		
A18	O-ring	AS568-159	1		
A19	O-ring	AS568-162	1		
A20	O-ring	AS568-262	1		
A21	O-ring	V-790	1		
A22	O-ring	V-880	1		
A23	Eye bolts	M36xP4.0	4		
A24	Oil window	PF3/4	2		
A25	Coil spring	TM16-25	16		
A26	Hexagon oil stopper	1-1/4"PF	12		
A27	Hexagon oil stopper	3/4"PF	4		
A28	Polyester cable glang	MGB12S-03-ST	1		
A29	Muffler	3/8"	1		
A30	Wearable piece	4*2.5*2966L	1		
NO.	Description	Specification	Q'ty	Use	Remark
A31	Oil wicker	φ 3*2947L	1		
A32	Oil wicker	φ 3*2969L	1		
A33	V-ring	2950L	1		